

The Commonwealth of Massachusetts  
Executive Office of Health and Human Services  
Department of Public Health  
Bureau of Climate and Environmental Health  
Division of Environmental Health Regulations and Standards

**Maura T. Healey**  
Governor

**Kimberley Driscoll**  
Lieutenant Governor

67 Forest Street, Suite # 100  
Marlborough, MA 01752  
617-624-6000 | mass.gov/dph

**Kiame Mahaniah, MD, MBA**  
Secretary

**Robert Goldstein, MD, PhD**  
Commissioner

January 15, 2026

To:	Shawn Jenkins, Commissioner, Department of Corrections	(electronic copy)
	Kathleen E. Walsh, Secretary, Executive Office of Health and Human Services	(electronic copy)
	Clerk, Massachusetts House of Representatives	(electronic copy)
	Clerk, Massachusetts Senate	(electronic copy)
	Tyler Crocker, Environmental Health and Safety Officer	(electronic copy)

Greetings,


Pursuant to 105 CMR 451.403, please find the inspection report for Suffolk County Jail, the Plan of Correction (POC) from the facility and the POC acceptance letter from the Division of Environmental Health Regulations and Standards (EHRS).

Sincerely,

*Hannah LeBeau*

Hannah LeBeau  
Environmental Health Inspector, EHRS, BCEH

Cc:	Robert Goldstein, MD, PhD, Commissioner, DPH	(electronic copy)
	Terrence Reidy, Secretary, Executive Office of Public Safety and Security	(electronic copy)
	Daniel J. Prendergast, Assistant Commissioner ISD/ Health Division, City of Boston	(electronic copy)
	Brianna Arruda, Director, Policy Development and Compliance Unit	(electronic copy)
	Jose Mojica, Superintendent	(electronic copy)

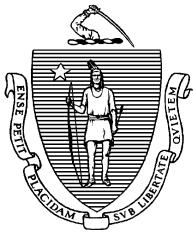

# The Commonwealth of Massachusetts

Executive Office of Health and Human Services

Department of Public Health

Bureau of Climate and Environmental Health

Division of Environmental Health Regulations and Standards

67 Forest Street, Suite # 100 Marlborough, MA 01752

617-624-6000 | [mass.gov/dph](http://mass.gov/dph)

**Maura T. Healey**

Governor

**Kimberley Driscoll**

Lieutenant Governor

**Kiame Mahaniah, MD, MBA**

Secretary

**Robert Goldstein, MD, PhD**

Commissioner

November 20, 2025

Steven W. Tompkins, Sheriff

Suffolk County Sheriff's Department

20 Bradston Street

Boston, MA 02118

(electronic copy)

Re: Facility Inspection – Suffolk County Jail, Boston

Dear Sheriff Tompkins:

The Massachusetts Department of Public Health (Department) Division of Environmental Health Regulations and Standards (EHRS) conducted an inspection of the Suffolk County Jail on November 3, 2025, accompanied by Sergeant Tyler Crocker, Environmental Health and Safety Officer, and Lieutenant Brittany Carroll, in accordance with Department regulations 105 CMR 451.000: Minimum Health and Sanitation Standards and Inspection Procedures for Correctional Facilities.

The inspection identified 149 total deficiencies: 81 new deficiencies under the Required Standards (.100 and .200 series), 30 repeat deficiencies under the Required Standards, 31 new deficiencies under the Recommended Standards (.300 series), and 7 repeat deficiencies under the Recommended Standards.

## Overview

**Section 1** provides details of all deficiencies, including repeat deficiencies, found during the inspection. These are categorized by Required Standards, Recommended Standards, or additional applicable regulatory standards.

**Section 2** provides information on areas that EHRS found to be compliant.

**Section 3** documents the areas that EHRS did not inspect.

**Section 4** provides information on submitting a Plan of Correction for the identified violations.

**Section 5** outlines observations and recommendations related to the inspection.

## SECTION 1: Health and Safety Deficiencies

### **Entry Level (Outside)**

#### **Deficiencies under the Required Standards (.100 and .200 series)**

1 repeat deficiency (indicated by an \*) was found during the inspection:

1. Female Bathroom	105 CMR 451.123*	Maintenance: Wall tile damaged under handwash sink # 2
--------------------	------------------	--

### **Housing Units**

#### **Deficiencies under the Required Standards (.100 and .200 series)**

77 new deficiencies and 25 repeat deficiencies (indicated by an \*) were found during the inspection:

1. Staff Bathroom 6-1 and 6-2		105 CMR 451.123	Maintenance: Ceiling vent dusty
2. Unit 6-1A	Cells	105 CMR 451.103	Mattresses: Mattress damaged in cell # 1
3. Unit 6-1	Shower # 617 – Bottom Tier, Left Side	105 CMR 451.123*	Maintenance: Door frame rusted
4. Unit 6-1	Shower # 617 – Bottom Tier, Left Side	105 CMR 451.123*	Maintenance: Door paint damaged
5. Unit 6-1	Shower # 617 – Bottom Tier, Left Side	105 CMR 451.130*	Plumbing: Plumbing not maintained in good repair, drain cover damaged
6. Unit 6-1	Shower # 617 – Bottom Tier, Left Side	105 CMR 451.123*	Maintenance: Ceiling surface damaged
7. Unit 6-1	Shower # 617 – Bottom Tier, Left Side	105 CMR 451.123*	Maintenance: Light shield rusted
8. Unit 6-1	Shower # 617 – Bottom Tier, Left Side	105 CMR 451.123	Maintenance: Sprinkler shroud rusted
9. Unit 6-1	Shower # 617 – Bottom Tier, Left Side	105 CMR 451.123	Maintenance: Ceiling dirty
10. Unit 6-1	Shower # 618 – Bottom Tier, Right Side	105 CMR 451.123*	Maintenance: Ceiling dirty
11. Unit 6-1	Shower # 618 – Bottom Tier, Right Side	105 CMR 451.123*	Maintenance: Door frame rusted
12. Unit 6-1	Shower # 618 – Bottom Tier, Right Side	105 CMR 451.123*	Maintenance: Door paint damaged
13. Unit 6-1	Shower # 618 – Bottom Tier, Right Side	105 CMR 451.123	Maintenance: Walls dirty
14. Unit 6-1	Shower # 618 – Bottom Tier, Right Side	105 CMR 451.123	Maintenance: Ceiling vent dusty outside showers
15. Unit 6-1	Shower # 711 - Top Tier, Left Side	105 CMR 451.123*	Maintenance: Ceiling paint damaged
16. Unit 6-1	Shower # 711 - Top Tier, Left Side	105 CMR 451.123*	Maintenance: Door paint damaged
17. Unit 6-1	Shower # 712 - Top Tier, Right Side	105 CMR 451.123	Maintenance: Door paint damaged
18. Unit 6-1	Shower # 712 - Top Tier, Right Side	105 CMR 451.123	Maintenance: Door frame rusted
19. Unit 6-1	Cells	105 CMR 451.103*	Mattresses: Mattress cover missing in cell # 19

20.	Unit 6-1	Cells	105 CMR 451.103	Mattresses: Mattress damaged in cell # 25, 28, 31, and 38
21.	Unit 6-3	Kitchenette	105 CMR 451.126	Hot Water for Bathing and Hygiene: No hot water supplied to handwash sink
22.	Unit 6-3	Kitchenette	105 CMR 451.200	Food Storage, Preparation and Service: Food preparation not in compliance with 105 CMR 590.000, interior of microwave oven dirty
23.	Unit 6-3	Shower # 63E	105 CMR 451.123	Maintenance: Metal panel on wall dirty
24.	Unit 6-3	Shower # 63H	105 CMR 451.123	Maintenance: Light out
25.	Unit 6-3	Shower # 63I	105 CMR 451.123*	Maintenance: Walls dirty
26.	Unit 6-3	Cells	105 CMR 451.103	Mattresses: Mattress damaged in cell # 3, 8, and 11
27.	Unit 6-3	Cells	105 CMR 451.103	Mattresses: Mattress cover missing in cell # 18
28.	Unit 6-4	Common Area	105 CMR 451.200*	Food Storage, Preparation and Service: Food preparation not in compliance with 105 CMR 590.000, interior of microwave oven dirty
29.	Unit 6-4	Kitchenette	105 CMR 451.130*	Plumbing: Plumbing not maintained in good repair, handwash sink leaking
30.	Unit 6-4	Kitchenette	105 CMR 451.200*	Food Storage, Preparation and Service: Food preparation not in compliance with 105 CMR 590.000, interior of microwave oven dirty
31.	Unit 6-4	Shower # 64G	105 CMR 451.123	Maintenance: Shower curtain missing
32.	Unit 6-4	Shower # 64H	105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, shower leaking
33.	Unit 6-4	Shower # 64H	105 CMR 451.123	Maintenance: Light shield rusted
34.	Unit 6-4	Shower # 64H	105 CMR 451.123	Maintenance: Ceiling dirty
35.	Unit 6-4	Shower # 64I	105 CMR 451.123*	Maintenance: Light shield rusted
36.	Medical Housing Unit	Shower # 55 C	105 CMR 451.123	Maintenance: Walls dirty
37.	Psychiatric Housing Unit # 5552	Shower # 55A	105 CMR 451.123	Maintenance: Ceiling dirty
38.	Psychiatric Housing Unit # 5552	Shower # 55A	105 CMR 451.123	Maintenance: Door frame rusted
39.	Psychiatric Housing Unit # 5552	Slop Sink Room # 5572	105 CMR 451.130*	Plumbing: Plumbing not maintained in good repair, drain cover missing
40.	Control 4-1 & 4-2	Staff Bathroom 4-1 & 4-2	105 CMR 451.123*	Maintenance: Ceiling vent dusty
41.	Unit 4-1	Shower # 41K	105 CMR 451.123	Maintenance: Floor drain dirty
42.	Unit 4-1	Shower # 41K	105 CMR 451.123	Maintenance: Shower curtain missing
43.	Unit 4-1	Cells	105 CMR 451.103	Mattresses: Mattress damaged in cell # 19, 22, 26, 31, and 32
44.	Unit 4-1	Cells	105 CMR 451.103	Mattresses: Mattress cover missing in cell # 4, 21, 23, 26, and 33
45.	Unit 4-2	Kitchenette	105 CMR 451.200*	Food Storage, Preparation and Service: Food preparation not in compliance with 105 CMR 590.000, interior of microwave oven dirty

46.	Unit 4-2	Slop Sink Room # 42C	105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, slop sink leaking
47.	Unit 4-2	Shower # 42D	105 CMR 451.123	Maintenance: Sprinkler shroud rusted
48.	Unit 4-2	Shower # 42E (near cell # 15)	105 CMR 451.123*	Maintenance: Walls dirty
49.	Unit 4-2	Shower # 42E (near cell # 15)	105 CMR 451.123*	Maintenance: Floor dirty
50.	Unit 4-2	Shower # 42E (near cell # 15)	105 CMR 451.123*	Maintenance: Debris on floor
51.	Unit 4-2	Cells	105 CMR 451.103	Mattresses: Mattress damaged in cell # 14
52.	Unit 4-2	Cells	105 CMR 451.103	Mattresses: Mattress cover missing in cell # 4 and 15
53.	Unit 4-3	Shower # 43G	105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, shower leaking
54.	Unit 4-3	Shower # 43G	105 CMR 451.123	Maintenance: Rust on sprinkler shroud
55.	Unit 4-3	Shower # 43G	105 CMR 451.123	Maintenance: Ceiling dirty
56.	Unit 4-3	Shower # 43G	105 CMR 451.123	Maintenance: Curtain dirty
57.	Unit 4-3	Shower # 43G	105 CMR 451.123	Maintenance: Excessive condensation observed on ceiling
58.	Unit 4-3	Shower # 43H	105 CMR 451.123	Maintenance: Soap scum on metal panel on wall
59.	Unit 4-3	Shower # 43H	105 CMR 451.123	Maintenance: Excessive condensation observed on ceiling
60.	Unit 4-3	Shower # 43I (near cell # 20)	105 CMR 451.123*	Maintenance: Walls dirty
61.	Unit 4-3	Shower # 43I (near cell # 20)	105 CMR 451.123	Maintenance: Curtain dirty
62.	Unit 4-3	Shower # 43E	105 CMR 451.123	Maintenance: Curtain dirty
63.	Unit 4-3	Shower # 43E	105 CMR 451.123	Maintenance: Wall paint damaged
64.	Unit 4-4	Kitchenette	105 CMR 451.130*	Plumbing: Plumbing not maintained in good repair, handwash sink leaking
65.	Unit 4-4	Kitchenette	105 CMR 451.200*	Food Storage, Preparation and Service: Food preparation not in compliance with 105 CMR 590.000, interior of microwave oven dirty
66.	Unit 4-4	Shower # 44J (near Visiting Rooms)	105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, floor drain cover not secure
67.	Unit 4-4	Shower # 44I (near cell # 28)	105 CMR 451.123	Maintenance: Floor dirty
68.	Unit 4-4	Shower # 44I (near cell # 28)	105 CMR 451.123	Maintenance: Walls dirty
69.	Unit 4-4	Shower # 44I (near cell # 28)	105 CMR 451.123	Maintenance: Ceiling dirty
70.	Unit 4-4	Shower # 44B	105 CMR 451.123	Maintenance: Walls dirty
71.	Unit 4-4	Cells	105 CMR 451.103	Mattresses: Mattress cover missing in cell # 1, 6, 9, 10, 13, 14, 32, and 36
72.	File Room Kitchen # 3516		105 CMR 451.200	Food Storage, Preparation and Service: Food storage not in compliance with 105 CMR 590.000, snap traps observed in kitchen area
73.	Education	Bathroom # 3521	105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, no water supplied to handwash sink

74.	Male Staff Bathroom # 2034	105 CMR 451.123	Maintenance: Ceiling vent dusty	
75.	Unit 2-1	Shower # 21B	105 CMR 451.123	Maintenance: Ceiling dirty
76.	Unit 2-1	Shower # 21D	105 CMR 451.123	Maintenance: Wall paint damaged
77.	Unit 2-1	Shower # 21D	105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, drain cover damaged
78.	Unit 2-2	Shower # 22I (near cell # 32)	105 CMR 451.123	Maintenance: Face plate missing around push button
79.	Unit 2-4	Shower # 24J (near visiting rooms)	105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, shower leaking
80.	Unit 2-4	Shower # 24J (near visiting rooms)	105 CMR 451.123	Maintenance: Drain flies observed
81.	Unit 2-4	Shower # 24J (near visiting rooms)	105 CMR 451.123	Maintenance: Mold on walls

#### Deficiencies under the Recommended Standards (.300 series)

30 new deficiencies and 7 repeat deficiencies (indicated by an \*) were found during the inspection:

1.	Control 6-1 & 6-1A	105 CMR 451.353*	Interior Maintenance: Area around ceiling vent dusty	
2.	Control 6-1 & 6-1A	105 CMR 451.350	Structural Maintenance: Window cracked	
3.	Unit 6-1A	Storage Room # 61G	105 CMR 451.353*	Interior Maintenance: Rodent droppings observed
4.	Unit 6-1A	Storage Room # 61G	105 CMR 451.353	Interior Maintenance: Objectionable odor observed
5.	Unit 6-1	Kitchenette	105 CMR 451.353	Interior Maintenance: Rodent droppings observed
6.	Unit 6-1	Second Floor Storage Room	105 CMR 451.353	Interior Maintenance: Rodent droppings observed
7.	Unit 6-1	Cells	105 CMR 451.353	Interior Maintenance: Mold on ceiling in cell # 31
8.	Control 6-3 & 6-4	105 CMR 451.353	Interior Maintenance: Light shield missing	
9.	Unit 6-3	Kitchenette	105 CMR 451.353*	Interior Maintenance: Rodent droppings observed
10.	Unit 6-3	Meeting Room # 63B	105 CMR 451.353	Interior Maintenance: Rodent droppings observed
11.	Unit 6-3	Meeting Room # 63B	105 CMR 451.353	Interior Maintenance: Ceiling vent dusty outside of Meeting Room
12.	Unit 6-4	Kitchenette	105 CMR 451.353	Interior Maintenance: Electric hand dryer out-of-order
13.	Unit 6-4	Kitchenette	105 CMR 451.353	Interior Maintenance: Soap dispenser damaged
14.	Visiting Rooms		105 CMR 451.353	Interior Maintenance: Floor dirty in room # 501
15.	Visiting Rooms		105 CMR 451.353	Interior Maintenance: Ceiling tile missing in room # 504
16.	Medical Area	Biohazard Storage # 5507	105 CMR 451.353	Interior Maintenance: Rodent droppings observed
17.	Psychiatric Housing Unit 552	Kitchenette	105 CMR 451.353	Interior Maintenance: Rodent droppings observed

18. Psychiatric Housing Unit # 5552	Slop Sink Room # 5572	105 CMR 451.353	Interior Maintenance: Rodent droppings observed
19. Unit 4-1	Recreation Deck 4-1 & 4-2	105 CMR 451.353	Interior Maintenance: Standing water observed
20. Unit 4-1	Kitchenette	105 CMR 451.353	Interior Maintenance: Rodent droppings observed
21. Unit 4-2	Kitchenette	105 CMR 451.353*	Interior Maintenance: Rodent droppings observed
22. Unit 4-3	Closet # 43F	105 CMR 451.353	Interior Maintenance: Rodent droppings observed
23. Unit 4-3	Closet # 43F	105 CMR 451.353	Interior Maintenance: Ceiling vent dusty outside of closet
24. Unit 4-3	Slop Sink # 43D	105 CMR 451.353	Interior Maintenance: Wall vent dusty
25. Unit 4-3	Slop Sink # 43D	105 CMR 451.353	Interior Maintenance: Standing water observed on floor
26. Unit 4-4	Kitchenette	105 CMR 451.353*	Interior Maintenance: Rodent droppings observed
27. Unit 4-4	Meeting Room # 44E	105 CMR 451.353	Interior Maintenance: Rodent droppings observed
28. Slop Sink Room # 3503		105 CMR 451.353	Interior Maintenance: Mold in slop sink
29. File Room Kitchen # 3516		105 CMR 451.353	Interior Maintenance: Rodent droppings observed
30. Unit 2-1	Kitchenette	105 CMR 451.353	Interior Maintenance: Electric hand dryer out-of-order
31. Unit 2-3	Cells	105 CMR 451.353	Interior Maintenance: Objectionable odor observed coming from several toilets in unoccupied cells
32. Unit 2-3	Kitchenette	105 CMR 451.353*	Interior Maintenance: Rodent droppings observed
33. Unit 2-3	Kitchenette	105 CMR 451.353*	Interior Maintenance: Handwash sink dirty
34. Unit 2-3	Kitchenette	105 CMR 451.353	Interior Maintenance: Dead insects observed
35. Unit 2-4	Cells	105 CMR 451.353	Interior Maintenance: Objectionable odor observed coming from multiple unoccupied cells
36. Unit 2-4	Cells	105 CMR 451.353	Interior Maintenance: Dead flies observed in cell # 5
37. Unit 2-4	Closet # 24G	105 CMR 451.353	Interior Maintenance: Rodent droppings observed

#### Contact Visits/Roll Call

#### Deficiencies under the Required Standards (.100 and .200 series)

1 repeat deficiency (indicated by an \*) was found during the inspection:

1. Female Visitors Bathroom	105 CMR 451.130*	Plumbing: Plumbing not maintained in good repair, no hot or cold water available at handwash sink # 1
-----------------------------	------------------	---

## Entry Level (Inside)

### Deficiencies under the Required Standards (.100 and .200 series)

2 new deficiencies were found during the inspection:

1. Female Staff Locker Room # 1076	105 CMR 451.123	Maintenance: Ceiling tiles water damaged
2. Outside Administration	Male Bathroom # 1015	105 CMR 451.130 Plumbing: Plumbing not maintained in good repair, no water supplied to handwash sink # 1

## Ground Level

### Deficiencies under the Required Standards (.100 and .200 series)

1 new deficiency was found during the inspection:

1. Staff Bathroom # G6	105 CMR 451.123	Maintenance: Ceiling water damaged
------------------------	-----------------	------------------------------------

### Deficiencies under the Recommended Standards (.300 series)

1 new deficiency was found during the inspection:

1. Female Booking Area	105 CMR 451.353	Interior Maintenance: Ceiling tiles missing and water damaged
------------------------	-----------------	---

## Food Service Area

### Deficiencies under the Required Standards (.100 and .200 series)

1 new deficiencies and 3 repeat deficiencies (indicated by an \*) were found during the inspection:

1. Dry Storage # G23	105 CMR 451.200*	Facility not cleaned as often as necessary, rodent droppings observed. Standard found in 105 CMR 590; FC 6-501.12(A). <b>** Corrected On-Site **</b>
2. Inmate Break Area	105 CMR 451.200	Cleaning of Equipment and Utensils, Objective: Nonfood contact surfaces of equipment dirty, interior of microwave oven dirty. Standard found in 105 CMR 590; FC 4-601.11(C).
3. Bread Refrigerator # 6	105 CMR 451.200	Preventing Contamination after Receiving; Preventing Food and Ingredient Contamination: Separating types of raw animal foods from each other during storage, preparation, holding, and display by arranging each type of food in equipment so that cross contamination of one type with another is prevented, ground beef stored above whole pork. Standard found in 105 CMR 590; FC 3-302.11(A)(2)(b). <b>** Corrected On-Site **</b>
4. Single Compartment Sink	105 CMR 451.200	Plumbing System; Operation and Maintenance: Plumbing system not maintained in good repair, sink leaking. Standard found in 105 CMR 590; FC 5-205.15(B).

## SECTION 2: Areas Found to be in Compliance

EHRS inspected 232 additional areas of the facility which were found to be in compliance.

### **Section 3: Areas EHRS did not inspect**

EHRS did not inspect 5 areas of the facility because they were either in use, locked, or under construction.

1. Floor 6.5	Inmate Bathroom # 6505	Unable to Inspect – Not in Use
2. Floor 6.5	Inmate Bathroom # 6506	Unable to Inspect – Not in Use
3. 4th Floor	Unit 4-4	Shower # 44H (near cell # 9)
4. 4th Floor	Unit 4-4	Shower # 44D (near meeting room # 44E)
5. Entry Level (Inside)	Blue Shirt's Locker Room # 1075	Unable to Inspect – In Use

### **SECTION 4: Plan of Correction**

This facility does not comply with the Department's Regulations cited above. In accordance with 105 CMR 451.404, please submit a plan of correction within 10 working days of receipt of this notice. The Plan of Correction must include:

1. Specific corrective steps to be taken
2. A timetable for the corrective actions for larger projects
3. The date by which correction will be achieved
4. Any interim measures being implemented to ensure the health and safety of incarcerated individuals and facility staff
5. The plan should be signed by the Superintendent or Administrator and submitted to my attention, at the address listed above.

### **SECTION 5: Observations and Recommendations**

1. The inmate population was 279 at the time of inspection.

To review the specific regulatory requirements please visit our website at [www.mass.gov/dph/dcs](http://www.mass.gov/dph/dcs) and click on "Correctional Facilities" [105 CMR 451.000](http://www.mass.gov/dph/dcs/105-cmr-451.000) available in both PDF and RTF formats. For more specific information about the food standards, you can download the merged food code, which can be found [here](#).

An inspection may also include observations of other conditions which could constitute a threat to the health or safety of inmates or employees, including but not limited to the standards set forth by the Department as follows, and report on such pursuant to 451.402(B). You can use these links below to review these standards:

- [105 CMR 205.000](#): Minimum Standards Governing Medical Records and Conduct of Physical Examinations in Correctional Facilities
- [105 CMR 480.000](#): Minimum requirements for the Management of Medical or Biological Waste
- [105 CMR 500.000](#): Good Manufacturing Practices for Food

This inspection report is true and accurate to the best of my knowledge.

Sincerely,



Hannah LeBeau  
Environmental Health Officer, EHRS, BCEH



# Suffolk County Sheriff's Department

STEVEN W. TOMPKINS  
SHERIFF

Jail  
200 Nashua Street  
Boston, MA 02114  
(617) 635-1100

House of Correction  
20 Bradston Street  
Boston, MA 02118  
(617) 635-1000




December 4, 2025


Hannah LeBeau, Environmental Health Inspector  
Commonwealth of Massachusetts  
Department of Public Health  
5 Randolph Street  
Canton, MA 02021

Dear Inspector LeBeau:

I am following up on the noted deficiencies (see attachment) regarding our most EHRS Inspection of the Suffolk County Jail.

Please feel free to contact me if you have any questions,

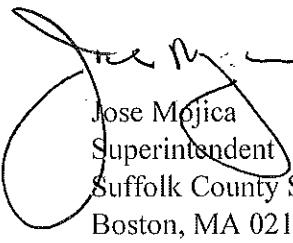  
Jose Mojica  
Superintendent  
Suffolk County Sheriff's Department  
Boston, MA 02114  
617-704-6663

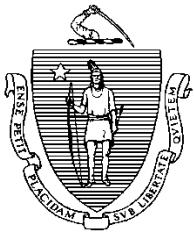

# The Commonwealth of Massachusetts

Executive Office of Health and Human Services

Department of Public Health

Bureau of Climate and Environmental Health

Division of Environmental Health Regulations and Standards

67 Forest Street, Suite # 100 Marlborough, MA 01752

617-624-6000 | [mass.gov/dph](http://mass.gov/dph)

**Maura T. Healey**

Governor

**Kimberley Driscoll**

Lieutenant Governor

**Kiame Mahaniah, MD, MBA**

Secretary

**Robert Goldstein, MD, PhD**

Commissioner

November 20, 2025

Steven W. Tompkins, Sheriff

Suffolk County Sheriff's Department

20 Bradston Street

Boston, MA 02118

(electronic copy)

Re: Facility Inspection – Suffolk County Jail, Boston

Dear Sheriff Tompkins:

The Massachusetts Department of Public Health (Department) Division of Environmental Health Regulations and Standards (EHRS) conducted an inspection of the Suffolk County Jail on November 3, 2025, accompanied by Sergeant Tyler Crocker, Environmental Health and Safety Officer, and Lieutenant Brittney Carroll, in accordance with Department regulations 105 CMR 451.000: Minimum Health and Sanitation Standards and Inspection Procedures for Correctional Facilities.

The inspection identified 149 total deficiencies: 81 new deficiencies under the Required Standards (.100 and .200 series), 30 repeat deficiencies under the Required Standards, 31 new deficiencies under the Recommended Standards (.300 series), and 7 repeat deficiencies under the Recommended Standards.

## Overview

**Section 1** provides details of all deficiencies, including repeat deficiencies, found during the inspection. These are categorized by Required Standards, Recommended Standards, or additional applicable regulatory standards.

**Section 2** provides information on areas that EHRS found to be compliant.

**Section 3** documents the areas that EHRS did not inspect.

**Section 4** provides information on submitting a Plan of Correction for the identified violations.

**Section 5** outlines observations and recommendations related to the inspection.

## SECTION 1: Health and Safety Deficiencies

### Entry Level (Outside)

#### Deficiencies under the Required Standards (.100 and .200 series)

1 repeat deficiency (indicated by an \*) was found during the inspection:

1.	Female Bathroom	105 CMR 451.123*	Maintenance: Wall tile damaged under hand wash sink # 2 <b>Wall tile re-secured by Maintenance Dept. 11/6/2025</b>
----	-----------------	------------------	--

### Housing Units

#### Deficiencies under the Required Standards (.100 and .200 series)

77 new deficiencies and 25 repeat deficiencies (indicated by an \*) were found during the inspection:

1.	Staff Bathroom 6-1 and 6-2	105 CMR 451.123	Maintenance: Ceiling vent dusty <b>Cleaned by detainee worker detail on 11/16/2025</b>
2.	Unit 6-1A	Cells	Mattresses: Mattress damaged in cell # 1 <b>Mattress replaced 11/25/2025</b>
3.	Unit 6-1	Shower # 617 – Bottom Tier, Left Side	Maintenance: Door frame rusted <b>New water/shower paint supply ordered (Sherwin- Williams) for resurfacing by the Maintenance Dept. Scheduled for repainting on 12/13/2025</b>
4.	Unit 6-1	Shower # 617 – Bottom Tier, Left Side	Maintenance: Door paint damaged <b>New water/shower paint supply ordered (Sherwin- Williams) for resurfacing by the Maintenance Dept. Scheduled for repainting on 12/13/2025</b>
5.	Unit 6-1	Shower # 617 – Bottom Tier, Left Side	Plumbing: Plumbing not maintained in good repair, drain cover damaged <b>Maintenance-Sgt. Bernard received drain cover quotes from Grainger Industrial Supply for replacement. Submitted for quote approval on 11/26/2025</b>
6.	Unit 6-1	Shower # 617 – Bottom Tier, Left Side	Maintenance: Ceiling surface damaged <b>New water/shower paint supply ordered (Sherwin- Williams) for resurfacing by the Maintenance Dept. Scheduled for repainting on 12/13/2025</b>
7.	Unit 6-1	Shower # 617 – Bottom Tier, Left Side	Maintenance: Light shield rusted <b>New water/shower paint supply ordered (Sherwin- Williams) for resurfacing by the Maintenance Dept. Scheduled for repainting on 12/13/2025</b>
8.	Unit 6-1	Shower # 617 – Bottom Tier, Left Side	Maintenance: Sprinkler shroud rusted <b>Carlyle Contractor onsite 11/26/2025 with Sgt. Crocker for replacement shroud quotes. Awaiting official quote from contractor for</b>

			purchasing.
9.	Unit 6-1	Shower # 617 – Bottom Tier, Left Side	105 CMR 451.123
10.	Unit 6-1	Shower # 618 – Bottom Tier, Right Side	105 CMR 451.123*
11.	Unit 6-1	Shower # 618 – Bottom Tier, Right Side	Maintenance: Door frame rusted New water/shower paint supply ordered (Sherwin- Williams) for resurfacing by the Maintenance Dept. Scheduled for repainting on 12/13/2025
12.	Unit 6-1	Shower # 618 – Bottom Tier, Right Side	Maintenance: Door paint damaged New water/shower paint supply ordered (Sherwin- Williams) for resurfacing by the Maintenance Dept. Scheduled for repainting on 12/13/2025
13.	Unit 6-1	Shower # 618 – Bottom Tier, Right Side	Maintenance: Walls dirty Cleaned by detainee worker detail on 11/04/2025
14.	Unit 6-1	Shower # 618 – Bottom Tier, Right Side	Maintenance: Ceiling vent dusty outside showers Cleaned by detainee worker detail on 11/04/2025
15.	Unit 6-1	Shower # 711 - Top Tier, Left Side	Maintenance: Ceiling paint damaged New water/shower paint supply ordered (Sherwin- Williams) for resurfacing by the Maintenance Dept. Scheduled for repainting on 12/13/2025
16.	Unit 6-1	Shower # 711 - Top Tier, Left Side	Maintenance: Door paint damaged New water/shower paint supply ordered (Sherwin- Williams) for resurfacing by the Maintenance Dept. Scheduled for repainting on 12/13/2025
17.	Unit 6-1	Shower # 712 - Top Tier, Right Side	Maintenance: Door paint damaged New water/shower paint supply ordered (Sherwin- Williams) for resurfacing by the Maintenance Dept. Scheduled for repainting on 12/13/2025
18.	Unit 6-1	Shower # 712 - Top Tier, Right Side	Maintenance: Door frame rusted New water/shower paint supply ordered (Sherwin- Williams) for resurfacing by the Maintenance Dept. Scheduled for repainting on 12/13/2025
19.	Unit 6-1	Cells	105 CMR 451.103*
20.	Unit 6-1	Cells	105 CMR 451.103
21.	Unit 6-3	Kitchenette	105 CMR 451.126
22.	Unit 6-3	Kitchenette	105 CMR 451.200

			590.000, interior of microwave oven dirty <b>Cleaned by worker detail on 11/08/2025</b>
23.	Unit 6-3	Shower # 63E	105 CMR 451.123 Maintenance: Metal panel on wall dirty <b>Cleaned by worker detail on 11/08/2025</b>
24.	Unit 6-3	Shower # 63H	105 CMR 451.123 Maintenance: Light out Maintenance excepted to replace light on 12/13/2025 with replacement light bulb
25.	Unit 6-3	Shower # 63I	105 CMR 451.123* Maintenance: Walls dirty <b>Cleaned by worker detail on 11/08/2025</b>
26.	Unit 6-3	Cells	105 CMR 451.103 Mattresses: Mattress damaged in cell # 3, 8, and 11 <b>Mattress replaced on 11/25/2025</b>
27.	Unit 6-3	Cells	105 CMR 451.103 Mattresses: Mattress cover missing in cell # 18 <b>Mattress replaced on 11/25/2025</b>
28.	Unit 6-4	Common Area	105 CMR 451.200* Food Storage, Preparation and Service: Food preparation not in compliance with 105 CMR 590.000, interior of microwave oven dirty <b>Cleaned by unit detail on 11/03/2025</b>
29.	Unit 6-4	Kitchenette	105 CMR 451.130* Plumbing: Plumbing not maintained in good repair, hand wash sink leaking <b>Plumbing connections tightened by Maintenance Dept. 11/27/2025</b>
30.	Unit 6-4	Kitchenette	105 CMR 451.200* Food Storage, Preparation and Service: Food preparation not in compliance with 105 CMR 590.000, interior of microwave oven dirty <b>Cleaned by unit detail on 11/03/2025</b>
31.	Unit 6-4	Shower # 64G	105 CMR 451.123 Maintenance: Shower curtain missing <b>Shower curtain replaced on 11/03/2025</b>
32.	Unit 6-4	Shower # 64H	105 CMR 451.130 Plumbing: Plumbing not maintained in good repair, shower leaking leaking <b>Plumbing connections tightened by Maintenance Dept. 11/27/2025</b>
33.	Unit 6-4	Shower # 64H	105 CMR 451.123 Maintenance: Light shield rusted <b>New water/shower paint supply ordered (Sherwin- Williams) for resurfacing by the Maintenance Dept. Scheduled for repainting on 12/13/2025</b>
34.	Unit 6-4	Shower # 64H	105 CMR 451.123 Maintenance: Ceiling dirty <b>Cleaned by unit detail 11/04/2025</b>
35.	Unit 6-4	Shower # 64I	105 CMR 451.123* Maintenance: Light shield rusted <b>New water/shower paint supply ordered (Sherwin- Williams) for resurfacing by the Maintenance Dept. Scheduled for repainting on 12/13/2025</b>
36.	Medical Housing Unit	Shower # 55 C	105 CMR 451.123 Maintenance: Walls dirty <b>Cleaned by unit detail 11/04/2025</b>
37.	Psychiatric Housing Unit # 5552	Shower # 55A	105 CMR 451.123 Maintenance: Ceiling dirty <b>Cleaned by unit detail 11/04/2025</b>
38.	Psychiatric Housing Unit # 5552	Shower # 55A	105 CMR 451.123 Maintenance: Door frame rusted <b>New water/shower paint supply ordered (Sherwin- Williams) for resurfacing by the Maintenance Dept. Scheduled for repainting</b>

				on 12/13/2025
39.	Psychiatric Housing Unit # 5552	Slop Sink Room # 5572	105 CMR 451.130*	Plumbing: Plumbing not maintained in good repair, drain cover missing Maintenance-Sgt. Bernard received drain cover quotes from Grainger Industrial Supply for replacement. Submitted for quote approval on 11/26/2025
40.	Control 4-1 & 4-2	Staff Bathroom 4-1 & 4-2	105 CMR 451.123*	Maintenance: Ceiling vent dusty <b>Cleaned by Unit Detail on 11/26/2025</b>
41.	Unit 4-1	Shower # 41K	105 CMR 451.123	Maintenance: Floor drain dirty <b>Cleaned by unit detail 11/03/2025</b>
42.	Unit 4-1	Shower # 41K	105 CMR 451.123	Maintenance: Shower curtain missing <b>Replaced on 11/03/2025</b>
43.	Unit 4-1	Cells	105 CMR 451.103	Mattresses: Mattress damaged in cell # 19, 22, 26, 31, and 32 Mattresses replaced on 11/25/2025
44.	Unit 4-1	Cells	105 CMR 451.103	Mattresses: Mattress cover missing in cell # 4, 21, 23, 26, and 33 <b>Mattresses replaced on 11/25/2025</b>
45.	Unit 4-2	Kitchenette	105 CMR 451.200*	Food Storage, Preparation and Service: Food preparation not in compliance with 105 CMR 590.000, interior of microwave oven dirty <b>Cleaned by unit detail on 11/03/2025</b>
46.	Unit 4-2	Slop Sink Room # 42C	105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, slop sink leaking <b>Connections tightened by Maintenance 11/07/2025</b>
47.	Unit 4-2	Shower # 42D	105 CMR 451.123	Maintenance: Sprinkler shroud rusted Carlyle Contractor onsite 11/26/2025 with Sgt. Crocker for replacement shroud quotes. Awaiting official quote from contractor for purchasing by 12/19/2025
48.	Unit 4-2	Shower # 42E (near cell # 15)	105 CMR 451.123*	Maintenance: Walls dirty <b>Cleaned by Unit Detail 11/04/2025</b>
49.	Unit 4-2	Shower # 42E (near cell # 15)	105 CMR 451.123*	Maintenance: Floor dirty <b>Cleaned by Unit Detail 11/03/2025</b>
50.	Unit 4-2	Shower # 42E (near cell # 15)	105 CMR 451.123*	Maintenance: Debris on floor <b>Cleaned by Unit Detail 11/03/2025</b>
51.	Unit 4-2	Cells	105 CMR 451.103	Mattresses: Mattress damaged in cell # 14 <b>Mattress replaced on 11/26/2025</b>
52.	Unit 4-2	Cells	105 CMR 451.103	Mattresses: Mattress cover missing in cell # 4 and 15 <b>Mattress replaced on 11/26/2025</b>
53.	Unit 4-3	Shower # 43G	105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, shower leaking Maintenance determined a new shower head is needed after examination. Consigli Contractor notified 11/18/2025. To be repaired with facility DCAM Plumbing project. Start date January 2026.
54.	Unit 4-3	Shower # 43G	105 CMR 451.123	Maintenance: Rust on sprinkler shroud Carlyle Contractor onsite 11/26/2025 with Sgt. Crocker for replacement shroud quotes. Awaiting official quote from contractor for

				purchasing by 12/19/2025
55.	Unit 4-3	Shower # 43G	105 CMR 451.123	Maintenance: Ceiling dirty <b>Cleaned by unit detail on 11/04/2025</b>
56.	Unit 4-3	Shower # 43G	105 CMR 451.123	Maintenance: Curtain dirty <b>Shower curtain replaced 11/03/2025</b>
57.	Unit 4-3	Shower # 43G	105 CMR 451.123	Maintenance: Excessive condensation observed on ceiling <b>Shower ceiling dried, vent cleared and cleaned by unit detail on 11/03/2025</b>
58.	Unit 4-3	Shower # 43H	105 CMR 451.123	Maintenance: Soap scum on metal panel on wall <b>Scrubbed and Cleaned by unit detail 11/04/2025</b>
59.	Unit 4-3	Shower # 43H	105 CMR 451.123	Maintenance: Excessive condensation observed on ceiling <b>Shower ceiling dried, vent cleared and cleaned by unit detail on 11/03/2025</b>
60.	Unit 4-3	Shower # 43I (near cell # 20)	105 CMR 451.123*	Maintenance: Walls dirty <b>Cleaned by unit detail 11/03/2025</b>
61.	Unit 4-3	Shower # 43I (near cell # 20)	105 CMR 451.123	Maintenance: Curtain dirty <b>Shower curtain replaced 11/04/2025</b>
62.	Unit 4-3	Shower # 43E	105 CMR 451.123	Maintenance: Curtain dirty <b>Shower curtain replaced 11/04/2025</b>
63.	Unit 4-3	Shower # 43E	105 CMR 451.123	Maintenance: Wall paint damaged rusted <b>New water/shower paint supply ordered (Sherwin-Williams) for resurfacing by the Maintenance Dept. Scheduled for repainting on 12/13/2025</b>
64.	Unit 4-4	Kitchenette	105 CMR 451.130*	Plumbing: Plumbing not maintained in good repair, hand wash sink leaking <b>New gasket was replaced and tightened 11/09/2025</b>
65.	Unit 4-4	Kitchenette	105 CMR 451.200*	Food Storage, Preparation and Service: Food preparation not in compliance with 105 CMR 590.000, interior of microwave oven dirty <b>Cleaned by unit detail 11/03/2025</b>
66.	Unit 4-4	Shower # 44J (near Visiting Rooms)	105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, floor drain cover not secure <b>Maintenance-Sgt. Bernard received drain cover quotes from Grainger Industrial Supply for replacement. Submitted for quote approval on 11/26/2025</b>
67.	Unit 4-4	Shower # 44I (near cell # 28)	105 CMR 451.123	Maintenance: Floor dirty <b>Cleaned by unit detail 11/03/2025</b>
68.	Unit 4-4	Shower # 44I (near cell # 28)	105 CMR 451.123	Maintenance: Walls dirty <b>Cleaned by unit detail 11/03/2025</b>
69.	Unit 4-4	Shower # 44I (near cell # 28)	105 CMR 451.123	Maintenance: Ceiling dirty <b>Cleaned by unit detail 11/03/2025</b>
70.	Unit 4-4	Shower # 44B	105 CMR 451.123	Maintenance: Walls dirty <b>Cleaned by unit detail 11/03/2025</b>
71.	Unit 4-4	Cells	105 CMR 451.103	Mattresses: Mattress cover missing in cell # 1, 6, 9, 10, 13, 14, 32, and 36 <b>Mattresses replaced on 11/28/2025</b>
72.	File Room		105 CMR 451.200	Food Storage, Preparation and Service: Food

Kitchen # 3516			storage not in compliance with 105 CMR 590.000, snap traps observed in kitchen area <b>Snap Traps were removed 11/03/2025</b>
73. Education	Bathroom # 3521	105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, no water supplied to hand wash sink <b>Maintenance fixed water supply on 11/06/2025</b>
74. Male Staff		105 CMR 451.123	Maintenance: Ceiling vent dusty <b>Cleaned by workers detail on 11/08/2025</b>
Bathroom # 2034			
75. Unit 2-1	Shower # 21B	105 CMR 451.123	Maintenance: Ceiling dirty <b>Cleaned by unit detail on 11/03/2025</b>
76. Unit 2-1	Shower # 21D	105 CMR 451.123	Maintenance: Wall paint damaged rusted <b>New water/shower paint supply ordered (Sherwin-Williams) for resurfacing by the Maintenance Dept. Scheduled for repainting on 12/13/2025</b>
77. Unit 2-1	Shower # 21D	105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, drain cover damaged <b>Maintenance-Sgt. Bernard received drain cover quotes from Grainger Industrial Supply for replacement. Submitted for quote approval on 11/26/2025</b>
78. Unit 2-2	Shower # 22I (near cell # 32)	105 CMR 451.123	Maintenance: Face plate missing around push button <b>Maintenance to replace face plate on 12/14/2025</b>
79. Unit 2-4	Shower # 24J (near visiting rooms)	105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, shower leaking <b>Maintenance determined a new shower head is needed after examination. Consigli Contractor notified 11/18/2025. To be repaired with facility DCAM Plumbing project. Start date January 2026.</b>
80. Unit 2-4	Shower # 24J (near visiting rooms)	105 CMR 451.123	Maintenance: Drain flies observed <b>Cleaned by worker detail 11/29/2025</b>
81. Unit 2-4	Shower # 24J (near visiting rooms)	105 CMR 451.123	Maintenance: Mold on walls <b>Cleaned by worker detail 11/29/2025</b>

#### Deficiencies under the Recommended Standards (.300 series)

30 new deficiencies and 7 repeat deficiencies (indicated by an \*) were found during the inspection:

1. Control 6-1 & 6-1A		105 CMR 451.353*	Interior Maintenance: Area around ceiling vent dusty <b>Scheduled for cleaning by Maintenance Dept. on 12/14/2025</b>
2. Control 6-1 & 6-1A		105 CMR 451.350	Structural Maintenance: Window cracked <b>Glass and Mirror Inc. Contractor accepted bid for replacement windows in September 2025. Manufacturing in progress. Excepted delivery by 01/31/2026</b>
3. Unit 6-1A	Storage Room # 61G	105 CMR 451.353*	Interior Maintenance: Rodent droppings observed <b>Cleaned by unit detail 11/09/2025</b>
4. Unit 6-1A	Storage Room #	105 CMR 451.353	Interior Maintenance: Objectionable odor

	61G		observed Old property bags removed and Storage room cleaned by unit detail 11/09/2025
5. Unit 6-1	Kitchenette	105 CMR 451.353	Interior Maintenance: Rodent droppings observed Cleaned by unit detail 11/03/2025
6. Unit 6-1	Second Floor Storage Room	105 CMR 451.353	Interior Maintenance: Rodent droppings observed Cleaned by unit detail 11/03/2025
7. Unit 6-1	Cells	105 CMR 451.353	Interior Maintenance: Mold on ceiling in cell # 31 Cell placed offline 11/29/2025. ServPro Contacted for inspection. Appointment time 12/11/2025
8. Control 6-3 & 6-4		105 CMR 451.353	Interior Maintenance: Light shield missing Light shield was removed for ongoing maintenance/ plumbing work in the ceiling. To be placed back in by 12/18/2025 once completed.
9. Unit 6-3	Kitchenette	105 CMR 451.353*	Interior Maintenance: Rodent droppings observed Cleaned by unit detail 11/03/2025
10. Unit 6-3	Meeting Room # 63B	105 CMR 451.353	Interior Maintenance: Rodent droppings observed Cleaned by unit detail 11/03/2025
11. Unit 6-3	Meeting Room # 63B	105 CMR 451.353	Interior Maintenance: Ceiling vent dusty outside of Meeting Room Cleaned by unit detail 11/29/2025
12. Unit 6-4	Kitchenette	105 CMR 451.353	Interior Maintenance: Electric hand dryer out- of-order Department electrician Bob Jackson notified. Scheduled for replacement by 2/28/26
13. Unit 6-4	Kitchenette	105 CMR 451.353	Interior Maintenance: Soap dispenser damaged Replaced by maintenance 11/19/2025
14. Visiting Rooms		105 CMR 451.353	Interior Maintenance: Floor dirty in room # 501 Cleaned by unit detail 11/04/2025
15. Visiting Rooms		105 CMR 451.353	Interior Maintenance: Ceiling tile missing in room # 504 Scheduled for repair with new ceiling tiles by 2/28/2026
16. Medical Area	Biohazard Storage # 5507	105 CMR 451.353	Interior Maintenance: Rodent droppings observed Cleaned by Dept. Custodians 11/07/2025
17. Psychiatric Housing Unit 5552	Kitchenette	105 CMR 451.353	Interior Maintenance: Rodent droppings observed Cleaned by unit detail 11/03/2025
18. Psychiatric Housing Unit # 5552	Slop Sink Room # 5572	105 CMR 451.353	Interior Maintenance: Rodent droppings observed Cleaned by unit detail 11/03/2025
19. Unit 4-1	Recreation Deck 4-1 & 4-2	105 CMR 451.353	Interior Maintenance: Standing water observed Squeeged by unit detail 11/04/2025
20. Unit 4-1	Kitchenette	105 CMR 451.353	Interior Maintenance: Rodent droppings observed Cleaned by unit detail 11/03/2025
21. Unit 4-2	Kitchenette	105 CMR 451.353*	Interior Maintenance: Rodent droppings observed Cleaned by unit detail 11/03/2025
22. Unit 4-3	Closet # 43F	105 CMR 451.353	Interior Maintenance: Rodent droppings observed Cleaned by unit detail 11/03/2025
23. Unit 4-3	Closet # 43F	105 CMR 451.353	Interior Maintenance: Ceiling vent dusty

			outside of closet <b>Cleaned by unit detail 11/29/2025</b>
24. Unit 4-3	Slop Sink # 43D	105 CMR 451.353	Interior Maintenance: Wall vent dusty <b>Cleaned by unit detail on 11/22/2025</b>
25. Unit 4-3	Slop Sink # 43D	105 CMR 451.353	Interior Maintenance: Standing water observed on floor <b>Mopped and dried by unit detail 11/03/2025</b>
26. Unit 4-4	Kitchenette	105 CMR 451.353*	Interior Maintenance: Rodent droppings observed <b>Cleaned by unit detail on 11/04/2025</b>
27. Unit 4-4	Meeting Room # 44E	105 CMR 451.353	Interior Maintenance: Rodent droppings observed <b>Cleaned by unit detail on 11/04/2025</b>
28. Slop Sink Room # 3503		105 CMR 451.353	Interior Maintenance: Mold in slop sink <b>Scrubbed by unit detail on 11/08/2025</b>
29. File Room Kitchen # 3516		105 CMR 451.353	Interior Maintenance: Rodent droppings observed <b>Cleaned by unit detail on 11/04/2025</b>
30. Unit 2-1	Kitchenette	105 CMR 451.353	Interior Maintenance: Electric hand dryer out-of-order <b>Department electrician Bob Jackson notified. Scheduled for replacement by 2/28/26</b>
31. Unit 2-3	Cells	105 CMR 451.353	Interior Maintenance: Objectionable odor observed coming from several toilets in unoccupied cells <b>Cleaned by detainee worker detail 11/30/2025</b>
32. Unit 2-3	Kitchenette	105 CMR 451.353*	Interior Maintenance: Rodent droppings observed <b>Cleaned by detainee worker detail 11/30/2025</b>
33. Unit 2-3	Kitchenette	105 CMR 451.353*	Interior Maintenance: Hand wash sink dirty <b>Cleaned by detainee worker detail 11/30/2025</b>
34. Unit 2-3	Kitchenette	105 CMR 451.353	Interior Maintenance: Dead insects observed <b>Removed and cleaned by detainee worker detail 11/30/2025</b>
35. Unit 2-4	Cells	105 CMR 451.353	Interior Maintenance: Objectionable odor observed coming from multiple unoccupied cells <b>Cleaned by detainee worker detail 11/30/2025</b>
36. Unit 2-4	Cells	105 CMR 451.353	Interior Maintenance: Dead flies observed in cell # 5 <b>Removed and cleaned by detainee worker detail 11/30/2025</b>
37. Unit 2-4	Closet # 24G	105 CMR 451.353	Interior Maintenance: Rodent droppings observed <b>Cleaned by detainee worker detail 11/30/2025</b>

#### Contact Visits/Roll Call

#### Deficiencies under the Required Standards (.100 and .200 series)

1 repeat deficiency (indicated by an \*) was found during the inspection:

1. Female Visitors Bathroom	105 CMR 451.130*	Plumbing: Plumbing not maintained in good repair, no hot or cold water available at hand wash sink # 1 <b>Water supply repaired by maintenance on 11/25/25</b>
-----------------------------	------------------	--

## Entry Level (Inside)

### Deficiencies under the Required Standards (.100 and .200 series)

2 new deficiencies were found during the inspection:

1. Female Staff Locker Room # 1076	105 CMR 451.123	Maintenance: Ceiling tiles water damaged <b>Scheduled for replacement with new ceiling tiles on 2/28/2026</b>
2. Outside Administration	Male Bathroom # 1015	105 CMR 451.130 Plumbing: Plumbing not maintained in good repair, no water supplied to hand wash sink # 1 <b>Scheduled for replacement with new ceiling tiles on 2/28/2026</b>

## Ground Level

### Deficiencies under the Required Standards (.100 and .200 series)

1 new deficiency was found during the inspection:

1. Staff Bathroom # G6	105 CMR 451.123	Maintenance: Ceiling water damaged <b>Scheduled to be replaced with new ceiling tiles on 2/28/2026</b>
------------------------	-----------------	---

### Deficiencies under the Recommended Standards (.300 series)

1 new deficiency was found during the inspection:

1. Female Booking Area	105 CMR 451.353	Interior Maintenance: Ceiling tiles missing and water damaged <b>Scheduled to be replaced with new ceiling tiles on 2/28/2026</b>
------------------------	-----------------	--

## Food Service Area

### Deficiencies under the Required Standards (.100 and .200 series)

1 new deficiencies and 3 repeat deficiencies (indicated by an \*) were found during the inspection:

1. Dry Storage # G23	105 CMR 451.200*	Facility not cleaned as often as necessary, rodent droppings observed. Standard found in 105 CMR 590; FC 6-501.12(A). <b>** Corrected On-Site ** Cleaned by kitchen workers 11/03/25</b>
2. Inmate Break Area	105 CMR 451.200	Cleaning of Equipment and Utensils, Objective: Nonfood contact surfaces of equipment dirty, interior of microwave oven dirty. Standard found in 105 CMR 590; FC 4-601.11(C). <b>Cleaned by kitchen workers 11/03/2025</b>
3. Bread Refrigerator # 6	105 CMR 451.200	Preventing Contamination after Receiving; Preventing Food and Ingredient Contamination: Separating types of raw animal foods from each other during storage, preparation, holding, and display by arranging each type of food in equipment so that cross contamination of one type with another is prevented, ground beef stored above whole pork. Standard found in 105 CMR 590; FC 3-302.11(A)(2)(b). <b>** Corrected On-Site ** Counselled Civilian staff on ServSafe standards</b>
4. Single Compartment Sink	105 CMR 451.200	Plumbing System; Operation and Maintenance: Plumbing system not maintained in good repair, sink leaking. Standard found in 105 CMR 590; FC 5-205.15(B). <b>Repaired by Maintenance 11/08/2025</b>

## **SECTION 2: Areas Found to be in Compliance**

EHRS inspected 232 additional areas of the facility which were found to be in compliance.

## **Section 3: Areas EHRS did not inspect**

EHRS did not inspect 5 areas of the facility because they were either in use, locked, or under construction.

1. Floor 6.5	Inmate Bathroom # 6505	Unable to Inspect – Not in Use
2. Floor 6.5	Inmate Bathroom # 6506	Unable to Inspect – Not in Use
3. 4th Floor	Unit 4-4	Shower # 44H (near cell # 9)
4. 4th Floor	Unit 4-4	Shower # 44D (near meeting room # 44E)
5. Entry Level	Blue Shirt's Locker Room (Inside) # 1075	Unable to Inspect – In Use

## **SECTION 4: Plan of Correction**

This facility does not comply with the Department's Regulations cited above. In accordance with 105 CMR 451.404, please submit a plan of correction within 10 working days of receipt of this notice. The Plan of Correction must include:

1. Specific corrective steps to be taken
2. A timetable for the corrective actions for larger projects
3. The date by which correction will be achieved
4. Any interim measures being implemented to ensure the health and safety of incarcerated individuals and facility staff
5. The plan should be signed by the Superintendent or Administrator and submitted to my attention, at the address listed above.

## **SECTION 5: Observations and Recommendations**

1. The inmate population was 279 at the time of inspection.

To review the specific regulatory requirements please visit our website at [www.mass.gov/dph/dcs](http://www.mass.gov/dph/dcs) and click on "Correctional Facilities" [105 CMR 451.000](http://www.mass.gov/dph/dcs/105CMR451.000) available in both PDF and RTF formats. For more specific information about the food standards, you can download the merged food code, which can be found [here](#).


An inspection may also include observations of other conditions which could constitute a threat to the health or safety of inmates or employees, including but not limited to the standards set forth by the Department as follows, and report on such pursuant to 451.402(B). You can use these links below to review these standards:

- [105 CMR 205.000](#): Minimum Standards Governing Medical Records and Conduct of Physical Examinations in Correctional Facilities
- [105 CMR 480.000](#): Minimum requirements for the Management of Medical or Biological Waste
- [105 CMR 500.000](#): Good Manufacturing Practices for Food

This inspection report is true and accurate to the best of my knowledge.

Sincerely,

Hannah LeBeau  
Environmental Health Officer, EHRS, BCEH

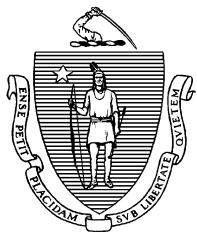

The Commonwealth of Massachusetts  
Executive Office of Health and Human Services  
Department of Public Health  
Bureau of Climate and Environmental Health  
Division of Environmental Health Regulations and Standards  
67 Forest Street, Suite # 100  
Marlborough, MA 01752  
617-624-6000 | [mass.gov/dph](http://mass.gov/dph)

**Maura T. Healey**  
Governor

**Kimberley Driscoll**  
Lieutenant Governor

**Kiame Mahaniah, MD, MBA**  
Secretary

**Robert Goldstein, MD, PhD**  
Commissioner

December 10, 2025

Steven W. Tompkins, Sheriff  
Suffolk County Sheriff's Department  
20 Bradston Street  
Boston, MA 02118  
(electronic copy)

Re: Plan of Correction – Suffolk County Jail, Boston

Dear Sheriff Tompkins:

The Massachusetts Department of Public Health, Division of Environmental Regulations and Standards (EHRS) has received your Plan of Correction in response to my inspection conducted on November 3, 2025. After review, the EHRS finds the plan addresses all the deficiencies noted with the following exceptions:

1. In instances you indicate *DCAMM Plumbing Project*, please provide an estimated start and completion date for this project. The EHRS would also like to be informed of your facilities interim measures you have implemented to ensure the health and safety of inmates and staff in these areas; and
2. Please provide an estimated date of completion where you indicate:
  - a. "Awaiting official quote from contractor for purchasing by";
  - b. "Submitted quote for approval on"; and
  - c. "Expected delivery by".

Thank you for your prompt attention to this matter, should you have any questions please contact me at the address listed above.

Sincerely,

A handwritten signature in blue ink that reads "Hannah LeBeau".

Hannah LeBeau  
Environmental Health Officer, EHRS, BCEH

cc: Jose Mojica, Superintendent  
Sergeant Tyler Crocker, EHSO/FSO

(electronic copy)  
(electronic copy)



# Suffolk County Sheriff's Department

STEVEN W. TOMPKINS  
SHERIFF

Jail  
200 Nashua Street  
Boston, MA 02114  
(617) 635-1100

House of Correction  
20 Bradston Street  
Boston, MA 02118  
(617) 635-1000



December 17, 2025

Hannah LeBeau, Environmental Health Inspector  
Commonwealth of Massachusetts  
Department of Public Health  
5 Randolph Street  
Canton, MA 02021

Dear Inspector LeBeau:

I am following up on the noted deficiencies (see attachment) regarding our most EHRS Inspection of the Suffolk County Jail.

I have also included the requested information regarding the DCAMM project (see below).

## **Interim Measures that will be implemented during the DCAMM plumbing project.**

Start / Completion Dates (February 2026-July 2027)


### General Facility:

- DCAMM project will take place in 3 phases to ensure the health and safety of all inmates and staff at the facility.
- Closing additional units for plumbing construction (Detainees will be transferred to South Bay House of Correction during unit constructions on a rotation)
- Hiring additional escort officers while Consigli is in the facility.
- Mandatory Department Maintenance Officer will be on duty while Consigli contractor are in the facility.
- Consigli will have an assigned cleaning crew on site in the facility to ensure the areas under construction at those times remain clean for the health and safety of the population and staff.


Kitchen Area:

- Kitchen is currently scheduled to be part of the third phase of the project.
- Plumbing construction is scheduled to take place on the overnight shift to ensure normal food operations and standards.
- Assigned Kitchen Officer will be on duty during the time of area construction to ensure proper sanitization and cleanliness before daily operations commence.
- Documented additional equipment and prep checks will be added to ensure proper sanitization from assigned kitchen officers, food service contractor, and civilian chefs.

Please feel free to contact me if you have any questions,

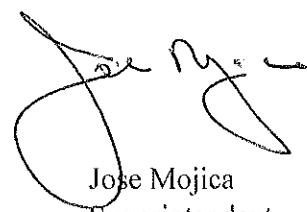

Jose Mojica  
Superintendent  
Suffolk County Sheriff's Department  
Boston, MA 02114  
617-704-6663

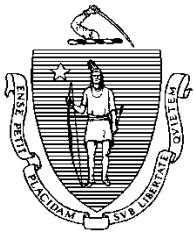

# The Commonwealth of Massachusetts

Executive Office of Health and Human Services

Department of Public Health

Bureau of Climate and Environmental Health

Division of Environmental Health Regulations and Standards

67 Forest Street, Suite # 100 Marlborough, MA 01752

617-624-6000 | [mass.gov/dph](http://mass.gov/dph)

**Maura T. Healey**

Governor

**Kimberley Driscoll**

Lieutenant Governor

**Kiame Mahaniah, MD, MBA**

Secretary

**Robert Goldstein, MD, PhD**

Commissioner

November 20, 2025

Steven W. Tompkins, Sheriff

Suffolk County Sheriff's Department

20 Bradston Street

Boston, MA 02118

(electronic copy)

Re: Facility Inspection – Suffolk County Jail, Boston

Dear Sheriff Tompkins:

The Massachusetts Department of Public Health (Department) Division of Environmental Health Regulations and Standards (EHRS) conducted an inspection of the Suffolk County Jail on November 3, 2025, accompanied by Sergeant Tyler Crocker, Environmental Health and Safety Officer, and Lieutenant Brittney Carroll, in accordance with Department regulations 105 CMR 451.000: Minimum Health and Sanitation Standards and Inspection Procedures for Correctional Facilities.

The inspection identified 149 total deficiencies: 81 new deficiencies under the Required Standards (.100 and .200 series), 30 repeat deficiencies under the Required Standards, 31 new deficiencies under the Recommended Standards (.300 series), and 7 repeat deficiencies under the Recommended Standards.

## Overview

**Section 1** provides details of all deficiencies, including repeat deficiencies, found during the inspection. These are categorized by Required Standards, Recommended Standards, or additional applicable regulatory standards.

**Section 2** provides information on areas that EHRS found to be compliant.

**Section 3** documents the areas that EHRS did not inspect.

**Section 4** provides information on submitting a Plan of Correction for the identified violations.

**Section 5** outlines observations and recommendations related to the inspection.

## SECTION 1: Health and Safety Deficiencies

### Entry Level (Outside)

#### Deficiencies under the Required Standards (.100 and .200 series)

1 repeat deficiency (indicated by an \*) was found during the inspection:

1.	Female Bathroom	105 CMR 451.123*	Maintenance: Wall tile damaged under hand wash sink # 2 <b>Wall tile re-secured by Maintenance Dept. 11/6/2025</b>
----	-----------------	------------------	--

### Housing Units

#### Deficiencies under the Required Standards (.100 and .200 series)

77 new deficiencies and 25 repeat deficiencies (indicated by an \*) were found during the inspection:

1.	Staff Bathroom 6-1 and 6-2	105 CMR 451.123	Maintenance: Ceiling vent dusty <b>Cleaned by detainee worker detail on 11/16/2025</b>
2.	Unit 6-1A	Cells	Mattresses: Mattress damaged in cell # 1 <b>Mattress replaced 11/25/2025</b>
3.	Unit 6-1	Shower # 617 – Bottom Tier, Left Side	Maintenance: Door frame rusted <b>New water/shower paint supply ordered (Sherwin- Williams) for resurfacing by the Maintenance Dept. Scheduled for repainting on 12/27/2025</b>
4.	Unit 6-1	Shower # 617 – Bottom Tier, Left Side	Maintenance: Door paint damaged <b>New water/shower paint supply ordered (Sherwin- Williams) for resurfacing by the Maintenance Dept. Scheduled for repainting on 12/27/2025</b>
5.	Unit 6-1	Shower # 617 – Bottom Tier, Left Side	Plumbing: Plumbing not maintained in good repair, drain cover damaged <b>Maintenance-Sgt. Bernard received drain cover quotes from Grainger Industrial Supply for replacement. Repair date is scheduled for Feb. 21, 2026</b>
6.	Unit 6-1	Shower # 617 – Bottom Tier, Left Side	Maintenance: Ceiling surface damaged <b>New water/shower paint supply ordered (Sherwin- Williams) for resurfacing by the Maintenance Dept. Scheduled for repainting on 12/27/2025</b>
7.	Unit 6-1	Shower # 617 – Bottom Tier, Left Side	Maintenance: Light shield rusted <b>New water/shower paint supply ordered (Sherwin- Williams) for resurfacing by the Maintenance Dept. Scheduled for repainting on 12/27/2025</b>
8.	Unit 6-1	Shower # 617 – Bottom Tier, Left Side	Maintenance: Sprinkler shroud rusted <b>Carlyle Contractor onsite 11/26/2025 with Sgt. Crocker for replacement shroud quotes. Repair date scheduled for July 2026</b>

9.	Unit 6-1	Shower # 617 – Bottom Tier, Left Side	105 CMR 451.123	Maintenance: Ceiling dirty <b>Cleaned by detainee worker detail on 11/04/2025</b>
10.	Unit 6-1	Shower # 618 – Bottom Tier, Right Side	105 CMR 451.123*	Maintenance: Ceiling dirty <b>Cleaned by detainee worker detail on 11/04/2025</b>
11.	Unit 6-1	Shower # 618 – Bottom Tier, Right Side	105 CMR 451.123*	Maintenance: Door frame rusted <b>New water/shower paint supply ordered (Sherwin- Williams) for resurfacing by the Maintenance Dept. Scheduled for repainting on 12/27/2025</b>
12.	Unit 6-1	Shower # 618 – Bottom Tier, Right Side	105 CMR 451.123*	Maintenance: Door paint damaged <b>New water/shower paint supply ordered (Sherwin- Williams) for resurfacing by the Maintenance Dept. Scheduled for repainting on 12/27/2025</b>
13.	Unit 6-1	Shower # 618 – Bottom Tier, Right Side	105 CMR 451.123	Maintenance: Walls dirty <b>Cleaned by detainee worker detail on 11/04/2025</b>
14.	Unit 6-1	Shower # 618 – Bottom Tier, Right Side	105 CMR 451.123	Maintenance: Ceiling vent dusty outside showers <b>Cleaned by detainee worker detail on 11/04/2025</b>
15.	Unit 6-1	Shower # 711 - Top Tier, Left Side	105 CMR 451.123*	Maintenance: Ceiling paint damaged <b>New water/shower paint supply ordered (Sherwin- Williams) for resurfacing by the Maintenance Dept. Scheduled for repainting on 12/27/2025</b>
16.	Unit 6-1	Shower # 711 - Top Tier, Left Side	105 CMR 451.123*	Maintenance: Door paint damaged <b>New water/shower paint supply ordered (Sherwin- Williams) for resurfacing by the Maintenance Dept. Scheduled for repainting on 12/27/2025</b>
17.	Unit 6-1	Shower # 712 - Top Tier, Right Side	105 CMR 451.123	Maintenance: Door paint damaged <b>New water/shower paint supply ordered (Sherwin- Williams) for resurfacing by the Maintenance Dept. Scheduled for repainting on 12/27/2025</b>
18.	Unit 6-1	Shower # 712 - Top Tier, Right Side	105 CMR 451.123	Maintenance: Door frame rusted <b>New water/shower paint supply ordered (Sherwin- Williams) for resurfacing by the Maintenance Dept. Scheduled for repainting on 12/27/2025</b>
19.	Unit 6-1	Cells	105 CMR 451.103*	Mattresses: Mattress cover missing in cell # 19 <b>Mattress replaced 11/25/2025</b>
20.	Unit 6-1	Cells	105 CMR 451.103	Mattresses: Mattress damaged in cell # 25, 28, 31, and 38 <b>Mattress replaced 11/25/2025</b>
21.	Unit 6-3	Kitchenette	105 CMR 451.126	Hot Water for Bathing and Hygiene: No hot water supplied to hand wash sink <b>Consigli Contractor notified 11/18/2025. To be repaired with facility DCAMM Plumbing project. Start / Completion date February 2026-August 2027</b>
22.	Unit 6-3	Kitchenette	105 CMR 451.200	Food Storage, Preparation and Service: Food preparation not in compliance with 105 CMR

			590.000, interior of microwave oven dirty <b>Cleaned by worker detail on 11/08/2025</b>
23.	Unit 6-3	Shower # 63E	105 CMR 451.123 Maintenance: Metal panel on wall dirty <b>Cleaned by worker detail on 11/08/2025</b>
24.	Unit 6-3	Shower # 63H	105 CMR 451.123 Maintenance: Light out Maintenance excepted to replace light on 12/13/2025 with replacement light bulb
25.	Unit 6-3	Shower # 63I	105 CMR 451.123* Maintenance: Walls dirty <b>Cleaned by worker detail on 11/08/2025</b>
26.	Unit 6-3	Cells	105 CMR 451.103 Mattresses: Mattress damaged in cell # 3, 8, and 11 <b>Mattress replaced on 11/25/2025</b>
27.	Unit 6-3	Cells	105 CMR 451.103 Mattresses: Mattress cover missing in cell # 18 <b>Mattress replaced on 11/25/2025</b>
28.	Unit 6-4	Common Area	105 CMR 451.200* Food Storage, Preparation and Service: Food preparation not in compliance with 105 CMR 590.000, interior of microwave oven dirty <b>Cleaned by unit detail on 11/03/2025</b>
29.	Unit 6-4	Kitchenette	105 CMR 451.130* Plumbing: Plumbing not maintained in good repair, hand wash sink leaking <b>Plumbing connections tightened by Maintenance Dept. 11/27/2025</b>
30.	Unit 6-4	Kitchenette	105 CMR 451.200* Food Storage, Preparation and Service: Food preparation not in compliance with 105 CMR 590.000, interior of microwave oven dirty <b>Cleaned by unit detail on 11/03/2025</b>
31.	Unit 6-4	Shower # 64G	105 CMR 451.123 Maintenance: Shower curtain missing <b>Shower curtain replaced on 11/03/2025</b>
32.	Unit 6-4	Shower # 64H	105 CMR 451.130 Plumbing: Plumbing not maintained in good repair, shower leaking leaking <b>Plumbing connections tightened by Maintenance Dept. 11/27/2025</b>
33.	Unit 6-4	Shower # 64H	105 CMR 451.123 Maintenance: Light shield rusted <b>New water/shower paint supply ordered (Sherwin- Williams) for resurfacing by the Maintenance Dept. Scheduled for repainting on 12/27/2025</b>
34.	Unit 6-4	Shower # 64H	105 CMR 451.123 Maintenance: Ceiling dirty <b>Cleaned by unit detail 11/04/2025</b>
35.	Unit 6-4	Shower # 64I	105 CMR 451.123* Maintenance: Light shield rusted <b>New water/shower paint supply ordered (Sherwin- Williams) for resurfacing by the Maintenance Dept. Scheduled for repainting on 12/27/2025</b>
36.	Medical Housing Unit	Shower # 55 C	105 CMR 451.123 Maintenance: Walls dirty <b>Cleaned by unit detail 11/04/2025</b>
37.	Psychiatric Housing Unit # 5552	Shower # 55A	105 CMR 451.123 Maintenance: Ceiling dirty <b>Cleaned by unit detail 11/04/2025</b>
38.	Psychiatric Housing Unit # 5552	Shower # 55A	105 CMR 451.123 Maintenance: Door frame rusted <b>New water/shower paint supply ordered (Sherwin- Williams) for resurfacing by the Maintenance Dept. Scheduled for repainting</b>

				on 12/27/2025
39.	Psychiatric Housing Unit # 5552	Slop Sink Room # 5572	105 CMR 451.130*	Plumbing: Plumbing not maintained in good repair, drain cover missing Maintenance-Sgt. Bernard received drain cover quotes from Grainger Industrial Supply for replacement. Repair date is scheduled for Feb. 21, 2026
40.	Control 4-1 & 4-2	Staff Bathroom 4-1 & 4-2	105 CMR 451.123*	Maintenance: Ceiling vent dusty <b>Cleaned by Unit Detail on 11/26/2025</b>
41.	Unit 4-1	Shower # 41K	105 CMR 451.123	Maintenance: Floor drain dirty <b>Cleaned by unit detail 11/03/2025</b>
42.	Unit 4-1	Shower # 41K	105 CMR 451.123	Maintenance: Shower curtain missing <b>Replaced on 11/03/2025</b>
43.	Unit 4-1	Cells	105 CMR 451.103	Mattresses: Mattress damaged in cell # 19, 22, 26, 31, and 32 Mattresses replaced on 11/25/2025
44.	Unit 4-1	Cells	105 CMR 451.103	Mattresses: Mattress cover missing in cell # 4, 21, 23, 26, and 33 <b>Mattresses replaced on 11/25/2025</b>
45.	Unit 4-2	Kitchenette	105 CMR 451.200*	Food Storage, Preparation and Service: Food preparation not in compliance with 105 CMR 590.000, interior of microwave oven dirty <b>Cleaned by unit detail on 11/03/2025</b>
46.	Unit 4-2	Slop Sink Room # 42C	105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, slop sink leaking <b>Connections tightened by Maintenance 11/07/2025</b>
47.	Unit 4-2	Shower # 42D	105 CMR 451.123	Maintenance: Sprinkler shroud rusted <b>Carlyle Contractor onsite 11/26/2025 with Sgt. Crocker for replacement shroud quotes. Repair date for July 2026</b>
48.	Unit 4-2	Shower # 42E (near cell # 15)	105 CMR 451.123*	Maintenance: Walls dirty <b>Cleaned by Unit Detail 11/04/2025</b>
49.	Unit 4-2	Shower # 42E (near cell # 15)	105 CMR 451.123*	Maintenance: Floor dirty <b>Cleaned by Unit Detail 11/03/2025</b>
50.	Unit 4-2	Shower # 42E (near cell # 15)	105 CMR 451.123*	Maintenance: Debris on floor <b>Cleaned by Unit Detail 11/03/2025</b>
51.	Unit 4-2	Cells	105 CMR 451.103	Mattresses: Mattress damaged in cell # 14 <b>Mattress replaced on 11/26/2025</b>
52.	Unit 4-2	Cells	105 CMR 451.103	Mattresses: Mattress cover missing in cell # 4 and 15 <b>Mattress replaced on 11/26/2025</b>
53.	Unit 4-3	Shower # 43G	105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, shower leaking <b>Maintenance determined a new shower head is needed after examination. Consigli Contractor notified 11/18/2025. To be repaired with facility DCAM Plumbing project. Start / Completion date February 2026-August 2027</b>
54.	Unit 4-3	Shower # 43G	105 CMR 451.123	Maintenance: Rust on sprinkler shroud <b>Carlyle Contractor onsite 11/26/2025 with Sgt. Crocker for replacement shroud quotes. Repair date for July 2026</b>
55.	Unit 4-3	Shower # 43G	105 CMR 451.123	Maintenance: Ceiling dirty

			Cleaned by unit detail on 11/04/2025
56.	Unit 4-3	Shower # 43G	105 CMR 451.123 Maintenance: Curtain dirty  <u>Shower curtain replaced 11/03/2025</u>
57.	Unit 4-3	Shower # 43G	105 CMR 451.123 Maintenance: Excessive condensation observed on ceiling  <u>Shower ceiling dried, vent cleared and cleaned by unit detail on 11/03/2025</u>
58.	Unit 4-3	Shower # 43H	105 CMR 451.123 Maintenance: Soap scum on metal panel on wall  <u>Scrubbed and Cleaned by unit detail 11/04/2025</u>
59.	Unit 4-3	Shower # 43H	105 CMR 451.123 Maintenance: Excessive condensation observed on ceiling  <u>Shower ceiling dried, vent cleared and cleaned by unit detail on 11/03/2025</u>
60.	Unit 4-3	Shower # 43I (near cell # 20)	105 CMR 451.123* Maintenance: Walls dirty  <u>Cleaned by unit detail 11/03/2025</u>
61.	Unit 4-3	Shower # 43I (near cell # 20)	105 CMR 451.123 Maintenance: Curtain dirty  <u>Shower curtain replaced 11/04/2025</u>
62.	Unit 4-3	Shower # 43E	105 CMR 451.123 Maintenance: Curtain dirty  <u>Shower curtain replaced 11/04/2025</u>
63.	Unit 4-3	Shower # 43E	105 CMR 451.123 Maintenance: Wall paint damaged rusted  <u>New water/shower paint supply ordered (Sherwin-Williams) for resurfacing by the Maintenance Dept. Scheduled for repainting on 12/27/2025</u>
64.	Unit 4-4	Kitchenette	105 CMR 451.130* Plumbing: Plumbing not maintained in good repair, hand wash sink leaking  <u>New gasket was replaced and tightened 11/09/2025</u>
65.	Unit 4-4	Kitchenette	105 CMR 451.200* Food Storage, Preparation and Service: Food preparation not in compliance with 105 CMR 590.000, interior of microwave oven dirty  <u>Cleaned by unit detail 11/03/2025</u>
66.	Unit 4-4	Shower # 44J (near Visiting Rooms)	105 CMR 451.130 Plumbing: Plumbing not maintained in good repair, floor drain cover not secure  <u>Maintenance-Sgt. Bernard received drain cover quotes from Grainger Industrial Supply for replacement. Repair date is scheduled for Feb. 21, 2026</u>
67.	Unit 4-4	Shower # 44I (near cell # 28)	105 CMR 451.123 Maintenance: Floor dirty  <u>Cleaned by unit detail 11/03/2025</u>
68.	Unit 4-4	Shower # 44I (near cell # 28)	105 CMR 451.123 Maintenance: Walls dirty  <u>Cleaned by unit detail 11/03/2025</u>
69.	Unit 4-4	Shower # 44I (near cell # 28)	105 CMR 451.123 Maintenance: Ceiling dirty  <u>Cleaned by unit detail 11/03/2025</u>
70.	Unit 4-4	Shower # 44B	105 CMR 451.123 Maintenance: Walls dirty  <u>Cleaned by unit detail 11/03/2025</u>
71.	Unit 4-4	Cells	105 CMR 451.103 Mattresses: Mattress cover missing in cell # 1, 6, 9, 10, 13, 14, 32, and 36  <u>Mattresses replaced on 11/28/2025</u>
72.	File Room Kitchen # 3516		105 CMR 451.200 Food Storage, Preparation and Service: Food storage not in compliance with 105 CMR 590.000, snap traps observed in kitchen area

				<b>Snap Traps were removed 11/03/2025</b>
73.	Education	Bathroom # 3521	105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, no water supplied to hand wash sink <b>Maintenance fixed water supply on 11/06/2025</b>
74.	Male Staff Bathroom # 2034		105 CMR 451.123	Maintenance: Ceiling vent dusty <b>Cleaned by workers detail on 11/08/2025</b>
75.	Unit 2-1	Shower # 21B	105 CMR 451.123	Maintenance: Ceiling dirty <b>Cleaned by unit detail on 11/03/2025</b>
76.	Unit 2-1	Shower # 21D	105 CMR 451.123	Maintenance: Wall paint damaged rusted <b>New water/shower paint supply ordered (Sherwin-Williams) for resurfacing by the Maintenance Dept. Scheduled for repainting on 12/27/2025</b>
77.	Unit 2-1	Shower # 21D	105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, drain cover damaged <b>Maintenance-Sgt. Bernard received drain cover quotes from Grainger Industrial Supply for replacement. Repair date is scheduled for Feb. 21, 2026</b>
78.	Unit 2-2	Shower # 22I (near cell # 32)	105 CMR 451.123	Maintenance: Face plate missing around push button <b>Maintenance to replace face plate on 12/14/2025</b>
79.	Unit 2-4	Shower # 24J (near visiting rooms)	105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, shower leaking <b>Maintenance determined a new shower head is needed after examination. Consigli Contractor notified 11/18/2025. To be repaired with facility DCAM Plumbing project. Start / Completion date February 2026-August 2027</b>
80.	Unit 2-4	Shower # 24J (near visiting rooms)	105 CMR 451.123	Maintenance: Drain flies observed <b>Cleaned by worker detail 11/29/2025</b>
81.	Unit 2-4	Shower # 24J (near visiting rooms)	105 CMR 451.123	Maintenance: Mold on walls <b>Cleaned by worker detail 11/29/2025</b>

#### Deficiencies under the Recommended Standards (.300 series)

30 new deficiencies and 7 repeat deficiencies (indicated by an \*) were found during the inspection:

1.	Control 6-1 & 6-1A	105 CMR 451.353*	Interior Maintenance: Area around ceiling vent dusty <b>Scheduled for cleaning by Maintenance Dept. on 12/14/2025</b>
2.	Control 6-1 & 6-1A	105 CMR 451.350	Structural Maintenance: Window cracked Glass and Mirror Inc. Contractor accepted bid for replacement windows in September 2025. Manufacturing in progress. Delivery date 01/30/2026
3.	Unit 6-1A	Storage Room # 61G	Interior Maintenance: Rodent droppings observed <b>Cleaned by unit detail 11/09/2025</b>
4.	Unit 6-1A	Storage Room # 61G	Interior Maintenance: Objectionable odor observed <b>Old property bags removed and Storage room cleaned by unit detail</b>

			11/09/2025
5. Unit 6-1	Kitchenette	105 CMR 451.353	Interior Maintenance: Rodent droppings observed <b>Cleaned by unit detail 11/03/2025</b>
6. Unit 6-1	Second Floor Storage Room	105 CMR 451.353	Interior Maintenance: Rodent droppings observed <b>Cleaned by unit detail 11/03/2025</b>
7. Unit 6-1	Cells	105 CMR 451.353	Interior Maintenance: Mold on ceiling in cell # 31 <b>Cell placed offline 11/29/2025. ServPro Contacted for inspection. Appointment time 12/23/2025</b>
8. Control 6-3 & 6-4		105 CMR 451.353	Interior Maintenance: Light shield missing <b>Light shield was removed for ongoing maintenance/ plumbing work in the ceiling. To be placed back in by 12/18/2025 once completed.</b>
9. Unit 6-3	Kitchenette	105 CMR 451.353*	Interior Maintenance: Rodent droppings observed <b>Cleaned by unit detail 11/03/2025</b>
10. Unit 6-3	Meeting Room # 63B	105 CMR 451.353	Interior Maintenance: Rodent droppings observed <b>Cleaned by unit detail 11/03/2025</b>
11. Unit 6-3	Meeting Room # 63B	105 CMR 451.353	Interior Maintenance: Ceiling vent dusty outside of Meeting Room <b>Cleaned by unit detail 11/29/2025</b>
12. Unit 6-4	Kitchenette	105 CMR 451.353	Interior Maintenance: Electric hand dryer out-of-order <b>Department electrician Bob Jackson notified. Scheduled for replacement on 2/28/26</b>
13. Unit 6-4	Kitchenette	105 CMR 451.353	Interior Maintenance: Soap dispenser damaged <b>Replaced by maintenance 11/19/2025</b>
14. Visiting Rooms		105 CMR 451.353	Interior Maintenance: Floor dirty in room # 501 <b>Cleaned by unit detail 11/04/2025</b>
15. Visiting Rooms		105 CMR 451.353	Interior Maintenance: Ceiling tile missing in room # 504 <b>Scheduled for repair with new ceiling tiles by 2/28/2026</b>
16. Medical Area	Biohazard Storage # 5507	105 CMR 451.353	Interior Maintenance: Rodent droppings observed <b>Cleaned by Dept. Custodians 11/07/2025</b>
17. Psychiatric Housing Unit 5552	Kitchenette	105 CMR 451.353	Interior Maintenance: Rodent droppings observed <b>Cleaned by unit detail 11/03/2025</b>
18. Psychiatric Housing Unit # 5552	Slop Sink Room # 5572	105 CMR 451.353	Interior Maintenance: Rodent droppings observed <b>Cleaned by unit detail 11/03/2025</b>
19. Unit 4-1	Recreation Deck 4-1 & 4-2	105 CMR 451.353	Interior Maintenance: Standing water observed <b>Squeegeed by unit detail 11/04/2025</b>
20. Unit 4-1	Kitchenette	105 CMR 451.353	Interior Maintenance: Rodent droppings observed <b>Cleaned by unit detail 11/03/2025</b>
21. Unit 4-2	Kitchenette	105 CMR 451.353*	Interior Maintenance: Rodent droppings observed <b>Cleaned by unit detail 11/03/2025</b>
22. Unit 4-3	Closet # 43F	105 CMR 451.353	Interior Maintenance: Rodent droppings observed <b>Cleaned by unit detail 11/03/2025</b>
23. Unit 4-3	Closet # 43F	105 CMR 451.353	Interior Maintenance: Ceiling vent dusty outside of closet <b>Cleaned by unit detail 11/29/2025</b>

24. Unit 4-3	Slop Sink # 43D	105 CMR 451.353	Interior Maintenance: Wall vent dusty <b>Cleaned by unit detail on 11/22/2025</b>
25. Unit 4-3	Slop Sink # 43D	105 CMR 451.353	Interior Maintenance: Standing water observed on floor <b>Mopped and dried by unit detail 11/03/2025</b>
26. Unit 4-4	Kitchenette	105 CMR 451.353*	Interior Maintenance: Rodent droppings observed <b>Cleaned by unit detail on 11/04/2025</b>
27. Unit 4-4	Meeting Room # 44E	105 CMR 451.353	Interior Maintenance: Rodent droppings observed <b>Cleaned by unit detail on 11/04/2025</b>
28. Slop Sink Room # 3503		105 CMR 451.353	Interior Maintenance: Mold in slop sink <b>Scrubbed by unit detail on 11/08/2025</b>
29. File Room Kitchen # 3516		105 CMR 451.353	Interior Maintenance: Rodent droppings observed <b>Cleaned by unit detail on 11/04/2025</b>
30. Unit 2-1	Kitchenette	105 CMR 451.353	Interior Maintenance: Electric hand dryer out-of-order <b>Department electrician Bob Jackson notified. Scheduled for replacement on 2/28/26</b>
31. Unit 2-3	Cells	105 CMR 451.353	Interior Maintenance: Objectionable odor observed coming from several toilets in unoccupied cells <b>Cleaned by detainee worker detail 11/30/2025</b>
32. Unit 2-3	Kitchenette	105 CMR 451.353*	Interior Maintenance: Rodent droppings observed <b>Cleaned by detainee worker detail 11/30/2025</b>
33. Unit 2-3	Kitchenette	105 CMR 451.353*	Interior Maintenance: Hand wash sink dirty <b>Cleaned by detainee worker detail 11/30/2025</b>
34. Unit 2-3	Kitchenette	105 CMR 451.353	Interior Maintenance: Dead insects observed <b>Removed and cleaned by detainee worker detail 11/30/2025</b>
35. Unit 2-4	Cells	105 CMR 451.353	Interior Maintenance: Objectionable odor observed coming from multiple unoccupied cells <b>Cleaned by detainee worker detail 11/30/2025</b>
36. Unit 2-4	Cells	105 CMR 451.353	Interior Maintenance: Dead flies observed in cell # 5 <b>Removed and cleaned by detainee worker detail 11/30/2025</b>
37. Unit 2-4	Closet # 24G	105 CMR 451.353	Interior Maintenance: Rodent droppings observed <b>Cleaned by detainee worker detail 11/30/2025</b>

#### Contact Visits/Roll Call

#### Deficiencies under the Required Standards (.100 and .200 series)

1 repeat deficiency (indicated by an \*) was found during the inspection:

1. Female Visitors Bathroom	105 CMR 451.130*	Plumbing: Plumbing not maintained in good repair, no hot or cold water available at hand wash sink # 1 <b>Water supply repaired by maintenance on 11/25/25</b>
-----------------------------	------------------	--

## Entry Level (Inside)

### Deficiencies under the Required Standards (.100 and .200 series)

2 new deficiencies were found during the inspection:

1. Female Staff Locker Room # 1076	105 CMR 451.123	Maintenance: Ceiling tiles water damaged <b>Scheduled for replacement with new ceiling tiles on 2/28/2026</b>
2. Outside Administration	Male Bathroom # 1015	Plumbing: Plumbing not maintained in good repair, no water supplied to hand wash sink # 1 <b>Scheduled for replacement with new ceiling tiles on 2/28/2026</b>

## Ground Level

### Deficiencies under the Required Standards (.100 and .200 series)

1 new deficiency was found during the inspection:

1. Staff Bathroom # G6	105 CMR 451.123	Maintenance: Ceiling water damaged <b>Scheduled to be replaced with new ceiling tiles on 2/28/2026</b>
------------------------	-----------------	--

### Deficiencies under the Recommended Standards (.300 series)

1 new deficiency was found during the inspection:

1. Female Booking Area	105 CMR 451.353	Interior Maintenance: Ceiling tiles missing and water damaged <b>Scheduled to be replaced with new ceiling tiles on 2/28/2026</b>
------------------------	-----------------	--

## Food Service Area

### Deficiencies under the Required Standards (.100 and .200 series)

1 new deficiencies and 3 repeat deficiencies (indicated by an \*) were found during the inspection:

1. Dry Storage # G23	105 CMR 451.200*	Facility not cleaned as often as necessary, rodent droppings observed. Standard found in 105 CMR 590; FC 6-501.12(A). <b>** Corrected On-Site ** Cleaned by kitchen workers 11/03/25</b>
2. Inmate Break Area	105 CMR 451.200	Cleaning of Equipment and Utensils, Objective: Nonfood contact surfaces of equipment dirty, interior of microwave oven dirty. Standard found in 105 CMR 590; FC 4-601.11(C). <b>Cleaned by kitchen workers 11/03/2025</b>
3. Bread Refrigerator	105 CMR 451.200 # 6	Preventing Contamination after Receiving; Preventing Food and Ingredient Contamination: Separating types of raw animal foods from each other during storage, preparation, holding, and display by arranging each type of food in equipment so that cross contamination of one type with another is prevented, ground beef stored above whole pork. Standard found in 105 CMR 590; FC 3-302.11(A)(2)(b). ** <b>Corrected On-Site ** Counselled Civilian staff on ServSafe standards 11/03/2025</b>
4. Single Compartment Sink	105 CMR 451.200	Plumbing System; Operation and Maintenance: Plumbing system not maintained in good repair, sink leaking. Standard found in 105 CMR 590; FC 5-205.15(B). <b>Repaired by Maintenance 11/08/2025</b>

## **SECTION 2: Areas Found to be in Compliance**

EHRS inspected 232 additional areas of the facility which were found to be in compliance.

## **Section 3: Areas EHRS did not inspect**

EHRS did not inspect 5 areas of the facility because they were either in use, locked, or under construction.

1. Floor 6.5	Inmate Bathroom # 6505	Unable to Inspect – Not in Use
2. Floor 6.5	Inmate Bathroom # 6506	Unable to Inspect – Not in Use
3. 4th Floor	Unit 4-4	Shower # 44H (near cell # 9)
4. 4th Floor	Unit 4-4	Shower # 44D (near meeting room # 44E)
5. Entry Level	Blue Shirt's Locker Room (Inside) # 1075	Unable to Inspect – In Use

## **SECTION 4: Plan of Correction**

This facility does not comply with the Department's Regulations cited above. In accordance with 105 CMR 451.404, please submit a plan of correction within 10 working days of receipt of this notice. The Plan of Correction must include:

1. Specific corrective steps to be taken
2. A timetable for the corrective actions for larger projects
3. The date by which correction will be achieved
4. Any interim measures being implemented to ensure the health and safety of incarcerated individuals and facility staff
5. The plan should be signed by the Superintendent or Administrator and submitted to my attention, at the address listed above.

## **SECTION 5: Observations and Recommendations**

1. The inmate population was 279 at the time of inspection.

To review the specific regulatory requirements please visit our website at [www.mass.gov/dph/dcs](http://www.mass.gov/dph/dcs) and click on "Correctional Facilities" [105 CMR 451.000](http://www.mass.gov/dph/dcs/105-cmr-451.000) available in both PDF and RTF formats. For more specific information about the food standards, you can download the merged food code, which can be found [here](#).


An inspection may also include observations of other conditions which could constitute a threat to the health or safety of inmates or employees, including but not limited to the standards set forth by the Department as follows, and report on such pursuant to 451.402(B). You can use these links below to review these standards:

- [105 CMR 205.000](http://www.mass.gov/dph/dcs/105-cmr-205.000): Minimum Standards Governing Medical Records and Conduct of Physical Examinations in Correctional Facilities
- [105 CMR 480.000](http://www.mass.gov/dph/dcs/105-cmr-480.000): Minimum requirements for the Management of Medical or Biological Waste
- [105 CMR 500.000](http://www.mass.gov/dph/dcs/105-cmr-500.000): Good Manufacturing Practices for Food

This inspection report is true and accurate to the best of my knowledge.

Sincerely,

Hannah LeBeau  
Environmental Health Officer, EHRS, BCEH

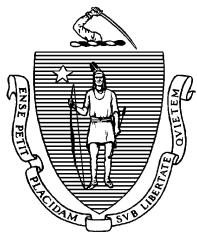

The Commonwealth of Massachusetts  
Executive Office of Health and Human Services  
Department of Public Health  
Bureau of Climate and Environmental Health  
Division of Environmental Health Regulations and Standards  
67 Forest Street, Suite # 100  
Marlborough, MA 01752  
617-624-6000 | [mass.gov/dph](http://mass.gov/dph)

# **Maura T. Healey**

## Governor

# **Kimberley Driscoll**

## Lieutenant Governor

## **Kiame Mahaniah, MD, MBA**

## **Robert Goldstein, MD, PhD**

January 6, 2026

Steven W. Tompkins, Sheriff  
Suffolk County Sheriff's Department  
20 Bradston Street  
Boston, MA 02118 (electronic copy)

Re: Plan of Correction – Suffolk County Jail, Boston

Dear Sheriff Tompkins:

The Massachusetts Department of Public Health, Division of Environmental Regulations and Standards (EHRS) has received your Plan of Correction dated December 17, 2025. After review, the EHRS finds the plan addresses all the deficiencies noted.

Thank you for your prompt attention to this matter, should you have any questions please contact me at the address listed above.

Sincerely,

Hannah UBeau

Hannah LeBeau  
Environmental Health Officer, EHRS, BCEH

cc: Jose Mojica, Superintendent  
Sergeant Tyler Crocker, EHSO/FSO

(electronic copy)  
(electronic copy)