

The Commonwealth of Massachusetts
Executive Office of Health and Human Services
Department of Public Health
Bureau of Climate and Environmental Health
Division of Environmental Health Regulations and Standards
67 Forest Street, Suite # 100
Marlborough, MA 01752
617-624-6000 | mass.gov/dph

Maura T. Healey
Governor

Kiame Mahaniah, MD, MBA
Secretary

Kimberley Driscoll
Lieutenant Governor

Robert Goldstein, MD, PhD
Commissioner

August 3, 2026

To: Shawn Jenkins, Commissioner, Department of Corrections (electronic copy)
Kiame Mahaniah, MD, MBA, Secretary, Executive Office of Health and Human Services (electronic copy)
Clerk, Massachusetts House of Representatives (electronic copy)
Clerk, Massachusetts Senate (electronic copy)
Sergeant Tyler Crocker, Environmental Health and Safety Officer (electronic copy)

Greetings,


Pursuant to 105 CMR 451.403, please find the inspection report for Suffolk County House of Correction, the Plan of Correction (POC) from the facility and the POC acceptance letter from the Division of Environmental Health Regulations and Standards (EHRS).

Sincerely,

Hannah LeBeau

Hannah LeBeau
Environmental Analyst, EHRS, BCEH

Cc: Robert Goldstein, MD, PhD, Commissioner, DPH (electronic copy)
Terrence Reidy, Secretary, Executive Office of Public Safety and Security (electronic copy)
Daniel J. Prendergast, Assistant Commissioner ISD/ Health Division, City of Boston (electronic copy)
Brianna Arruda, Director, Policy Development and Compliance Unit (electronic copy)
Michael Lally, Superintendent (electronic copy)

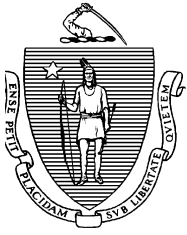

The Commonwealth of Massachusetts
Executive Office of Health and Human Services
Department of Public Health
250 Washington Street, Boston, MA 02108-4619
617-624-6000 | mass.gov/dph

Maura T. Healey
Governor

Kimberley Driscoll
Lieutenant Governor

Kiame Mahaniah, MD, MBA
Secretary

Robert Goldstein, MD, PhD
Commissioner

May 20, 2026

Steven W. Tompkins, Sheriff
Suffolk County Sheriff's Department
20 Bradston Street
Boston, MA 02118 (electronic copy)

Re: Facility Inspection – Suffolk County House of Corrections, Boston

Dear Sheriff Tompkins:

The Massachusetts Department of Public Health (Department) Division of Environmental Health Regulations and Standards (EHRS) conducted an inspection of the Suffolk County House of Corrections on April 27, 28, and 29, 2026 accompanied by Captain Brian Reynolds, in accordance with Department regulations 105 CMR 451.000: Minimum Health and Sanitation Standards and Inspection Procedures for Correctional Facilities.

The inspection identified 833 total deficiencies: 291 new deficiencies under the Required Standards (.100 and .200 series), 141 repeat deficiencies under the Required Standards, 310 new deficiencies under the Recommended Standards (.300 series), 90 repeat deficiencies under the Recommended Standards, and 1 new deficiency under 105 CMR 451.402(B).

Overview

Section 1 provides details of all deficiencies, including repeat deficiencies, found during the inspection. These are categorized by Required Standards, Recommended Standards, or additional applicable regulatory standards.

Section 2 provides information on areas that EHRS found to be compliant.

Section 3 documents the areas that EHRS did not inspect.

Section 4 provides information on submitting a Plan of Correction for the identified deficiencies.

Section 5 outlines observations and recommendations related to the inspection.

SECTION 1: Health and Safety Deficiencies

Building #1

Deficiencies under the Required Standards (.100 and .200 series)

102 new deficiencies and 29 repeat deficiencies (indicated by an *) were found during the inspection:

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
1. 11th Floor	Slop Sink Room # 1158		105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, drain clogged at slop sink
2. 11th Floor	Unit 1-11-1	Showers	105 CMR 451.130*	Hot Water: Shower water temperature 69°F at shower # 3
3. 11th Floor	Unit 1-11-1	Showers	105 CMR 451.123*	Maintenance: Walls dirty in shower # 1, 2, and 3
4. 11th Floor	Unit 1-11-1	Showers	105 CMR 451.123*	Maintenance: Ceiling vent dusty in shower # 2
5. 11th Floor	Unit 1-11-1	Showers	105 CMR 451.123	Maintenance: Ceiling vent dusty in shower # 1 and 3
6. 11th Floor	Unit 1-11-1	Kitchenette	105 CMR 451.200	Food Storage, Preparation and Service: Food preparation not in compliance with 105 CMR 590.000, interior of microwave oven dirty
7. 11th Floor	Unit 1-11-2	Showers	105 CMR 451.123*	Maintenance: Walls dirty in shower # 1 and 2
8. 11th Floor	Unit 1-11-2	Showers	105 CMR 451.123*	Maintenance: Ceiling vent dusty in shower # 3
9. 10th Floor	Staff Bathroom # 1074		105 CMR 451.123	Maintenance: Ceiling vent dusty
10. 10th Floor	Unit 1-10-1	Showers	105 CMR 451.123	Maintenance: Mop stored upside down in shower # 1
11. 10th Floor	Unit 1-10-1	Showers	105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, shower # 1 continuously running
12. 10th Floor	Unit 1-10-1	Kitchenette	105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, drain cover missing at handwash sink
13. 10th Floor	Unit 1-10-1	Cells	105 CMR 451.103	Mattresses: Mattress cover damaged in cell # 9
14. 10th Floor	Unit 1-10-2	Showers	105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, shower # 1 leaking
15. 10th Floor	Unit 1-10-2	Showers	105 CMR 451.123	Maintenance: Ceiling vent dusty in shower # 1, 2, and 3
16. 10th Floor	Unit 1-10-2	Kitchenette	105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, handwash sink out-of-order
17. 10th Floor	Unit 1-10-2	Kitchenette	105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, handwash sink clogged

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
18. 10th Floor	Unit 1-10-4 Women's MAT Program	Staff Bathroom	105 CMR 451.123	Maintenance: Soap dispenser damaged
19. 10th Floor	Unit 1-10-4 Women's MAT Program	Shower	105 CMR 451.123*	Maintenance: Wall damaged around water control
20. 10th Floor	Unit 1-10-4 Women's MAT Program	Staff Bathroom	105 CMR 451.123*	Maintenance: Ceiling vent dusty
21. 9th Floor	Staff Bathroom # 944		105 CMR 451.123*	Maintenance: Ceiling vent dusty
22. 9th Floor	Unit 1-9-1	Shower Area	105 CMR 451.123*	Maintenance: Walls dirty in shower # 1
23. 9th Floor	Unit 1-9-1	Shower Area	105 CMR 451.123	Maintenance: Ceiling vent dusty in shower # 1
24. 9th Floor	Unit 1-9-1	Shower Area	105 CMR 451.123	Maintenance: Door frame damaged in shower # 1
25. 9th Floor	Unit 1-9-1	Shower Area	105 CMR 451.123	Maintenance: Walls dirty in shower # 3
26. 9th Floor	Unit 1-9-1	Shower Area	105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, shower # 3 continuously running
27. 9th Floor	Unit 1-9-1	Shower Area	105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, handicapped shower attachment missing
28. 9th Floor	Unit 1-9-1	Kitchenette	105 CMR 451.200	Food Storage, Preparation and Service: Food preparation not in compliance with 105 CMR 590.000, microwave oven damaged
29. 9th Floor	Unit 1-9-1	Kitchenette	105 CMR 451.126	Hot Water for Bathing and Hygiene: Hot water temperature 88°F at handwash sink
30. 9th Floor	Unit 1-9-2	Shower Area	105 CMR 451.123	Maintenance: Wall paint damaged in shower # 1
31. 9th Floor	Unit 1-9-2	Shower Area	105 CMR 451.123	Maintenance: Ceiling vent rusted in shower # 2
32. 9th Floor	Unit 1-9-2	Shower Area	105 CMR 451.123	Maintenance: Walls dirty in shower # 2
33. 8th Floor	Unit 1-8-1	Showers	105 CMR 451.123*	Maintenance: Walls dirty in shower # 1 and 2
34. 8th Floor	Unit 1-8-1	Showers	105 CMR 451.123*	Maintenance: Ceiling vent dusty in shower # 1
35. 8th Floor	Unit 1-8-2	Showers	105 CMR 451.123	Maintenance: Ceiling vent dusty in shower # 2 and 3
36. 8th Floor	Unit 1-8-2	Showers	105 CMR 451.123	Maintenance: Drain flies observed in shower # 1
37. 8th Floor	Unit 1-8-2	Showers	105 CMR 451.123	Maintenance: Walls dirty in shower # 2
38. 8th Floor	Unit 1-8-2	Showers	105 CMR 451.123	Maintenance: Ceiling paint damaged in shower # 2

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
39. 8th Floor	Unit 1-8-2	Cells	105 CMR 451.103	Mattresses: Mattress cover missing in cell # 6, 11, and 14
40. 6th Floor	Unit 1-6-1	Kitchenette	105 CMR 451.200	Food Storage, Preparation and Service: Food preparation not in compliance with 105 CMR 590.000, interior of microwave oven dirty
41. 6th Floor	Unit 1-6-1	Upper Showers	105 CMR 451.123	Maintenance: Door frame rusted in shower # 3
42. 6th Floor	Unit 1-6-1	Upper Showers	105 CMR 451.123	Maintenance: Walls dirty in shower # 1
43. 6th Floor	Unit 1-6-1	Upper Showers	105 CMR 451.123	Maintenance: Ceiling vent dusty in shower # 1 and 2
44. 6th Floor	Unit 1-6-1	Upper Showers	105 CMR 451.123	Maintenance: Sprinkler shroud rusted in shower # 3
45. 6th Floor	Unit 1-6-1	Upper Showers	105 CMR 451.123	Maintenance: Threshold epoxy damaged in shower # 3
46. 6th Floor	Unit 1-6-1	Lower Shower Area	105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, handicapped shower attachment missing in shower # 3
47. 6th Floor	Unit 1-6-1	Lower Shower Area	105 CMR 451.123	Maintenance: Ceiling vent dusty in shower # 1, 2, and 3
48. 6th Floor	Unit 1-6-1	Lower Shower Area	105 CMR 451.123	Maintenance: Door frame rusted in shower # 1 and 3
49. 6th Floor	Unit 1-6-2	Kitchenette	105 CMR 451.200	Food Storage, Preparation and Service: Food preparation not in compliance with 105 CMR 590.000, interior of microwave oven dirty near television and near cell # 16
50. 6th Floor	Unit 1-6-2	Upper Cells	105 CMR 451.103	Mattresses: Mattress cover missing in cell # 18 and 27
51. 6th Floor	Unit 1-6-2	Upper Showers	105 CMR 451.123*	Maintenance: Ceiling vent dusty in shower # 2
52. 6th Floor	Unit 1-6-2	Upper Showers	105 CMR 451.123*	Maintenance: Wall damaged near water control in shower # 1
53. 6th Floor	Unit 1-6-2	Upper Showers	105 CMR 451.123*	Maintenance: Walls dirty in shower # 2
54. 6th Floor	Unit 1-6-2	Upper Showers	105 CMR 451.123	Maintenance: Sprinkler shroud rusted in shower # 1 and 2
55. 6th Floor	Unit 1-6-2	Upper Showers	105 CMR 451.123	Maintenance: Door frame rusted in shower # 2
56. 6th Floor	Unit 1-6-2	Upper Showers	105 CMR 451.123	Maintenance: Ceiling vent dusty in shower # 3
57. 6th Floor	Unit 1-6-2	Lower Showers	105 CMR 451.123*	Maintenance: Ceiling vent dusty in shower # 2
58. 6th Floor	Unit 1-6-2	Lower Showers	105 CMR 451.123	Maintenance: Door frame rusted in shower # 1 and 2
59. 6th Floor	Unit 1-6-2	Lower Showers	105 CMR 451.123	Maintenance: Drain flies observed in shower # 2

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
60. 6th Floor	Unit 1-6-2	Lower Showers	105 CMR 451.123	Maintenance: Shower curtain damaged in shower # 2
61. 6th Floor	Unit 1-6-2	Lower Showers	105 CMR 451.123	Maintenance: Ceiling vent dusty in shower # 3
62. 5th Floor	Unit 1-5-1	Shower Area	105 CMR 451.123	Maintenance: Door frame damaged in shower # 1 and 2
63. 5th Floor	Unit 1-5-1	Shower Area	105 CMR 451.123	Maintenance: Sprinkler shroud rusted in shower # 2
64. 4th Floor	Staff Bathroom # 445		105 CMR 451.123	Maintenance: Ceiling vent dusty
65. 4th Floor	Slop Sink # 454		105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, slop sink clogged
66. 4th Floor	Unit 1-4-1	Shower Area	105 CMR 451.123*	Maintenance: Walls dirty in shower # 1
67. 4th Floor	Unit 1-4-1	Shower Area	105 CMR 451.123	Maintenance: Walls dirty in shower # 3
68. 4th Floor	Unit 1-4-1	Shower Area	105 CMR 451.123	Maintenance: Ceiling vent dusty in shower # 1
69. 4th Floor	Unit 1-4-1	Shower Area	105 CMR 451.123	Maintenance: Door frame damaged in shower # 1
70. 4th Floor	Unit 1-4-1	Shower Area	105 CMR 451.123	Maintenance: Wet mop stored in bucket in shower # 2
71. 4th Floor	Unit 1-4-1	Shower Area	105 CMR 451.123	Maintenance: Debris in drain in shower # 2
72. 4th Floor	Unit 1-4-1	Cells	105 CMR 451.103	Mattresses: Mattress cover missing in cell # 4
73. 4th Floor	Unit 1-4-2	Shower Area	105 CMR 451.123*	Maintenance: Ceiling vent dusty in shower # 3
74. 4th Floor	Unit 1-4-2	Shower Area	105 CMR 451.123	Maintenance: Wet mop stored on floor in shower # 1
75. 4th Floor	Unit 1-4-2	Shower Area	105 CMR 451.123	Maintenance: Toilet auger stored with cleaning supplies in shower # 1
76. 4th Floor	Unit 1-4-2	Shower Area	105 CMR 451.123	Maintenance: Walls dirty in shower # 2 and 3
77. 4th Floor	Unit 1-4-2	Shower Area	105 CMR 451.123	Maintenance: Ceiling vent dusty in shower # 2
78. 4th Floor	Unit 1-4-2	Cells	105 CMR 451.103	Mattresses: Mattress damaged in cell # 3
79. 3rd Floor	Unit 1-3-1	Cells	105 CMR 451.103	Mattresses: Mattress cover missing in cell # 8
80. 3rd Floor	Unit 1-3-2	Staff Bathroom # 360	105 CMR 451.123	Maintenance: Objectionable odor observed
81. 3rd Floor	Unit 1-3-2	Shower Area	105 CMR 451.123*	Maintenance: Debris in drain in shower # 1
82. 3rd Floor	Unit 1-3-2	Shower Area	105 CMR 451.123*	Maintenance: Debris on floor in shower # 1
83. 3rd Floor	Unit 1-3-2	Shower Area	105 CMR 451.123*	Maintenance: Walls dirty in shower # 1

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
84. 3rd Floor	Unit 1-3-2	Shower Area	105 CMR 451.123*	Maintenance: Ceiling dirty in shower # 1
85. 3rd Floor	Unit 1-3-2	Shower Area	105 CMR 451.123	Maintenance: Ceiling vent dusty in shower # 1 and 3
86. 3rd Floor	Unit 1-3-2	Shower Area	105 CMR 451.123	Maintenance: Door frame dirty in shower # 1
87. 3rd Floor	Unit 1-3-2	Shower Area	105 CMR 451.123	Maintenance: Wet mop stored on floor in shower # 2
88. 3rd Floor	Unit 1-3-2	Shower Area	105 CMR 451.123	Maintenance: Debris on floor in shower # 2 and 3
89. 3rd Floor	Unit 1-3-2	Shower Area	105 CMR 451.123	Maintenance: Door frame rusted in shower # 3
90. 3rd Floor	Unit 1-3-2	Shower Area	105 CMR 451.123	Maintenance: Floor dirty in shower # 3
91. 3rd Floor	Unit 1-3-2	Shower Area	105 CMR 451.123	Maintenance: Walls dirty in shower # 3
92. 3rd Floor	Unit 1-3-2	Kitchenette	105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, debris in drain
93. 3rd Floor	Unit 1-3-2	Kitchenette	105 CMR 451.126	Hot Water for Bathing and Hygiene: Hot water temperature 59°F at handwash sink
94. 2nd Floor	Unit 1-2-1	Common Area	105 CMR 451.200*	Food Storage, Preparation and Service: Food preparation not in compliance with 105 CMR 590.000, interior of microwave oven dirty near cell # 19
95. 2nd Floor	Unit 1-2-1	Bathroom # 230	105 CMR 451.123*	Maintenance: Walls dirty in shower # 4
96. 2nd Floor	Unit 1-2-1	Bathroom # 230	105 CMR 451.123*	Maintenance: Floor dirty in shower # 1
97. 2nd Floor	Unit 1-2-1	Bathroom # 230	105 CMR 451.123	Maintenance: No curtain at shower # 1 and 2
98. 2nd Floor	Unit 1-2-1	Bathroom # 230	105 CMR 451.123	Maintenance: Floor drain dirty in shower # 1
99. 2nd Floor	Unit 1-2-1	Bathroom # 230	105 CMR 451.123	Maintenance: Floor dirty in shower # 3 and 4
100. 2nd Floor	Unit 1-2-1	Bathroom # 230	105 CMR 451.123	Maintenance: Walls dirty in shower # 2
101. 2nd Floor	Unit 1-2-1	Bathroom # 230	105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, showerhead missing in shower # 1 and 2
102. 2nd Floor	Unit 1-2-1	Bathroom # 230	105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, shower # 2 leaking
103. 2nd Floor	Unit 1-2-1	Bathroom # 230	105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, showerhead covered in plastic bag in shower # 3

	Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
104.	2nd Floor	Unit 1-2-1	Bathroom # 230	105 CMR 451.123	Maintenance: Floor paint damaged outside showers
105.	2nd Floor	Unit 1-2-1	Bathroom # 230	105 CMR 451.123	Maintenance: Ceiling vent rusted above toilet
106.	2nd Floor	Unit 1-2-1	Cells	105 CMR 451.103	Mattresses: Mattress damaged in cell # 27
107.	1st Floor	Female Bathroom # 140		105 CMR 451.130*	Plumbing: Plumbing not maintained in good repair, handwash sink # 1 out-of-order

Deficiencies under the Recommended Standards (.300 series)

186 new deficiencies and 35 repeat deficiencies (indicated by an *) were found during the inspection:

	Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
1.	All Cells			105 CMR 451.320*	Cell Size: Inadequate floor space in all cells
2.	11th Floor	Unit 1-11-1	Common Area	105 CMR 451.353	Interior Maintenance: Wall dusty around vent near television
3.	11th Floor	Unit 1-11-1	Cells	105 CMR 451.353	Interior Maintenance: Wall vent blocked in cell # 15
4.	11th Floor	Unit 1-11-1	Cells	105 CMR 451.353*	Interior Maintenance: Wall vent blocked in cell # 4
5.	11th Floor	Unit 1-11-2	Common Area	105 CMR 451.353	Interior Maintenance: Wall dusty around vent near television
6.	11th Floor	Unit 1-11-2	Cells	105 CMR 451.353	Interior Maintenance: Ceiling vent blocked in cell # 2 and 15
7.	10th Floor	Offices		105 CMR 451.353	Interior Maintenance: Ceiling tiles dirty throughout
8.	10th Floor	Unit 1-10-1	Common Area	105 CMR 451.353	Interior Maintenance: Ceiling vent dusty
9.	10th Floor	Unit 1-10-1	Cells	105 CMR 451.353	Interior Maintenance: Wall vent blocked in cell # 10 and 15
10.	10th Floor	Unit 1-10-1	Cells	105 CMR 451.353	Interior Maintenance: Ceiling paint damaged in cell # 11, 15, and 16
11.	10th Floor	Unit 1-10-1	Cells	105 CMR 451.353	Interior Maintenance: Door window cracked in cell # 1 and 14
12.	10th Floor	Unit 1-10-2	Common Area	105 CMR 451.353	Interior Maintenance: Ceiling vent dusty
13.	10th Floor	Unit 1-10-2	Kitchenette	105 CMR 451.353	Interior Maintenance: Cabinet below handwash sink dirty
14.	10th Floor	Unit 1-10-2	Cells	105 CMR 451.353	Interior Maintenance: Wall vent blocked in cell # 1
15.	10th Floor	Unit 1-10-2	Cells	105 CMR 451.353	Interior Maintenance: Ceiling paint damaged in cell # 10, 12, and 15
16.	10th Floor	Unit 1-10-4 Women's MAT Program	Supply Closet	105 CMR 451.344*	Illumination in Habitable Areas: Light(s) not functioning properly, light out

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
17. 10th Floor	Unit 1-10-4 Women's MAT Program	Supply Closet	105 CMR 451.353	Interior Maintenance: Wet mop stored in bucket
18. 10th Floor	Unit 1-10-4 Women's MAT Program	Exam Room	105 CMR 451.353	Interior Maintenance: Ceiling vent dusty
19. 10th Floor	Unit 1-10-4 Women's MAT Program	Exam Room	105 CMR 451.353	Interior Maintenance: Ceiling paint damaged
20. 10th Floor	Unit 1-10-4 Women's MAT Program	Cells	105 CMR 451.353	Interior Maintenance: Cell # 18 generally dirty
21. 10th Floor	Unit 1-10-4 Women's MAT Program	Cells	105 CMR 451.353	Interior Maintenance: Ceiling paint damaged in cell # 20
22. 10th Floor	Unit 1-10-3	Cells	105 CMR 451.353	Interior Maintenance: Ceiling paint damaged in cell # 6
23. 10th Floor	Unit 1-10-3	Cells	105 CMR 451.353	Interior Maintenance: Wall vent blocked in cell # 1 and 4
24. 9th Floor	Slop Sink # 956		105 CMR 451.353*	Interior Maintenance: Slop sink dirty
25. 9th Floor	Recreation Deck # 940		105 CMR 451.353*	Interior Maintenance: Ceiling paint damaged
26. 9th Floor	Recreation Deck # 940		105 CMR 451.353*	Interior Maintenance: Wall paint damaged
27. 9th Floor	Recreation Deck # 940		105 CMR 451.353*	Interior Maintenance: Light not secure to ceiling
28. 9th Floor	Programs/Ed ucation Offices		105 CMR 451.353	Interior Maintenance: Ceiling vent blocked
29. 9th Floor	Programs/Ed ucation Offices		105 CMR 451.353	Interior Maintenance: Ceiling vent dusty
30. 9th Floor	Unit 1-9-1	Common Area	105 CMR 451.353	Interior Maintenance: Wall dusty around vent near television
31. 9th Floor	Unit 1-9-1	Common Area	105 CMR 451.353	Interior Maintenance: Vent dusty near Recreation Deck
32. 9th Floor	Unit 1-9-1	Kitchenette	105 CMR 451.353	Interior Maintenance: Cabinet under handwash sink dirty
33. 9th Floor	Unit 1-9-1	Cells	105 CMR 451.353	Interior Maintenance: Wall vent blocked in cell # 1, 2, 5, and 9
34. 9th Floor	Unit 1-9-1	Cells	105 CMR 451.353	Interior Maintenance: Ceiling paint damaged in cell # 7 and 8
35. 9th Floor	Unit 1-9-2	Kitchenette	105 CMR 451.353	Interior Maintenance: Cabinet under handwash sink dirty
36. 9th Floor	Unit 1-9-2	Cells	105 CMR 451.353	Interior Maintenance: Ceiling paint damaged in cell # 8
37. 8th Floor	Unit 1-8-1	Common Area	105 CMR 451.353	Interior Maintenance: Wall vent dusty near television
38. 8th Floor	Unit 1-8-1	Laundry Area	105 CMR 451.360	Protective Measures: Rodent droppings observed

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
39. 8th Floor	Unit 1-8-1	Utility Closet # 834	105 CMR 451.360*	Protective Measures: Rodent droppings observed
40. 8th Floor	Unit 1-8-1	Utility Closet # 834	105 CMR 451.353	Interior Maintenance: Floor dirty
41. 8th Floor	Unit 1-8-1	Utility Closet # 834	105 CMR 451.353	Interior Maintenance: Standing water stored in mop bucket
42. 8th Floor	Unit 1-8-1	Cells	105 CMR 451.353	Interior Maintenance: Ceiling paint damaged in cell # 3
43. 8th Floor	Unit 1-8-1	Cells	105 CMR 451.353	Interior Maintenance: Wall vent blocked in cell # 5, 8, 9, 13, 14, and 16
44. 8th Floor	Unit 1-8-2	Recreation Deck	105 CMR 451.353	Interior Maintenance: Door knob damaged on 1-8-1 entrance to Recreation Deck
45. 8th Floor	Unit 1-8-2	Staff Office	105 CMR 451.360	Protective Measures: Rodent droppings observed
46. 8th Floor	Unit 1-8-2	Common Area	105 CMR 451.353	Interior Maintenance: Wall vent dusty near television mount
47. 8th Floor	Unit 1-8-2	Common Area	105 CMR 451.353	Interior Maintenance: Ceiling dirty outside of cell # 15
48. 8th Floor	Unit 1-8-2	Recreation Deck	105 CMR 451.353	Interior Maintenance: Ceiling vent dusty near Recreation Deck
49. 8th Floor	Unit 1-8-2	Cells	105 CMR 451.353	Interior Maintenance: Wall vent blocked in cell # 7, 9, and 10
50. 6th Floor	Meeting Room and Dining Hall		105 CMR 451.353*	Interior Maintenance: White substance observed on floor under sink
51. 6th Floor	Meeting Room and Dining Hall		105 CMR 451.360*	Protective Measures: Rodent droppings observed on windowsills and floor
52. 6th Floor	Unit 1-6-1	Upper Cells	105 CMR 451.353	Interior Maintenance: Wall vent blocked in cell # 20, 22, 23, 24, 27, 28, 30, 31, and 32
53. 6th Floor	Unit 1-6-1	Lower Cells	105 CMR 451.353	Interior Maintenance: Wall vent blocked in cell # 2, 5, 7, 8, 9, 12, and 15
54. 6th Floor	Unit 1-6-1	Lower Laundry Area	105 CMR 451.360	Protective Measures: Rodent droppings observed
55. 6th Floor	Unit 1-6-2	Common Area	105 CMR 451.353	Interior Maintenance: Ceiling vent dust near Recreation Deck
56. 6th Floor	Unit 1-6-2	Common Area	105 CMR 451.353	Interior Maintenance: Window sill dirty near Recreation Deck
57. 6th Floor	Unit 1-6-2	Office	105 CMR 451.353	Interior Maintenance: Ceiling paint damaged
58. 6th Floor	Unit 1-6-2	Upper Storage Closet # 757	105 CMR 451.360*	Protective Measures: Rodent droppings observed
59. 6th Floor	Unit 1-6-2	Upper Cells	105 CMR 451.353	Interior Maintenance: Wall vent blocked in cell # 17, 20, 25, 31, and 32
60. 6th Floor	Unit 1-6-2	Upper Cells	105 CMR 451.353	Interior Maintenance: Ceiling paint damaged in cell # 35
61. 6th Floor	Unit 1-6-2	Lower Cells	105 CMR 451.353	Interior Maintenance: Ceiling paint damaged in cell # 3
62. 6th Floor	Unit 1-6-2	Lower Cells	105 CMR 451.353	Interior Maintenance: Wall vent blocked in cell # 3, 9, 11, and 16
63. 6th Floor	Unit 1-6-2	Slop Sink Closet	105 CMR 451.353	Interior Maintenance: Objectionable odor observed

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
64. 5th Floor	Unit 1-5-1	Common Area	105 CMR 451.353	Interior Maintenance: Ceiling vent dusty near Recreation Deck
65. 5th Floor	Unit 1-5-1	Utility Closet # 540	105 CMR 451.353	Interior Maintenance: Wet mop stored upside down
66. 5th Floor	Unit 1-5-1	Utility Closet # 540	105 CMR 451.353	Interior Maintenance: Wet mop stored on floor
67. 5th Floor	Unit 1-5-1	Utility Closet # 540	105 CMR 451.353	Interior Maintenance: Standing water stored in bucket
68. 5th Floor	Unit 1-5-1	Cells	105 CMR 451.353	Interior Maintenance: Wall vent blocked in cell # 5, 6, 7, 9, 10, 11, 12, 13, 14, 15, and 16
69. 5th Floor	Unit 1-5-1	Cells	105 CMR 451.353	Interior Maintenance: Ceiling paint damaged in cell # 8
70. 4th Floor	Unit 1-4-1	Cells	105 CMR 451.353*	Interior Maintenance: Wall vent blocked in cell # 4, 6, and 7
71. 4th Floor	Unit 1-4-1	Cells	105 CMR 451.353	Interior Maintenance: Wall vent blocked in cell # 2, 3, 5, 8, 10, 11, 12, 13, 15, and 16
72. 4th Floor	Unit 1-4-2	Common Area	105 CMR 451.353	Interior Maintenance: Ceiling vent dusty near Recreation Deck
73. 4th Floor	Unit 1-4-2	Kitchenette	105 CMR 451.360	Protective Measures: Rodent droppings observed below handwash sink
74. 4th Floor	Unit 1-4-2	Kitchenette	105 CMR 451.353	Interior Maintenance: Cabinet under handwash sink dirty
75. 4th Floor	Unit 1-4-2	Cells	105 CMR 451.353*	Interior Maintenance: Wall vent blocked in cell # 1
76. 4th Floor	Unit 1-4-2	Cells	105 CMR 451.353	Interior Maintenance: Wall vent blocked in cell # 2, 6, 7, 9, 15, and 16
77. 4th Floor	Unit 1-4-2	Cells	105 CMR 451.353	Interior Maintenance: Bed not secure to wall in cell # 2
78. 3rd Floor	Supervisor's Office		105 CMR 451.353	Interior Maintenance: Ceiling vent blocked
79. 3rd Floor	Office # 347		105 CMR 451.353	Interior Maintenance: Ceiling vent blocked
80. 3rd Floor	Office # 347		105 CMR 451.353	Interior Maintenance: Ceiling vent dusty
81. 3rd Floor	Unit 1-3-1	Storage Room # 336	105 CMR 451.360	Protective Measures: Rodent droppings observed
82. 3rd Floor	Unit 1-3-1	Cells	105 CMR 451.353*	Interior Maintenance: Wall vent blocked in cell # 3, 4, 5, 11, and 12
83. 3rd Floor	Unit 1-3-1	Cells	105 CMR 451.353	Interior Maintenance: Wall vent blocked in cell # 1, 2, 6, 7, 8, and 10
84. 3rd Floor	Unit 1-3-1	Recreation Room	105 CMR 451.353	Interior Maintenance: Trash observed on floor
85. 3rd Floor	Unit 1-3-1	Recreation Deck	105 CMR 451.353	Interior Maintenance: Trash observed on floor
86. 3rd Floor	Unit 1-3-1	Recreation Deck	105 CMR 451.353	Interior Maintenance: Ceiling paint damaged
87. 3rd Floor	Unit 1-3-1	Recreation Deck	105 CMR 451.353	Interior Maintenance: Wall paint damaged
88. 3rd Floor	Unit 1-3-2	Recreation Room # 368	105 CMR 451.353	Interior Maintenance: Ceiling dusty outside room
89. 3rd Floor	Unit 1-3-2	Recreation Room # 368	105 CMR 451.353	Interior Maintenance: Light switch cover missing

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
90. 3rd Floor	Unit 1-3-2	Recreation Room # 368	105 CMR 451.353	Interior Maintenance: Walls dirty
91. 3rd Floor	Unit 1-3-2	Recreation Room # 368	105 CMR 451.353	Interior Maintenance: Trash observed on floor
92. 3rd Floor	Unit 1-3-2	Recreation Room # 368	105 CMR 451.353	Interior Maintenance: Ceiling vent dusty
93. 3rd Floor	Unit 1-3-2	Recreation Room # 368	105 CMR 451.346	Safe Wiring: Inappropriate use of temporary wiring, extension cord through door
94. 3rd Floor	Unit 1-3-2	Kitchenette	105 CMR 451.353	Interior Maintenance: Wall vent dusty near Kitchenette
95. 3rd Floor	Unit 1-3-2	Kitchenette	105 CMR 451.360	Protective Measures: Rodent droppings observed under handwash sink
96. 3rd Floor	Unit 1-3-2	Kitchenette	105 CMR 451.360	Protective Measures: Cabinet under handwash sink dirty
97. 3rd Floor	Unit 1-3-2	Cells	105 CMR 451.353*	Interior Maintenance: Wall vent blocked in cell # 1, 2, 4, 6, 7, and 8
98. 3rd Floor	Unit 1-3-2	Cells	105 CMR 451.353	Interior Maintenance: Wall vent blocked in cell # 3, 5, 8, 9, 10, 12, and 15
99. 3rd Floor	Unit 1-3-2	Cells	105 CMR 451.353	Interior Maintenance: Ceiling paint damaged in cell # 1, 2, 3, 4, 5, 7, 8, 10, and 12
100. 3rd Floor	Unit 1-3-2	Cells	105 CMR 451.353	Interior Maintenance: Door dirty at cell # 8
101. 2nd Floor			105 CMR 451.353	Interior Maintenance: Ceiling tiles water damaged in hallway
102. 2nd Floor			105 CMR 451.353	Interior Maintenance: Ceiling vent dusty in Room # 257
103. 2nd Floor	Mosque # 269		105 CMR 451.353*	Interior Maintenance: Ceiling damaged
104. 2nd Floor	Mosque # 269		105 CMR 451.353*	Interior Maintenance: Mold on ceiling
105. 2nd Floor	Unit 1-2-1	Common Area	105 CMR 451.353*	Interior Maintenance: Ceiling water damaged
106. 2nd Floor	Unit 1-2-1	Slop Sink Room # 229	105 CMR 451.353	Interior Maintenance: Wet mop stored upside down
107. 2nd Floor	Unit 1-2-1	Slop Sink Room # 229	105 CMR 451.360	Protective Measures: Rodent droppings observed
108. 2nd Floor	Unit 1-2-1	Closet # 236	105 CMR 451.360	Protective Measures: Rodent droppings observed
109. 2nd Floor	Unit 1-2-1	Cells	105 CMR 451.353*	Interior Maintenance: Ceiling damaged in cell # 28 and 30
110. 2nd Floor	Unit 1-2-1	Cells	105 CMR 451.353*	Interior Maintenance: Ceiling vent blocked in cell # 21, 28, and 29
111. 2nd Floor	Unit 1-2-1	Cells	105 CMR 451.353*	Interior Maintenance: Mold on ceiling in cell # 28
112. 2nd Floor	Unit 1-2-1	Cells	105 CMR 451.353	Interior Maintenance: Ceiling paint damaged in cell # 14 and 16
113. 2nd Floor	Unit 1-2-1	Cells	105 CMR 451.353	Interior Maintenance: Ceiling vent blocked in cell # 22, 23, 24, 25, 26, 27, 30, and 31
114. 2nd Floor	Unit 1-2-1	Cells	105 CMR 451.353	Interior Maintenance: Door window cracked in cell # 30
115. 2nd Floor	Unit 1-2-1	Laundry Room	105 CMR 451.353	Interior Maintenance: Ceiling paint damaged

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
116. 1st Floor	Re-Entry Center	Staff Bathroom # 121	105 CMR 451.353	Interior Maintenance: Ceiling damaged

Building #2

Deficiencies under the Required Standards (.100 and .200 series)

1 new deficiency was found during the inspection:

Area	Regulation	Description of Deficiency
1. Staff Lounge	105 CMR 451.200	Food Storage, Preparation and Service: Food storage not in compliance with 105 CMR 590.000, interior of freezer dirty

Building #3

Deficiencies under the Required Standards (.100 and .200 series)

42 new deficiencies and 38 repeat deficiencies (indicated by an *) were found during the inspection:

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
1. 4th Floor	Staff Bathroom		105 CMR 451.123	Maintenance: Ceiling vent dusty
2. 4th Floor	Unit 3-3	Staff Bathroom	105 CMR 451.123	Maintenance: Ceiling vent dusty
3. 4th Floor	Unit 3-3	Lower Shower Area	105 CMR 451.123*	Maintenance: Ceiling vent dusty in shower # 1, 2, 3, 4, and 5
4. 4th Floor	Unit 3-3	Lower Shower Area	105 CMR 451.123*	Maintenance: Ceiling paint damaged in shower # 2
5. 4th Floor	Unit 3-3	Lower Shower Area	105 CMR 451.123*	Maintenance: Ceiling damaged outside showers
6. 4th Floor	Unit 3-3	Lower Shower Area	105 CMR 451.123*	Maintenance: Door frame rusted in shower # 4 and 5
7. 4th Floor	Unit 3-3	Lower Shower Area	105 CMR 451.123*	Maintenance: Mold on ceiling in shower # 5
8. 4th Floor	Unit 3-3	Lower Shower Area	105 CMR 451.123*	Maintenance: Bottom of door frame separating from wall outside shower # 5
9. 4th Floor	Unit 3-3	Lower Shower Area	105 CMR 451.123*	Maintenance: Access panel rusted in shower # 5
10. 4th Floor	Unit 3-3	Lower Shower Area	105 CMR 451.123*	Maintenance: Walls dirty in shower # 5
11. 4th Floor	Unit 3-3	Lower Shower Area	105 CMR 451.123	Maintenance: Drain flies observed in shower # 1
12. 4th Floor	Unit 3-3	Lower Shower Area	105 CMR 451.123	Maintenance: Door frame rusted in shower # 1 and 3
13. 4th Floor	Unit 3-3	Lower Shower Area	105 CMR 451.123	Maintenance: Door frame damaged in shower # 4
14. 4th Floor	Unit 3-3	Lower Shower Area	105 CMR 451.123	Maintenance: Dead drain flies observed on ceiling in shower # 5
15. 4th Floor	Unit 3-3	Kitchenette	105 CMR 451.200	Food Storage, Preparation and Service: Food preparation not in compliance with 105 CMR 590.000, interior of microwave oven dirty

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
16. 4th Floor	Unit 3-3	Upper Shower Area	105 CMR 451.123*	Maintenance: Ceiling vent dusty in shower # 6 and 10
17. 4th Floor	Unit 3-3	Upper Shower Area	105 CMR 451.123*	Maintenance: Ceiling paint damaged in shower # 10
18. 4th Floor	Unit 3-3	Upper Shower Area	105 CMR 451.123*	Maintenance: Door frame paint damaged in shower # 6
19. 4th Floor	Unit 3-3	Upper Shower Area	105 CMR 451.123*	Maintenance: Access panel rusted in shower # 10
20. 4th Floor	Unit 3-3	Upper Shower Area	105 CMR 451.123*	Maintenance: Walls dirty in shower # 10
21. 4th Floor	Unit 3-3	Upper Shower Area	105 CMR 451.123*	Maintenance: Metal brackets rusted in shower # 10
22. 4th Floor	Unit 3-3	Upper Shower Area	105 CMR 451.123*	Maintenance: Metal brackets rusted in shower # 10
23. 4th Floor	Unit 3-3	Upper Shower Area	105 CMR 451.123	Maintenance: Mold on ceiling in shower # 6 and 10
24. 4th Floor	Unit 3-3	Upper Shower Area	105 CMR 451.123	Maintenance: Ceiling vent dusty in shower # 8
25. 4th Floor	Unit 3-3	Slop Sink Room	105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, drain cover missing at slop sink
26. 4th Floor	Unit 3-4	Handicapped Shower # 3491	105 CMR 451.123*	Maintenance: Wall vent dusty outside shower
27. 4th Floor	Unit 3-4	Handicapped Shower # 3491	105 CMR 451.123	Maintenance: Ceiling vent dusty
28. 4th Floor	Unit 3-4	Staff Bathroom # 3494	105 CMR 451.123	Maintenance: Ceiling vent dusty
29. 4th Floor	Unit 3-4	Lower Shower Area	105 CMR 451.123*	Maintenance: Ceiling vent dusty in shower # 2, 3, and 4
30. 4th Floor	Unit 3-4	Lower Shower Area	105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, shower # 1 and 5 out-of-order
31. 4th Floor	Unit 3-4	Lower Shower Area	105 CMR 451.130	Hot Water: Shower water temperature 90°F at shower # 2
32. 4th Floor	Unit 3-4	Upper Shower Area	105 CMR 451.123*	Maintenance: Ceiling vent dusty in shower # 6 and 10
33. 4th Floor	Unit 3-4	Upper Shower Area	105 CMR 451.123*	Maintenance: Walls dirty in shower # 7
34. 4th Floor	Unit 3-4	Upper Shower Area	105 CMR 451.123*	Maintenance: Floor damaged around drain in shower # 10
35. 4th Floor	Unit 3-4	Upper Shower Area	105 CMR 451.123	Maintenance: No curtain at shower # 6
36. 4th Floor	Unit 3-4	Upper Shower Area	105 CMR 451.123	Maintenance: Ceiling vent dusty in shower # 7
37. 4th Floor	Unit 3-4	Upper Shower Area	105 CMR 451.123	Maintenance: Mold on wall in shower # 7
38. 4th Floor	Unit 3-4	Upper Shower Area	105 CMR 451.123	Maintenance: Wall paint damaged in shower # 7
39. 4th Floor	Unit 3-4	Upper Shower Area	105 CMR 451.123	Maintenance: Ceiling paint damaged in shower # 9
40. 4th Floor	Unit 3-4	Cells	105 CMR 451.103	Mattresses: Mattress cover missing in cell # 22 and 56

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
41. 4th Floor	Unit 3-4	Cells	105 CMR 451.101	Blankets: Blanket damaged in cell # 39
42. 3rd Floor	Staff Bathroom # 3378		105 CMR 451.123	Maintenance: Ceiling vent dusty
43. 2nd Floor	Unit 3-1	Lower Shower Area	105 CMR 451.123	Maintenance: Door frame rusted in shower # 5
44. 2nd Floor	Unit 3-1	Cells	105 CMR 451.103	Mattresses: Mattress cover missing in cell # 41
45. 2nd Floor	Unit 3-2	Handicapped Shower # 3293	105 CMR 451.123	Maintenance: Debris in floor drain
46. 2nd Floor	Unit 3-2	Lower Shower Area	105 CMR 451.123*	Maintenance: Ceiling paint damaged in shower # 4
47. 2nd Floor	Unit 3-2	Lower Shower Area	105 CMR 451.123*	Maintenance: Floor damaged around drain in shower # 5
48. 2nd Floor	Unit 3-2	Lower Shower Area	105 CMR 451.123*	Maintenance: Walls dirty in shower # 4
49. 2nd Floor	Unit 3-2	Lower Shower Area	105 CMR 451.123*	Maintenance: Ceiling vent dusty in shower # 1
50. 2nd Floor	Unit 3-2	Lower Shower Area	105 CMR 451.123*	Maintenance: Dead drain flies observed on ceiling in shower # 4
51. 2nd Floor	Unit 3-2	Lower Shower Area	105 CMR 451.123*	Maintenance: Door frame rusted in shower # 4
52. 2nd Floor	Unit 3-2	Lower Shower Area	105 CMR 451.123	Maintenance: Objectionable odor observed in shower # 2 and 5
53. 2nd Floor	Unit 3-2	Kitchenette	105 CMR 451.200*	Food Storage, Preparation and Service: Food preparation not in compliance with 105 CMR 590.000, interior of microwave oven # 1 dirty
54. 2nd Floor	Unit 3-2	Kitchenette	105 CMR 451.200	Food Storage, Preparation and Service: Food preparation not in compliance with 105 CMR 590.000, interior of microwave oven # 2 dirty
55. 2nd Floor	Unit 3-2	Kitchenette	105 CMR 451.200	Food Storage, Preparation and Service: Food preparation not in compliance with 105 CMR 590.000, handle missing on microwave oven # 2
56. 2nd Floor	Unit 3-2	Upper Shower Area	105 CMR 451.123*	Maintenance: Dead drain flies observed on ceiling in shower # 10
57. 2nd Floor	Unit 3-2	Upper Shower Area	105 CMR 451.123	Maintenance: Dead drain flies observed on ceiling in shower # 7
58. 2nd Floor	Unit 3-2	Upper Shower Area	105 CMR 451.123*	Maintenance: Walls dirty in shower # 7
59. 2nd Floor	Unit 3-2	Cells	105 CMR 451.103	Mattresses: Mattress damaged in cell # 22
60. 2nd Floor	Unit 3-2	Cells	105 CMR 451.103	Mattresses: Mattress cover missing in cell # 38, 45, and 54

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
61. 1st Floor	Education Area	Inmate Bathroom # 3162	105 CMR 451.123	Maintenance: Ceiling paint damaged
62. 1st Floor	Education Area	Inmate Bathroom # 3162	105 CMR 451.123	Maintenance: Floor paint damaged
63. 1st Floor	Education Area	Inmate Bathroom # 3162	105 CMR 451.123	Maintenance: Standing water on floor
64. 1st Floor	Canteen	Canteen Bathroom	105 CMR 451.123	Maintenance: Ceiling vent dusty

Deficiencies under the Recommended Standards (.300 series)

93 new deficiencies and 47 repeat deficiencies (indicated by an *) were found during the inspection:

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
1. All Cells			105 CMR 451.320*	Cell Size: Inadequate floor space in all cells
2. 4th Floor	Unit 3-3	Common Area	105 CMR 451.353*	Interior Maintenance: Wall damaged near stairs near cell # 13
3. 4th Floor	Unit 3-3	Case Worker's Office	105 CMR 451.353	Interior Maintenance: Ceiling vent blocked
4. 4th Floor	Unit 3-3	Case Worker's Office	105 CMR 451.353	Interior Maintenance: Ceiling vent dusty
5. 4th Floor	Unit 3-3	Lower Laundry Area	105 CMR 451.353	Interior Maintenance: Dryer vent not properly connected
6. 4th Floor	Unit 3-3	Kitchenette	105 CMR 451.353	Interior Maintenance: Ceiling beam damaged near Kitchenette
7. 4th Floor	Unit 3-3	Upper Laundry Area	105 CMR 451.360*	Protective Measures: Rodent droppings observed
8. 4th Floor	Unit 3-3	Slop Sink Room	105 CMR 451.360*	Protective Measures: Rodent droppings observed
9. 4th Floor	Unit 3-3	Slop Sink Room	105 CMR 451.353*	Interior Maintenance: Ceiling vent dusty
10. 4th Floor	Unit 3-3	Uniform Storage Room # 3566	105 CMR 451.360	Protective Measures: Rodent droppings observed
11. 4th Floor	Unit 3-3	Cells	105 CMR 451.353*	Interior Maintenance: Wall vent blocked in cell # 20, 22, 28, 30, 34, 35, 37, 46, 48, 61, 62, and 63
12. 4th Floor	Unit 3-3	Cells	105 CMR 451.353*	Interior Maintenance: Ceiling paint damaged in cell # 10, 40, and 43
13. 4th Floor	Unit 3-3	Cells	105 CMR 451.353	Interior Maintenance: Food debris in window sill near cell # 60
14. 4th Floor	Unit 3-3	Cells	105 CMR 451.353	Interior Maintenance: Wall dirty near cell # 16 and 28
15. 4th Floor	Unit 3-3	Cells	105 CMR 451.353	Interior Maintenance: Ceiling paint damaged in cell # 15, 29, 34, 37, 38, 39, 42, 45, 46, 49, 61, and 63
16. 4th Floor	Unit 3-3	Cells	105 CMR 451.353	Interior Maintenance: Wall vent blocked in cell # 24, 33, 34, 41, 47, 49, 51, 52, 55, 59, and 64

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
17. 4th Floor	Unit 3-3	Cells	105 CMR 451.360	Protective Measures: Rodent droppings observed on window sill near cell # 28
18. 4th Floor	Unit 3-4	Common Area	105 CMR 451.353*	Interior Maintenance: Floor tiles missing and damaged
19. 4th Floor	Unit 3-4	Recreation Deck	105 CMR 451.353*	Interior Maintenance: Wall paint damaged
20. 4th Floor	Unit 3-4	Recreation Deck	105 CMR 451.350	Structural Maintenance: Wall panels rotted on Recreation Deck
21. 4th Floor	Unit 3-4	Closet # 3492	105 CMR 451.353	Interior Maintenance: Floor dirty
22. 4th Floor	Unit 3-4	Lower Laundry Area	105 CMR 451.353	Interior Maintenance: Dryer vent not connected properly
23. 4th Floor	Unit 3-4	Uniform Storage # 3581	105 CMR 451.360*	Protective Measures: Rodent droppings observed
24. 4th Floor	Unit 3-4	Uniform Storage # 3581	105 CMR 451.344	Illumination in Habitable Areas: Light(s) not functioning properly, light out
25. 4th Floor	Unit 3-4	Cells	105 CMR 451.353*	Interior Maintenance: Wall vent blocked in cell # 3, 17, 21, 22, 26, 27, 43, and 51
26. 4th Floor	Unit 3-4	Cells	105 CMR 451.353*	Interior Maintenance: Ceiling paint damaged in cell # 8, 10, 11, 13, 15, 28, 43, 45, and 60
27. 4th Floor	Unit 3-4	Cells	105 CMR 451.353	Interior Maintenance: Wall vent blocked in cell # 7, 13, 14, 16, 19, and 46
28. 4th Floor	Unit 3-4	Cells	105 CMR 451.353	Interior Maintenance: Wall paint damaged in cell # 4, 40, 58, and 59
29. 4th Floor	Unit 3-4	Cells	105 CMR 451.353	Interior Maintenance: Ceiling paint damaged in cell # 21, 23, 30, and 64
30. 2nd Floor	Unit 3-1	Case Worker's Office # 3269	105 CMR 451.353	Interior Maintenance: Ceiling vent dusty
31. 2nd Floor	Unit 3-1	Kitchenette	105 CMR 451.353	Interior Maintenance: Floor dirty under handwash sink
32. 2nd Floor	Unit 3-1	Common Area	105 CMR 451.353	Interior Maintenance: Floor dirty in mechanical room between cell # 5 and 6
33. 2nd Floor	Unit 3-1	Common Area	105 CMR 451.360	Protective Measures: Rodent droppings observed on floor in mechanical room between cell # 5 and 6
34. 2nd Floor	Unit 3-1	Cells	105 CMR 451.353*	Interior Maintenance: Wall vent blocked in cell # 62
35. 2nd Floor	Unit 3-1	Cells	105 CMR 451.353	Interior Maintenance: Wall vent blocked in cell # 2, 4, 5, 14, 22, 33, 40, 43, 58, and 59
36. 2nd Floor	Unit 3-1	Cells	105 CMR 451.344	Illumination in Habitable Areas: Light(s) not functioning properly, light out in cell # 19

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
37. 2nd Floor	Unit 3-1	Cells	105 CMR 451.353	Interior Maintenance: Ceiling paint damaged in cell # 2, 15, 47, and 58
38. 2nd Floor	Unit 3-2	Storage Closet # 3294	105 CMR 451.353	Interior Maintenance: Standing water stored in mop bucket
39. 2nd Floor	Unit 3-2	Upper Laundry Area	105 CMR 451.360	Protective Measures: Rodent droppings observed
40. 2nd Floor	Unit 3-2	Cells	105 CMR 451.353*	Interior Maintenance: Ceiling paint damaged in cell # 21 and 35
41. 2nd Floor	Unit 3-2	Cells	105 CMR 451.353*	Interior Maintenance: Wall vent blocked in cell # 27
42. 2nd Floor	Unit 3-2	Cells	105 CMR 451.353	Interior Maintenance: Ceiling paint damaged in cell # 4, 8, 16, 25, 33, 36, 46, and 49
43. 2nd Floor	Unit 3-2	Cells	105 CMR 451.353	Interior Maintenance: Wall vent blocked in cell # 8, 10, 11, 16, 20, 24, 55, and 62
44. 2nd Floor	Unit 3-2	Cells	105 CMR 451.353	Interior Maintenance: Wall paint damaged in cell # 15 and 25
45. 2nd Floor	Unit 3-2	Cells	105 CMR 451.353	Interior Maintenance: Ceiling water damaged in cell # 56
46. 1st Floor	Education Area		105 CMR 451.353	Interior Maintenance: Ceiling water damaged throughout
47. 1st Floor	Education Area	Classrooms	105 CMR 451.353*	Interior Maintenance: Mold on ceiling outside of Room # 3132
48. 1st Floor	MAT Outside Classroom		105 CMR 451.350*	Structural Maintenance: Ceiling tiles missing and water damaged
49. 1st Floor	Canteen		105 CMR 451.350*	Structural Maintenance: Ceiling tiles missing and water damaged
50. 1st Floor	Main Laundry	Hallway	105 CMR 451.353	Interior Maintenance: Area around ceiling vent dusty

Building #4

Deficiencies under the Required Standards (.100 and .200 series)

47 new deficiencies and 13 repeat deficiencies (indicated by an *) were found during the inspection:

Area	Sub Area # 1	Regulation	Description of Deficiency
1. Unit 4-1	Common Area	105 CMR 451.200	Food Storage, Preparation and Service: Food preparation not in compliance with 105 CMR 590.000, interior of microwave oven dirty near telephones and cell # 5
2. Unit 4-1	Lower Shower Area	105 CMR 451.123	Maintenance: Ceiling vent dusty in shower # 1
3. Unit 4-1	Lower Shower Area	105 CMR 451.123	Maintenance: Drain flies observed in shower # 2 and 3
4. Unit 4-1	Lower Shower Area	105 CMR 451.123	Maintenance: No curtain at shower # 4
5. Unit 4-1	Lower Shower Area	105 CMR 451.123	Maintenance: Debris in drain in shower # 5
6. Unit 4-1	Upper Shower Area	105 CMR 451.123*	Maintenance: Walls dirty in shower # 7, 8, 9, and 12
7. Unit 4-1	Upper Shower Area	105 CMR 451.123*	Maintenance: Ceiling vent dusty in shower # 8
8. Unit 4-1	Upper Shower Area	105 CMR 451.123	Maintenance: Walls dirty in shower # 10
9. Unit 4-1	Upper Shower Area	105 CMR 451.123	Maintenance: Ceiling vent dusty in shower # 7

Area	Sub Area # 1	Regulation	Description of Deficiency
10. Unit 4-1	Upper Shower Area	105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, shower # 9 leaking
11. Unit 4-1	Cells	105 CMR 451.103	Mattresses: Mattress cover missing in cell # 20
12. Unit 4-2	Kitchenette	105 CMR 451.200	Food Storage, Preparation and Service: Food preparation not in compliance with 105 CMR 590.000, interior of microwave oven dirty
13. Unit 4-2	1st Tier Bathroom # 4257 and 4268	105 CMR 451.123	Maintenance: Ceiling vent dusty
14. Unit 4-2	1st Tier Bathroom # 4257 and 4268	105 CMR 451.123	Maintenance: Drain flies observed
15. Unit 4-2	1st Tier Bathroom # 4257 and 4268	105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, handwash sink # 1 out-of-order
16. Unit 4-2	1st Tier Bathroom # 4257 and 4268	105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, urinal # 1 out-of-order
17. Unit 4-2	1st Tier Bathroom # 4257 and 4268	105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, toilet # 5 out-of-order
18. Unit 4-2	1st Tier Bathroom # 4257 and 4268	105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, handwash sink # 7 leaking
19. Unit 4-2	1st Tier Bathroom # 4257 and 4268	105 CMR 451.123	Maintenance: Standing water observed on floor
20. Unit 4-2	1st Tier Bathroom # 4285 and 4275	105 CMR 451.130*	Plumbing: Plumbing not maintained in good repair, toilet # 1 out-of-order
21. Unit 4-2	1st Tier Bathroom # 4285 and 4275	105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, toilet # 2 out-of-order
22. Unit 4-2	2nd Tier Bathroom # 4366 and 4354	105 CMR 451.123	Maintenance: Floor dirty
23. Unit 4-2	2nd Tier Bathroom # 4366 and 4354	105 CMR 451.123	Maintenance: Dead insects observed on floor
24. Unit 4-2	2nd Tier Bathroom # 4374 and 4387	105 CMR 451.117	Toilet Fixtures: Toilet fixtures dirty in stall # 1, 2, and 4
25. Unit 4-2	2nd Tier Bathroom # 4374 and 4387	105 CMR 451.117	Toilet Fixtures: Urinal # 3 dirty
26. Unit 4-2	2nd Tier Bathroom # 4374 and 4387	105 CMR 451.123	Maintenance: Floor dirty
27. Unit 4-3	Common Area	105 CMR 451.200	Food Storage, Preparation and Service: Food preparation not in compliance with 105 CMR 590.000, interior of microwave oven dirty near cell # 5 and 8
28. Unit 4-3	Lower Shower Area	105 CMR 451.123*	Maintenance: Walls dirty in shower # 1, 2, and 3
29. Unit 4-3	Lower Shower Area	105 CMR 451.123*	Maintenance: Ceiling vent dusty in shower # 1, 2, and 3
30. Unit 4-3	Lower Shower Area	105 CMR 451.123	Maintenance: Drain flies observed in shower # 1, 5, and 6
31. Unit 4-3	Lower Shower Area	105 CMR 451.123	Maintenance: Door frame rusted in shower # 1, 2, 3, 4, and 5
32. Unit 4-3	Lower Shower Area	105 CMR 451.123	Maintenance: Curtain dirty in shower # 2 and 4
33. Unit 4-3	Lower Shower Area	105 CMR 451.123	Maintenance: Ceiling vent dusty in shower # 6
34. Unit 4-3	Upper Shower Area	105 CMR 451.123*	Maintenance: Ceiling vent dusty in shower # 8
35. Unit 4-3	Upper Shower Area	105 CMR 451.123	Maintenance: Ceiling vent dusty in shower # 7, 9, 10, and 11
36. Unit 4-3	Upper Shower Area	105 CMR 451.123	Maintenance: Walls dirty in shower # 8 and 11

Area	Sub Area # 1	Regulation	Description of Deficiency
37. Unit 4-3	Upper Shower Area	105 CMR 451.123	Maintenance: Drain flies observed in shower # 12
38. Unit 4-3	Upper Shower Area	105 CMR 451.123	Maintenance: Dead drain flies observed on ceiling in shower # 12

Deficiencies under the Recommended Standards (.300 series)

4 new deficiencies and 1 repeat deficiency (indicated by an *) were found during the inspection:

Area	Sub Area # 1	Regulation	Description of Deficiency
1. Dining Hall # 4137		105 CMR 451.353	Interior Maintenance: Wet mop stored in bucket
2. Unit 4-2	Common Area	105 CMR 451.353	Interior Maintenance: Ceiling vents dusty
3. Unit 4-2	Common Area	105 CMR 451.353	Interior Maintenance: Ceiling tiles dusty
4. Unit 4-2	Laundry Area	105 CMR 451.353	Interior Maintenance: Dryer vent not properly connected
5. Unit 4-2	2nd Tier Utility Room # 4388	105 CMR 451.360*	Protective Measures: Rodent droppings observed

Building #5

Deficiencies under the Required Standards (.100 and .200 series)

70 new deficiencies and 40 repeat deficiencies (indicated by an *) were found during the inspection:

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
1. Food Service Area	Section 1	Inmate Locker Room	105 CMR 451.123*	Maintenance: Soap dispenser damaged
2. Food Service Area	Section 1	Inmate Locker Room	105 CMR 451.123*	Maintenance: Floor paint damaged
3. Food Service Area	Section 1	Inmate Locker Room	105 CMR 451.123*	Maintenance: Ceiling dirty
4. Food Service Area	Section 1	Inmate Locker Room	105 CMR 451.123*	Maintenance: Insects observed
5. Food Service Area	Section 1	Inmate Locker Room	105 CMR 451.123*	Maintenance: Encrusted food debris on trash can
6. Food Service Area	Section 1	Slop Sink Room	105 CMR 451.200*	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Facility not cleaned as often as necessary, standing water observed. Standard found in 105 CMR 590; FC 6-501.12(A).
7. Food Service Area	Section 1	Slop Sink Room	105 CMR 451.200	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Wet mop stored in bucket. Standard found in 105 CMR 590; FC 6-501.16.
8. Food Service Area	Section 1	Slop Sink Room	105 CMR 451.200	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Standing water stored in mop bucket. Standard found in 105 CMR 590; FC 6-501.16.

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
9. Food Service Area	Section 1	Slop Sink Room	105 CMR 451.200	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Facility not cleaned as often as necessary, slop sink dirty. Standard found in 105 CMR 590; FC 6-501.12(A).
10. Food Service Area	Section 1	Chemical Storage	105 CMR 451.200*	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Premises not maintained free of rodents, rodent droppings observed. Standard found in 105 CMR 590; FC 6-501.111. ** Corrected On-Site **
11. Food Service Area	Section 1	Chemical Storage	105 CMR 451.200	Design, Construction, and Installation; Functionality: Outer openings not protected against the entry of insects and rodents, exterior door damaged. Standard found in 105 CMR 590; FC 6-202.15(A)(3).
12. Food Service Area	Section 1	Staff Bathroom	105 CMR 451.123	Maintenance: Ceiling vent dusty
13. Food Service Area	Section 1	Mechanical Warewashing Area	105 CMR 451.200*	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Facility not cleaned as often as necessary, mold on wall above single compartment sink. Standard found in 105 CMR 590; FC 6-501.12(A).
14. Food Service Area	Section 1	Mechanical Warewashing Area	105 CMR 451.200*	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Facility not cleaned as often as necessary, ceiling dirty. Standard found in 105 CMR 590; FC 6-501.12(A).
15. Food Service Area	Section 1	Mechanical Warewashing Area	105 CMR 451.200*	Maintenance and Operation, Equipment: Inadequate water temperature in the mechanical warewashing machine (Pf), temperature recorded at 153°F. Standard found in 105 CMR 590; FC 4-501.112(A)(2).

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
16. Food Service Area	Section 1	Mechanical Warewashing Area	105 CMR 451.200*	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Facility not cleaned as often as necessary, mold on ceiling. Standard found in 105 CMR 590; FC 6-501.12(A).
17. Food Service Area	Section 1	Mechanical Warewashing Area	105 CMR 451.200*	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Facility not cleaned as often as necessary, walls dirty. Standard found in 105 CMR 590; FC 6-501.12(A).
18. Food Service Area	Section 1	Mechanical Warewashing Area	105 CMR 451.200	Cleaning of Equipment and Utensils, Objective: Nonfood contact surfaces of equipment dirty, splash curtain dirty on warewash machine. Standard found in 105 CMR 590; FC 4-601.11(C).
19. Food Service Area	Section 1	Mechanical Warewashing Area	105 CMR 451.200	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Facility not in good repair, junction box cover missing. Standard found in 105 CMR 590; FC 6-501.11.
20. Food Service Area	Section 1	Mechanical Warewashing Area	105 CMR 451.200	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Facility not in good repair, outlet cover missing below wall fan. Standard found in 105 CMR 590; FC 6-501.11.
21. Food Service Area	Section 1	Mechanical Warewashing Area	105 CMR 451.200	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Facility not cleaned as often as necessary, wall mounted fan dusty. Standard found in 105 CMR 590; FC 6-501.12(A). ** Corrected On-Site **
22. Food Service Area	Section 1	Mechanical Warewashing Area	105 CMR 451.200	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Premises not maintained free of rodents, rodent droppings observed. Standard found in 105 CMR 590; FC 6-501.111.

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
23. Food Service Area	Section 1	Mechanical Warewashing Area	105 CMR 451.200	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Facility not cleaned as often as necessary, drying racks dirty. Standard found in 105 CMR 590; FC 6-501.12(A).
24. Food Service Area	Section 1	Mechanical Warewashing Area	105 CMR 451.200	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Premises not maintained free of insects, drain flies observed. Standard found in 105 CMR 590; FC 6-501.111.
25. Food Service Area	Section 1	Mechanical Warewashing Area	105 CMR 451.200	Maintenance and Operation; Equipment: Warewashing machine not operating in accordance with manufacturer's instructions, warewash machine leaking. Standard found in 105 CMR 590; FC 4-501.15(A).
26. Food Service Area	Section 1	Mechanical Warewashing Area	105 CMR 451.200	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Facility not cleaned as often as necessary, standing water observed. Standard found in 105 CMR 590; FC 6-501.12(A).
27. Food Service Area	Section 1	Mechanical Warewashing Area	105 CMR 451.200	Plumbing System; Operation and Maintenance: Plumbing system not maintained in good repair. pipe in ceiling leaking into single compartment sink. Standard found in 105 CMR 590; FC 5-205.15(B).
28. Food Service Area	Section 1	Pot Wash Area	105 CMR 451.200*	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Premises not maintained free of insects, drain flies observed. Standard found in 105 CMR 590; FC 6-501.111.
29. Food Service Area	Section 1	Pot Wash Area	105 CMR 451.200	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Facility not cleaned as often as necessary, signage hung on wall moldy. Standard found in 105 CMR 590; FC 6-501.12(A).

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
30. Food Service Area	Section 1	Pot Wash Area	105 CMR 451.200*	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Facility not in good repair, wall damaged. Standard found in 105 CMR 590; FC 6-501.11.
31. Food Service Area	Section 1	Pot Wash Area	105 CMR 451.200*	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Facility not cleaned as often as necessary, sprayer head dirty. Standard found in 105 CMR 590; FC 6-501.12(A).
32. Food Service Area	Section 1	Pot Wash Area	105 CMR 451.200*	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Non-functional equipment not repaired or removed from premises, garbage disposal out-of-order. Standard found in 105 CMR 590; FC 6-501.114(A).
33. Food Service Area	Section 1	Pot Wash Area	105 CMR 451.200*	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Facility not cleaned as often as necessary, standing water observed on floor. Standard found in 105 CMR 590; FC 6-501.12(A).
34. Food Service Area	Section 1	Pot Wash Area	105 CMR 451.200*	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Facility not cleaned as often as necessary, walls dirty. Standard found in 105 CMR 590; FC 6-501.12(A).
35. Food Service Area	Section 1	Pot Wash Area	105 CMR 451.200*	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Facility not cleaned as often as necessary, mold on walls. Standard found in 105 CMR 590; FC 6-501.12(A).
36. Food Service Area	Section 1	Pot Wash Area	105 CMR 451.200*	Design, Construction, and Installation; Cleanability: Floors not smooth and easily cleanable. floor damaged. Standard found in 105 CMR 590; FC 6-201.11.

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
37. Food Service Area	Section 1	Pot Wash Area	105 CMR 451.200	Plumbing System; Operation and Maintenance: Plumbing system not maintained in good repair, middle sink compartment leaking. Standard found in 105 CMR 590; FC 5-205.15(B).
38. Food Service Area	Section 1	Pot Wash Handwash Sink	105 CMR 451.200	Plumbing System; Operation and Maintenance: Plumbing system not maintained in good repair, handwash sink out-of-order. Standard found in 105 CMR 590; FC 5-205.15(B). ** Corrected On-Site **
39. Food Service Area	Section 1	Pot Wash Handwash Sink	105 CMR 451.200	Numbers and Capacity; Handwashing Sinks: No soap at handwash sink(Pf). Standard found in 105 CMR 590.000, FC 6-301.11. ** Corrected On-Site **
40. Food Service Area	Section 1	Tray Area Handwash Sink	105 CMR 451.200*	Plumbing System; Design, Construction and Installation: Insufficient hot water temperature at handwashing sinks (Pf), temperature recorded at 87°F. Standard found in 105 CMR 590; FC 5-202.12(A).
41. Food Service Area	Section 1	Tray Area Handwash Sink	105 CMR 451.200*	Plumbing System; Operations and Maintenance: Handwashing sink not accessible (Pf), cart stored in front of handwash sink. Standard found in 105 CMR 590; FC 5-205.11(A).
42. Food Service Area	Section 1	Tray Area Handwash Sink	105 CMR 451.200	Numbers and Capacity; Handwashing Sinks: No hand drying method available at handwashing sink (Pf). Standard found in 105 CMR 590; FC 6-301.12. ** Corrected On-Site **
43. Food Service Area	Section 1	Tray Area Handwash Sink	105 CMR 451.200	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Facility not in good repair, paper towel dispenser not working properly. Standard found in 105 CMR 590; FC 6-501.11.

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
44. Food Service Area	Section 2	Prep Table/Sink	105 CMR 451.200*	Maintenance and Operation; Equipment: Quaternary ammonium compound (QAC) solution lower than the manufacturers recommended concentration. Standard found in 105 CMR 590; FC 4-501.114(C)(2). ** Corrected On-Site **
45. Food Service Area	Section 2	Pot/Pan Storage Room	105 CMR 451.200*	Protection of Clean Items, Storing: Pots and pans not stored in a self-draining position, items stacked wet. Standard found in 105 CMR 590; FC 4-903.11(B)(1). ** Corrected On-Site **
46. Food Service Area	Section 2	Pot/Pan Storage Room	105 CMR 451.200*	Cleaning of Equipment and Utensils, Objective: Food contact surface dirty (Pf), pots and pans stored dirty. Standard found in 105 CMR 590; FC 4-601.11(A). ** Corrected On-Site **
47. Food Service Area	Section 2	Pot/Pan Storage Room	105 CMR 451.200*	Cleaning of Equipment and Utensils, Objective: Food contact surface dirty (Pf), trays stored greasy. Standard found in 105 CMR 590; FC 4-601.11(A). ** Corrected On-Site **
48. Food Service Area	Section 2	Pot/Pan Storage Room	105 CMR 451.200*	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Facility not cleaned as often as necessary, ceiling dirty. Standard found in 105 CMR 590; FC 6-501.12(A). ** Corrected On-Site **
49. Food Service Area	Section 2	Pot/Pan Storage Room	105 CMR 451.200*	Design, Construction, and Installation; Cleanability: Wall not easily cleanable, wall paint damaged. Standard found in 105 CMR 590; FC 6-201.16(A).
50. Food Service Area	Section 2	Pot/Pan Storage Room	105 CMR 451.200*	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Premises not maintained free of rodents, rodent droppings observed on floor. Standard found in 105 CMR 590; FC 6-501.111. ** Corrected On-Site **

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
51. Food Service Area	Section 2	Pot/Pan Storage Room	105 CMR 451.200	Cleaning of Equipment and Utensils, Objective: Food contact surface dirty (Pf), rodent droppings observed on pans. Standard found in 105 CMR 590; FC 4-601.11(A). ** Corrected On-Site **
52. Food Service Area	Section 2	Pot/Pan Storage Room	105 CMR 451.200	Cleaning of Equipment and Utensils, Objective: Food contact surface dirty (Pf), dry baskets stored greasy. Standard found in 105 CMR 590; FC 4-601.11(A).
53. Food Service Area	Section 2	Pot/Pan Storage Room	105 CMR 451.200	Protection from Contamination After Receiving; Preventing Contamination from Equipment, Utensils, and Linens: Grease from dry baskets dripping onto clean items. Standard found in 105 CMR 590; FC 3-304.12(B). ** Corrected On-Site **
54. Food Service Area	Section 3		105 CMR 451.200*	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Premises not maintained free of rodents, rodent droppings observed on rear of stove. Standard found in 105 CMR 590; FC 6-501.111. ** Corrected On-Site **
55. Food Service Area	Section 3		105 CMR 451.200	Maintenance and Operation; Equipment: Quaternary ammonium compound (QAC) solution lower than the manufacturers recommended concentration. Standard found in 105 CMR 590; FC 4-501.114(C)(2). ** Corrected On-Site **
56. Food Service Area	Section 4	Refrigerator # 1	105 CMR 451.200	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Facility not cleaned as often as necessary, ceiling dirty. Standard found in 105 CMR 590; FC 6-501.12(A).

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
57. Food Service Area	Section 4	Refrigerator # 2	105 CMR 451.200*	Protection from Contamination After Receiving; Preventing Contamination from Equipment, Utensils, and Linens: Utensil handle not stored above the food in the container, scoop observed in sugar and flour containers. Standard found in 105 CMR 590; FC 3-304.12(B). ** Corrected On-Site **
58. Food Service Area	Section 4	Refrigerator # 2	105 CMR 451.200	Preventing Contamination after Receiving; Preventing Food and Ingredient Contamination: Food not appropriately covered, breadcrumbs stored uncovered. Standard found in 105 CMR 590; FC 3-302.11(A)(4). ** Corrected On-Site **
59. Food Service Area	Section 4	Refrigerator # 2	105 CMR 451.200	Protection from Contamination After Receiving, Preventing Food and Ingredient Contamination: Food or food ingredients that have been removed from original packages not labeled with common name of food, bulk containers not labeled. Standard found in 105 CMR 590; FC 3-302.12. ** Corrected On-Site **
60. Food Service Area	Section 4	Refrigerator # 2	105 CMR 451.200	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Facility not cleaned as often as necessary, sugar and flour container dirty. Standard found in 105 CMR 590; FC 6-501.12(A). ** Corrected On-Site **
61. Food Service Area	Section 4	Refrigerator # 2	105 CMR 451.200	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Facility not cleaned as often as necessary, walls dirty. Standard found in 105 CMR 590; FC 6-501.12(A). ** Corrected On-Site **
62. Food Service Area	Section 4	Refrigerator # 2	105 CMR 451.200	Preventing Contamination from the Premises; Food Storage: Food exposed to splash, dust, or other contamination, fans in cooler dusty. Standard found in 105 CMR 590; FC 3-305.11(A)(2). ** Corrected On-Site **

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
63. Food Service Area	Section 4	Refrigerator # 2	105 CMR 451.200	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Facility not cleaned as often as necessary, spilled food debris on storage pallets. Standard found in 105 CMR 590; FC 6-501.12(A). ** Corrected On-Site **
64. Food Service Area	Section 4	Refrigerator # 2	105 CMR 451.200	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Facility not cleaned as often as necessary, produce storage rack dirty. Standard found in 105 CMR 590; FC 6-501.12(A). ** Corrected On-Site **
65. Food Service Area	Section 4	Refrigerator # 2	105 CMR 451.200	Characteristics; Condition: Food not safe, unadulterated, and honestly presented (Pf), rotten produce observed. Standard found in 105 CMR 590; FC 3-101.11. ** Corrected On-Site **
66. Food Service Area	Section 4	Freezer # 4	105 CMR 451.200*	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Facility not in good repair, threshold damaged. Standard found in 105 CMR 590; FC 6-501.11.
67. Food Service Area	Section 5	Diet Area	105 CMR 451.200*	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Facility not in good repair, pipe insulation damaged. Standard found in 105 CMR 590; FC 6-501.11.
68. Food Service Area	Section 5	Diet Area	105 CMR 451.200	Limitation of Growth of Organisms of Public Health Concern, Temperature and Time Control: Time/temperature control for safety food not held at 135°F or above (Pf), temperature of chicken recorded at 88°F. Standard found in 105 CMR 590; FC 3-501.16(A)(1). ** Corrected On-Site **

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
69. Food Service Area	Section 5		105 CMR 451.200	Limitation of Growth of Organisms of Public Health Concern, Temperature and Time Control: Time/temperature control for safety food not held at 135°F or above (Pf), temperature of rice recorded at 111°F. Standard found in 105 CMR 590; FC 3-501.16(A)(1). ** Corrected On-Site **
70. Food Service Area	Section 5	Diet Area	105 CMR 451.200	Maintenance and Operation, Equipment: Equipment not maintained in a state of good repair, available outlet not compatible with hot holding equipment. Standard found in 105 CMR 590; FC 4-501.11(A).
71. Food Service Area	Section 5	Diet Area	105 CMR 451.200	Maintenance and Operation, Equipment: Equipment components not maintained in a state of good repair, warmer gaskets dirty and damaged. Standard found in 105 CMR 590; FC 4-501.11(B).
72. Food Service Area	Section 5	Diet Area	105 CMR 451.200	Hygienic Practices Food Contamination Prevention: Food service personnel eating in an inappropriate area, employee food observed in diet area. Standard found in 105 CMR 590; FC 2-401.11(A). ** Corrected On-Site **
73. Food Service Area	Section 5	Diet Area	105 CMR 451.200	Preventing Contamination after Receiving; Preventing Food and Ingredient Contamination: Food not appropriately covered, peas stored uncovered. Standard found in 105 CMR 590; FC 3-302.11(A)(4). ** Corrected On-Site **
74. Food Service Area	Section 5	Diet Area	105 CMR 451.200	Protection of Clean Items, Storing: Food product stored in an inappropriate location, peas stored below damaged pipe. Standard found in 105 CMR 590; FC 4-903-12(A)(8). ** Corrected On-Site **

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
75. Food Service Area	Section 5	Dry Storage Area	105 CMR 451.200*	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Premises not maintained free of rodents, rodent droppings observed. Standard found in 105 CMR 590; FC 6-501.111. ** Corrected On-Site **
76. Food Service Area	Section 5	Dry Storage Area	105 CMR 451.200	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Facility not cleaned as often as necessary, spilled food observed on floor. Standard found in 105 CMR 590; FC 6-501.12(A). ** Corrected On-Site **
77. Food Service Area	Section 5	Loading Dock	105 CMR 451.200*	Design, Construction, and Installation; Functionality: Outer openings not protected against the entry of insects and rodents, garage door not rodent and weathertight. Standard found in 105 CMR 590; FC 6-202.15(A)(3).
78. Food Service Area	Section 6	Refrigerator # 6	105 CMR 451.200*	Maintenance and Operation, Equipment: Equipment components not maintained in a state of good repair, gaskets dirty. Standard found in 105 CMR 590; FC 4-501.11(B).
79. Food Service Area	Section 6	Refrigerator # 6	105 CMR 451.200*	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Premises not maintained free of rodents, rodent droppings observed. Standard found in 105 CMR 590; FC 6-501.111. ** Corrected On-Site **
80. Food Service Area	Section 6	Refrigerator # 6	105 CMR 451.200	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Facility not cleaned as often as necessary, ceiling dirty. Standard found in 105 CMR 590; FC 6-501.12(A).

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
81. Food Service Area	Section 6	Refrigerator # 6	105 CMR 451.200	Maintenance and Operation, Equipment: Equipment components not maintained in a state of good repair, fan cover not secure. Standard found in 105 CMR 590; FC 4-501.11(B). ** Corrected On-Site **
82. Food Service Area	Section 6	Refrigerator # 6	105 CMR 451.200	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Facility not cleaned as often as necessary, spilled food debris observed on floor. Standard found in 105 CMR 590; FC 6-501.12(A). ** Corrected On-Site **
83. Food Service Area	Section 6	2-Compartment Sink Area	105 CMR 451.200	Plumbing System; Operation and Maintenance: Plumbing system not maintained in good repair, left side sink out-of-order. Standard found in 105 CMR 590; FC 5-205.15(B).
84. Food Service Area	Section 6	2-Compartment Sink Area	105 CMR 451.200	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Premises not maintained free of insects, drain flies observed. Standard found in 105 CMR 590; FC 6-501.111.
85. Food Service Area	Section 6	2-Compartment Sink Area	105 CMR 451.200	Design, Construction, and Installation; Cleanability: Wall not easily cleanable, wall damaged. Standard found in 105 CMR 590; FC 6-201.16(A).
86. Food Service Area	Section 6	2-Compartment Sink Area	105 CMR 451.200	Plumbing System; Operations and Maintenance: Handwashing sink not accessible (Pf), carts stored in front of handwash sink. Standard found in 105 CMR 590; FC 5-205.11(A). ** Corrected On-Site **
87. Food Service Area	Section 6	Prep-Refrigerators and Tray Assembly Line	105 CMR 451.200*	Protection of Clean Items, Storing: Serving Trays not stored in a self-draining position. Standard found in 105 CMR 590; FC 4-903.11(B)(1).

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
88. Food Service Area	Section 6	Prep-Refrigerators and Tray Assembly Line	105 CMR 451.200*	Design, Construction, and Installation; Functionality: Outer openings not protected against the entry of insects and rodents, exterior door not rodent and weathertight. Standard found in 105 CMR 590; FC 6-202.15(A)(3).
89. Food Service Area	Section 6	Prep-Refrigerators and Tray Assembly Line	105 CMR 451.200*	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Facility not cleaned as often as necessary, vent dusty above warmers. Standard found in 105 CMR 590; FC 6-501.12(A).
90. Food Service Area	Section 6	Prep-Refrigerators and Tray Assembly Line	105 CMR 451.200	Cleaning of Equipment and Utensils, Objective: Food contact surface dirty (Pf). trays dirty. Standard found in 105 CMR 590; FC 4-601.11(A).
91. Food Service Area	Section 6	Prep-Refrigerators and Tray Assembly Line	105 CMR 451.200	Maintenance and Operation, Equipment: Equipment components not maintained in a state of good repair, warmer gaskets dirty. Standard found in 105 CMR 590; FC 4-501.11(B).
92. Food Service Area	Section 6	Prep-Refrigerators and Tray Assembly Line	105 CMR 451.200	Maintenance and Operation, Equipment: Equipment components not maintained in a state of good repair, cooler gaskets damaged. Standard found in 105 CMR 590; FC 4-501.11(B).
93. Food Service Area	Section 6	Prep-Refrigerators and Tray Assembly Line	105 CMR 451.200	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Premises not maintained free of rodents, rodent droppings observed. Standard found in 105 CMR 590; FC 6-501.111.
94. Food Service Area	Section 6	Prep-Refrigerators and Tray Assembly Line	105 CMR 451.200	Cleaning of Equipment and Utensils, Objective: Nonfood contact surfaces of equipment dirty, encrusted food debris on tray carts. Standard found in 105 CMR 590; FC 4-601.11(C).

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
95. Food Service Area	Section 6	Staff Food Line	105 CMR 451.200	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Facility not cleaned as often as necessary, floor dirty below staff line. Standard found in 105 CMR 590; FC 6-501.12(A). ** Corrected On-Site **
96. Food Service Area	Section 6	Staff Food Line	105 CMR 451.200	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Premises not maintained free of rodents, rodent droppings observed throughout area. Standard found in 105 CMR 590; FC 6-501.111. ** Corrected On-Site **
97. Food Service Area	Section 6	Staff Dining Room	105 CMR 451.200	Cleaning of Equipment and Utensils, Objective: Food contact surface dirty (Pf), hairnet used in coffee brewer. Standard found in 105 CMR 590; FC 4-601.11(A). ** Corrected On-Site **
98. Food Service Area	Section 6	Staff Dining Room	105 CMR 451.200	Protection of Clean Items, Storing: Single-Use Items not stored at least 6 inches above the floor. Standard found in 105 CMR 590; FC 4-903.11(A)(3). ** Corrected On-Site **
99. Food Service Area	Section 6	Staff Dining Room	105 CMR 451.200	Protection from Contamination After Receiving, Preventing Food and Ingredient Contamination: Food or food ingredients that have been removed from original packages not labeled with common name of food, sugar not labeled. Standard found in 105 CMR 590; FC 3-302.12.
100. Food Service Area	Section 6	Staff Dining Room	105 CMR 451.200	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Premises not maintained free of insects, fruit flies observed. Standard found in 105 CMR 590; FC 6-501.111.
101. Food Service Area	Section 6	Staff Food Line	105 CMR 451.200	Cleaning of Equipment and Utensils, Objective: Nonfood contact surfaces of equipment dirty, exterior of warmer dirty. Standard found in 105 CMR 590; FC 4-601.11(C). ** Corrected On-Site **

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
102. Food Service Area	Section 6	Staff Dining Room	105 CMR 451.200	Limitation of Growth of Organisms of Public Health Concern, Temperature and Time Control: Time/temperature control for safety food not held at 41°F or less (Pf), temperature of chicken recorded at 60°F at salad bar. Standard found in 105 CMR 590; FC 3-501.16(A)(2). ** Corrected On-Site **
103. Food Service Area	Section 6	Staff Dining Room	105 CMR 451.200	Protection from Contamination After Receiving, Preventing Food and Ingredient Contamination: Food or food ingredients that have been removed from original packages not labeled with common name of food, dressing not labeled at salad bar. Standard found in 105 CMR 590; FC 3-302.12. ** Corrected On-Site **
104. Food Service Area	Section 6	Staff Dining Room	105 CMR 451.200	Maintenance and Operation, Equipment: Equipment components not maintained in a state of good repair, refrigerator gaskets dirty and damaged. Standard found in 105 CMR 590; FC 4-501.11(B).
105. Food Service Area	Section 6	Staff Dining Room	105 CMR 451.200	Protection from Contamination After Receiving, Preventing Food and Ingredient Contamination: Food or food ingredients that have been removed from original packages not labeled with common name of food, several items not labeled in refrigerator. Standard found in 105 CMR 590; FC 3-302.12.
106. Food Service Area	Section 6	Staff Dining Room	105 CMR 451.200	Protection of Clean Items, Storing: Use Items not stored at least 6 inches above the floor. Standard found in 105 CMR 590; FC 4-903.11(A)(3). ** Corrected On-Site **
107. Food Service Area	Section 6	Staff Dining Room	105 CMR 451.200	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Facility not cleaned as often as necessary, ceiling dirty around vent. Standard found in 105 CMR 590; FC 6-501.12(A).

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
108. Culinary Arts Kitchen	Slop Sink		105 CMR 451.200	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Wet mop stored in slop sink. Standard found in 105 CMR 590; FC 6-501.16.
109. Culinary Arts Kitchen	Bathroom		105 CMR 451.123	Maintenance: Floor dirty
110. Culinary Arts Kitchen	Classroom Section		105 CMR 451.200	Design, Construction, and Installation; Functionality: Outer openings not protected against the entry of insects and rodents, exterior door not rodent and weathertight. Standard found in 105 CMR 590; FC 6-202.15(A)(3).

Building #6

Deficiencies under the Required Standards (.100 and .200 series)

6 new deficiencies and 1 repeat deficiency (indicated by an *) were found during the inspection:

Area	Sub Area # 1	Regulation	Description of Deficiency
1. Health Services Medical Area	Inmate Bathroom # 6229	105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, handwash sink leaking
2. Health Services Medical Area	Inmate Bathroom # 6229	105 CMR 451.123	Maintenance: Ceiling vent dusty
3. Medical Unit	Room # 6258	105 CMR 451.200	Food Storage, Preparation and Service: Food preparation not in compliance with 105 CMR 590.000, interior of microwave oven dirty
4. Medical Unit	Shower Area	105 CMR 451.123	Maintenance: Ceiling vent dusty in shower # 1
5. Medical Unit	Cells	105 CMR 451.103	Mattresses: Mattress damaged in cell # 8 and 12
6. Booking Area	Staff Bathroom # 6135	105 CMR 451.130*	Plumbing: Plumbing not maintained in good repair, water control not secure at handwash sink

Deficiencies under the Recommended Standards (.300 series)

10 new deficiencies and 3 repeat deficiencies (indicated by an *) were found during the inspection:

Area	Sub Area # 1	Regulation	Description of Deficiency
1. Medical Unit	Hallway	105 CMR 451.353	Interior Maintenance: Ceiling vent dusty
2. Medical Unit	Room # 6258	105 CMR 451.353	Interior Maintenance: Ceiling vent blocked
3. Medical Unit	Isolation Cells (# 3 and 5)	105 CMR 451.353	Interior Maintenance: Ceiling vent blocked in cell # 5
4. Medical Unit	Isolation Cells (# 3 and 5)	105 CMR 451.353	Interior Maintenance: Ceiling vent dusty outside of cell # 5 and 7
5. Medical Unit	Medical Waste/Biohazard Storage # 6250	105 CMR 451.353*	Interior Maintenance: Ceiling vent dusty
6. Medical Unit	Chemical Storage Room # 6248	105 CMR 451.353	Interior Maintenance: Ceiling vent dusty
7. Medical Unit	Inmate Property # 6246	105 CMR 451.360*	Protective Measures: Rodent droppings observed

Area	Sub Area # 1	Regulation	Description of Deficiency
8. Medical Unit	Cells	105 CMR 451.353	Interior Maintenance: Ceiling vent blocked in cell # 2 and 9
9. Medical Unit	Cells	105 CMR 451.353	Interior Maintenance: Ceiling vent dusty in cell # 13
10. Medical Unit	Cells	105 CMR 451.353	Interior Maintenance: Objectionable odor observed in cell # 18
11. Booking Area	Male Property Room # 6106	105 CMR 451.353*	Interior Maintenance: Ceiling water damaged

Deficiencies under 105 CMR 451.402(B) (other conditions that may constitute a threat to health or safety)

1 new deficiency was found during the inspection:

Area	Sub Area # 1	Regulation	Description of Deficiency
1. Medical Unit	Medical Waste/Biohazard Storage # 6250	105 CMR 451.402(B)	Storage Area: Storage area not used exclusively for waste storage, clean blankets and clothing stored on top of full biohazard boxes. Standard found in 105 CMR 480.100(B).

Building # 7

Deficiencies under the Recommended Standards (.300 series)

1 new deficiency and 1 repeat deficiency (indicated by an *) were found during the inspection:

Area	Sub Area # 1	Regulation	Description of Deficiency
1. Vehicle Trap	1st Floor	105 CMR 451.353*	Interior Maintenance: Ceiling water damaged
2. Vehicle Trap	2nd Floor	105 CMR 451.353	Interior Maintenance: Ceiling water damaged

Building # 8

Deficiencies under the Required Standards (.100 and .200 series)

22 new deficiencies and 19 repeat deficiencies (indicated by an *) were found during the inspection:

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
1. 1st Floor - Unit 8-1	Staff Area	Staff Bathroom # 8-106	105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, handwash sink leaking
2. 1st Floor - Unit 8-1	Common Area		105 CMR 451.200	Food Storage, Preparation and Service: Food preparation not in compliance with 105 CMR 590.000, interior of microwave oven dirty
3. 1st Floor - Unit 8-1	Common Area		105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, bubbler # 2 clogged
4. 1st Floor - Unit 8-1	Housing Area	Inmate Bathroom # 8-122	105 CMR 451.123	Maintenance: Wall vent dusty above showers
5. 2nd Floor - Unit 8-2	Staff Area	Staff Bathroom # 8-206	105 CMR 451.123*	Maintenance: Ceiling vent dusty
6. 2nd Floor - Unit 8-2	Common Area	Recreation Room # 8-215	105 CMR 451.200	Food Storage, Preparation and Service: Food preparation not in compliance with 105 CMR 590.000, interior of microwave oven dirty
7. 2nd Floor - Unit 8-2	Housing Area	Inmate Bathroom # 8-221	105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, water control leaking at handwash sink # 2

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
8. 2nd Floor - Unit 8-2	Housing Area	Inmate Bathroom # 8-221	105 CMR 451.123	Maintenance: Wall vent dusty above showers
9. 2nd Floor - Unit 8-2	Housing Area	Inmate Bathroom # 8-222	105 CMR 451.123	Maintenance: Wall vent dusty above showers
10. 2nd Floor - Unit 8-2	Housing Area	Cells	105 CMR 451.103	Mattresses: Mattress damaged in cell # 1
11. 3rd Floor - Unit 8-3	Common Area	Recreation Room # 8-316	105 CMR 451.200*	Food Storage, Preparation and Service: Food preparation not in compliance with 105 CMR 590.000, interior of microwave oven dirty
12. 3rd Floor - Unit 8-3	Housing Area	Inmate Bathroom # 8-322	105 CMR 451.123*	Maintenance: Floor dirty outside showers
13. 3rd Floor - Unit 8-3	Housing Area	Inmate Bathroom # 8-322	105 CMR 451.123*	Maintenance: Wall vent dusty above showers
14. 3rd Floor - Unit 8-3	Housing Area	Inmate Bathroom # 8-322	105 CMR 451.123	Maintenance: Walls dirty in shower # 2 and 4
15. 3rd Floor - Unit 8-3	Housing Area	Inmate Bathroom # 8-322	105 CMR 451.123	Maintenance: Curtain dirty in shower # 4
16. 3rd Floor - Unit 8-3	Housing Area	Inmate Bathroom # 8-322	105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, water control leaking at handwash sink # 2
17. 3rd Floor - Unit 8-3	Housing Area	Inmate Bathroom # 8-322	105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, shower # 5 continuously running
18. 3rd Floor - Unit 8-3	Housing Area	Inmate Bathroom # 8-322	105 CMR 451.130	Hot Water: Shower water temperature 121°F at shower # 5
19. 3rd Floor - Unit 8-3	Housing Area	Inmate Bathroom # 8-321	105 CMR 451.123*	Maintenance: Walls dirty in shower # 1, 3, and 5
20. 4th Floor - Unit 8-4	Housing Area	Bathroom # 8-421	105 CMR 451.123	Maintenance: Floor dirty throughout bathroom
21. 4th Floor - Unit 8-4	Housing Area	Bathroom # 8-421	105 CMR 451.123*	Maintenance: Wall vent dusty above shower
22. 4th Floor - Unit 8-4	Housing Area	Bathroom # 8-421	105 CMR 451.123*	Maintenance: Walls dirty in shower # 1, 2, 3, 4, and 5
23. 4th Floor - Unit 8-4	Housing Area	Bathroom # 8-421	105 CMR 451.123*	Maintenance: Floor dirty in shower # 1
24. 4th Floor - Unit 8-4	Housing Area	Bathroom # 8-422	105 CMR 451.123*	Maintenance: Wall vent dusty above shower
25. 4th Floor - Unit 8-4	Housing Area	Bathroom # 8-422	105 CMR 451.123*	Maintenance: Area around handwash sinks dirty
26. 4th Floor - Unit 8-4	Housing Area	Bathroom # 8-422	105 CMR 451.123*	Maintenance: Floor stained
27. 4th Floor - Unit 8-4	Housing Area	Bathroom # 8-422	105 CMR 451.123*	Maintenance: Light near showers damaged and dirty
28. 4th Floor - Unit 8-4	Housing Area	Bathroom # 8-422	105 CMR 451.123*	Maintenance: Ceiling damaged
29. 4th Floor - Unit 8-4	Housing Area	Bathroom # 8-422	105 CMR 451.123	Maintenance: Walls dirty near handwash sinks
30. 4th Floor - Unit 8-4	Housing Area	Bathroom # 8-422	105 CMR 451.123	Maintenance: Walls dirty in shower # 1, 2, 3, 4, and 5

Deficiencies under the Recommended Standards (.300 series)

17 new deficiencies and 3 repeat deficiencies (indicated by an *) were found during the inspection:

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
1. Building Entrance			105 CMR 451.350*	Structural Maintenance: Left side exterior door at entrance damaged
2. 1st Floor - Unit 8-1	Common Area	Office # 8-115	105 CMR 451.353	Interior Maintenance: Ceiling vent blocked
3. 1st Floor - Unit 8-1	Common Area	Staff Break Room # 8-116	105 CMR 451.353	Interior Maintenance: Ceiling vent dusty
4. 1st Floor - Unit 8-1	Common Area	Slop Sink Room # 8-123	105 CMR 451.353	Interior Maintenance: Wet mop stored in bucket
5. 2nd Floor - Unit 8-2	Staff Area	Property # 8-211	105 CMR 451.344*	Illumination in Habitable Areas: Light(s) not functioning properly, light out
6. 2nd Floor - Unit 8-2	Staff Area	Electrical # 8-226	105 CMR 451.353	Interior Maintenance: Ceiling vent dusty
7. 2nd Floor - Unit 8-2	Common Area		105 CMR 451.353*	Interior Maintenance: Floor tiles damaged throughout
8. 2nd Floor - Unit 8-2	Common Area	Recreation Room # 8-215	105 CMR 451.353	Interior Maintenance: Ceiling vent dusty
9. 2nd Floor - Unit 8-2	Common Area	Laundry Area	105 CMR 451.353	Interior Maintenance: Area around handwash sink dirty
10. 2nd Floor - Unit 8-2	Housing Area	Slop Sink # 8-223	105 CMR 451.353	Interior Maintenance: Ceiling vent dusty
11. 3rd Floor - Unit 8-3	Common Area	Recreation Room # 8-315	105 CMR 451.353	Interior Maintenance: Ceiling vent dusty
12. 3rd Floor - Unit 8-3	Common Area	Recreation Room # 8-316	105 CMR 451.353	Interior Maintenance: Padding damaged on exercise machine
13. 3rd Floor - Unit 8-3	Common Area	Laundry Area	105 CMR 451.353	Interior Maintenance: Area around handwash sink dirty
14. 3rd Floor - Unit 8-3	Common Area	Laundry Area	105 CMR 451.360	Protective Measures: Rodent droppings observed
15. 3rd Floor - Unit 8-3	Housing Area	Slop Sink Room # 8-323	105 CMR 451.353	Interior Maintenance: Wet mop stored upside down
16. 3rd Floor - Unit 8-3	Housing Area	Slop Sink Room # 8-323	105 CMR 451.353	Interior Maintenance: Wet mop stored in bucket
17. 3rd Floor - Unit 8-3	Housing Area	Slop Sink Room # 8-323	105 CMR 451.353	Interior Maintenance: Standing water stored in mop bucket
18. 4th Floor - Unit 8-4	Common Area	TV Room # 8-415	105 CMR 451.353	Interior Maintenance: Floor dirty
19. 4th Floor - Unit 8-4	Common Area	TV Room # 8-416	105 CMR 451.353	Interior Maintenance: Ceiling vent dusty
20. 4th Floor - Unit 8-4	Housing Area		105 CMR 451.353	Interior Maintenance: Floor dirty throughout

SECTION 2: Areas Found to be in Compliance

EHRIS inspected 272 additional areas of the facility which were found to be in compliance

SECTION 3: Areas EHRS did not Inspect

EHRS did not inspect 3 areas of the facility because they were either in use, locked, or under construction.

Area	Sub Area # 1	Sub Area # 2	Sub Area # 3	Description of Deficiency
1. Building # 1	11th Floor	Unit 1-11-2	Kitchenette	Unable to Inspect – In Use
2. Building # 1	2nd Floor	Unit 1-2-1	Bathroom # 235	Unable to Inspect – In Use
3. Building # 8	1st Floor - Unit 8-1	Housing Area	Inmate Bathroom # 8-121	Unable to Inspect – In Use

SECTION 4: Plan of Correction

This facility does not comply with the Department’s regulations cited above. In accordance with 105 CMR 451.404, please submit a plan of correction within 10 working days of receipt of this notice which includes:

1. Specific corrective steps to be taken
2. A timetable for the corrective actions for larger projects
3. The date by which correction will be achieved
4. Any interim measures being implemented to ensure the health and safety of incarcerated individuals and facility staff
5. A signature by the Superintendent or Administrator responsible for the plan. The signed plan should be submitted to my attention, at the address listed above.

SECTION 5: Observations and Recommendations

1. The inmate population was 1093 at the time of inspection.
2. During the facility inspection, the EHRS noted numerous deficiencies related to cleanliness. The conditions noted throughout the facility can lead to bacterial growth and pest infestation, increasing the risk of illness for staff and inmates. The EHRS suggests a routine cleaning schedule be developed and implemented to ensure all areas of the facility are cleaned at a higher frequency.
3. During the inspection of the food service area, the EHRS noted numerous deficiencies related to improper food serving procedures and failure to properly clean and sanitize surfaces and equipment. The conditions noted throughout the food service area can lead to cross contamination and pathogen growth, increasing the risk of foodborne illness or injury. The EHRS recommends:
 - A routine cleaning schedule be developed and implemented to ensure all areas of the kitchen are cleaned at a higher frequency; and
 - Kitchen management develop a program and train staff on proper food serving temperatures and record keeping protocols.

To review the specific regulatory requirements, please visit the [Massachusetts Department of Public Health Regulatory and Compliance Unit](#) and [read the minimum health and sanitation standards for correctional facilities](#) available in both PDF and RTF formats. For more specific information about the food standards, you can [download the merged food code](#).

An inspection may also include observations of other conditions which could constitute a threat to the health or safety of inmates or employees, including but not limited to the standards set forth by the Department as follows, and report on such pursuant to 451.402(B). You can use these links below to review these standards:

- [105 CMR 205.000](#): Minimum Standards Governing Medical Records and Conduct of Physical Examinations in Correctional Facilities
- [105 CMR 480.000](#): Minimum requirements for the Management of Medical or Biological Waste
- [105 CMR 500.000](#): Good Manufacturing Practices for Food

This inspection report is true and accurate to the best of my knowledge.

Sincerely,

A handwritten signature in blue ink that reads "Hannah LeBeau". The signature is written in a cursive, flowing style.

Hannah LeBeau
Environmental Health Officer, EHRS, BCEH



STEVEN W. TOMPKINS
SHERIFF

Suffolk County Sheriff's Department

Jail
200 Nashua Street
Boston, MA 02114
(617) 635-1100

House of Correction
20 Bradston Street
Boston, MA 02118
(617) 635-1000



June 18, 2026

Hannah LeBeau
Environmental Health Inspector
Department of Public Health
Bureau of Environmental Health
Community Sanitation Program
5 Randolph St.
Canton, MA 02021


Dear Inspector LeBeau,


Enclosed is this Department's Plan of Action to correct deficiencies noted in the Minimum Health and Sanitation Standards Inspection of the Suffolk County House of Correction conducted by you on April 27, 28 and 29, 2026.

Maintenance issues noted have either been addressed or the completion date is anticipated based on resources available.

As always, we look forward to any recommendations or suggestions your department raises, and will address those issues to the best of our abilities in a timely manner.

Sincerely,

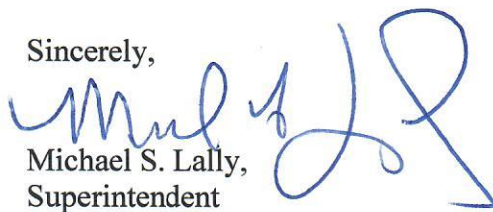
Michael S. Lally,
Superintendent

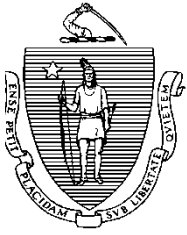

The Commonwealth of Massachusetts
Executive Office of Health and Human Services
Department of Public Health
250 Washington Street, Boston, MA 02108-4619
617-624-6000 | mass.gov/dph

Maura T. Healey
Governor

Kimberley Driscoll
Lieutenant Governor

Kiame Mahaniah, MD, MBA
Secretary

Robert Goldstein, MD, PhD
Commissioner

May 20, 2026

Steven W. Tompkins, Sheriff
Suffolk County Sheriff's Department
20 Bradston Street
Boston, MA 02118 (electronic copy)

Re: Facility Inspection – Suffolk County House of Corrections, Boston

Dear Sheriff Tompkins:

The Massachusetts Department of Public Health (Department) Division of Environmental Health Regulations and Standards (EHRS) conducted an inspection of the Suffolk County House of Corrections on April 27, 28, and 29, 2026 accompanied by Captain Brian Reynolds, in accordance with Department regulations 105 CMR 451.000: Minimum Health and Sanitation Standards and Inspection Procedures for Correctional Facilities.

The inspection identified 833 total deficiencies: 291 new deficiencies under the Required Standards (.100 and .200 series), 141 repeat deficiencies under the Required Standards, 310 new deficiencies under the Recommended Standards (.300 series), 90 repeat deficiencies under the Recommended Standards, and 1 new deficiency under 105 CMR 451.402(B).

Overview

Section 1 provides details of all deficiencies, including repeat deficiencies, found during the inspection. These are categorized by Required Standards, Recommended Standards, or additional applicable regulatory standards.

Section 2 provides information on areas that EHRS found to be compliant.

Section 3 documents the areas that EHRS did not inspect.

Section 4 provides information on submitting a Plan of Correction for the identified deficiencies.

Section 5 outlines observations and recommendations related to the inspection.

SECTION 1: Health and Safety Deficiencies

Building #1

Deficiencies under the Required Standards (.100 and .200 series)

102 new deficiencies and 29 repeat deficiencies (indicated by an *) were found during the inspection:

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
1. 11th Floor	Slop Sink Room # 1158		105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, drain clogged at slop sink Drain unclogged – 4/27/26
2. 11th Floor	Unit 1-11-1	Showers	105 CMR 451.130*	Hot Water: Shower water temperature 69°F at shower # 3 Water temperature adjusted to meet the appropriate regulatory requirements – 6/15/26
3. 11th Floor	Unit 1-11-1	Showers	105 CMR 451.123*	Maintenance: Walls dirty in shower # 1, 2, and 3 Walls cleaned – 4/27/26
4. 11th Floor	Unit 1-11-1	Showers	105 CMR 451.123*	Maintenance: Ceiling vent dusty in shower # 2 Vent cleaned 5/21/26
5. 11th Floor	Unit 1-11-1	Showers	105 CMR 451.123	Maintenance: Ceiling vent dusty in shower # 1 and 3 Vents cleaned - 5/21/26
6. 11th Floor	Unit 1-11-1	Kitchenette	105 CMR 451.200	Food Storage, Preparation and Service: Food preparation not in compliance with 105 CMR 590.000, interior of microwave oven dirty Microwave cleaned – 4/27/26
7. 11th Floor	Unit 1-11-2	Showers	105 CMR 451.123*	Maintenance: Walls dirty in shower # 1 and 2 Walls cleaned – 4/27/26
8. 11th Floor	Unit 1-11-2	Showers	105 CMR 451.123*	Maintenance: Ceiling vent dusty in shower # 3 Vent cleaned - 5/21/26
9. 10th Floor	Staff Bathroom # 1074		105 CMR 451.123	Maintenance: Ceiling vent dusty Vent cleaned - 5/21/26
10. 10th Floor	Unit 1-10-1	Showers	105 CMR 451.123	Maintenance: Mop stored upside down in shower # 1 Mop removed from upside down position and stored properly – 4/27/26
11. 10th Floor	Unit 1-10-1	Showers	105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, shower # 1 continuously running Shower repaired – 4/27/26
12. 10th Floor	Unit 1-10-1	Kitchenette	105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, drain cover missing at handwash sink

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
				Cover installed – 6/4/26
13. 10th Floor	Unit 1-10-1	Cells	105 CMR 451.103	Mattresses: Mattress cover damaged in cell # 9 Mattress removed – 5/21/26
14. 10th Floor	Unit 1-10-2	Showers	105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, shower # 1 leaking Shower repaired – 6/4/326
15. 10th Floor	Unit 1-10-2	Showers	105 CMR 451.123	Maintenance: Ceiling vent dusty in shower # 1, 2, and 3 Vents cleaned - 5/21/26
16. 10th Floor	Unit 1-10-2	Kitchenette	105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, handwash sink out-of-order Sink repaired – placed back on-line – 6/1/26
17. 10th Floor	Unit 1-10-2	Kitchenette	105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, handwash sink clogged Sink unclogged – 6/1/26
18. 10th Floor	Unit 1-10-4 Women's MAT Program	Staff Bathroom	105 CMR 451.123	Maintenance: Soap dispenser damaged Soap dispenser repaired – 6/4/26
19. 10th Floor	Unit 1-10-4 Women's MAT Program	Shower	105 CMR 451.123*	Maintenance: Wall damaged around water control Wall repaired – 6/8/26
20. 10th Floor	Unit 1-10-4 Women's MAT Program	Staff Bathroom	105 CMR 451.123*	Maintenance: Ceiling vent dusty Vent cleaned – 5/21/26
21. 9th Floor	Staff Bathroom # 944		105 CMR 451.123*	Maintenance: Ceiling vent dusty Vent cleaned - 5/21/26
22. 9th Floor	Unit 1-9-1	Shower Area	105 CMR 451.123*	Maintenance: Walls dirty in shower # 1 Walls cleaned – 4/27/26
23. 9th Floor	Unit 1-9-1	Shower Area	105 CMR 451.123	Maintenance: Ceiling vent dusty in shower # 1 Vent cleaned – 5/21/26
24. 9th Floor	Unit 1-9-1	Shower Area	105 CMR 451.123	Maintenance: Door frame damaged in shower # 1 Frame repaired – 6/4/26
25. 9th Floor	Unit 1-9-1	Shower Area	105 CMR 451.123	Maintenance: Walls dirty in shower # 3 Walls cleaned – 4/27/26
26. 9th Floor	Unit 1-9-1	Shower Area	105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, shower # 3 continuously running Shower repaired – 4/27/26
27. 9th Floor	Unit 1-9-1	Shower Area	105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, handicapped shower

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
				attachment missing Attachment replaced – 5/6/26
28. 9th Floor	Unit 1-9-1	Kitchenette	105 CMR 451.200	Food Storage, Preparation and Service: Food preparation not in compliance with 105 CMR 590.000, microwave oven damaged Microwave replaced – 5/21/26
29. 9th Floor	Unit 1-9-1	Kitchenette	105 CMR 451.126	Hot Water for Bathing and Hygiene: Hot water temperature 88°F at handwash sink Water temperature adjusted to meet the appropriate regulatory requirements – 6/15/26
30. 9th Floor	Unit 1-9-2	Shower Area	105 CMR 451.123	Maintenance: Wall paint damaged in shower # 1 Wall repaired – 6/5/26
31. 9th Floor	Unit 1-9-2	Shower Area	105 CMR 451.123	Maintenance: Ceiling vent rusted in shower # 2 Vent replaced – 6/5/26
32. 9th Floor	Unit 1-9-2	Shower Area	105 CMR 451.123	Maintenance: Walls dirty in shower # 2 Walls cleaned – 4/27/26
33. 8th Floor	Unit 1-8-1	Showers	105 CMR 451.123*	Maintenance: Walls dirty in shower # 1 and 2 Walls cleaned – 4/27/26
34. 8th Floor	Unit 1-8-1	Showers	105 CMR 451.123*	Maintenance: Ceiling vent dusty in shower # 1 Vent cleaned - 5/21/26
35. 8th Floor	Unit 1-8-2	Showers	105 CMR 451.123	Maintenance: Ceiling vent dusty in shower # 2 and 3 Vents cleaned - 5/21/26
36. 8th Floor	Unit 1-8-2	Showers	105 CMR 451.123	Maintenance: Drain flies observed in shower # 1 Shower cleaned – Exterminator addressed issue – 6/2/26
37. 8th Floor	Unit 1-8-2	Showers	105 CMR 451.123	Maintenance: Walls dirty in shower # 2 Walls cleaned – 4/27/26
38. 8th Floor	Unit 1-8-2	Showers	105 CMR 451.123	Maintenance: Ceiling paint damaged in shower # 2 Ceiling repaired – 6/5/26
39. 8th Floor	Unit 1-8-2	Cells	105 CMR 451.103	Mattresses: Mattress cover missing in cell # 6, 11, and 14 Mattresses replaced – 5/21/26
40. 6th Floor	Unit 1-6-1	Kitchenette	105 CMR 451.200	Food Storage, Preparation and Service: Food preparation not in compliance with 105 CMR 590.000, interior of microwave oven dirty Microwave cleaned – 4/27/26

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
41. 6th Floor	Unit 1-6-1	Upper Showers	105 CMR 451.123	Maintenance: Door frame rusted in shower # 3 Maintenance notified – frame will be repaired – anticipated date of repairs no later than 7/3/26
42. 6th Floor	Unit 1-6-1	Upper Showers	105 CMR 451.123	Maintenance: Walls dirty in shower # 1 Walls cleaned – 4/27/26
43. 6th Floor	Unit 1-6-1	Upper Showers	105 CMR 451.123	Maintenance: Ceiling vent dusty in shower # 1 and 2 Vents cleaned - 5/21/26
44. 6th Floor	Unit 1-6-1	Upper Showers	105 CMR 451.123	Maintenance: Sprinkler shroud rusted in shower # 3 Fire Safety Officer notified – shroud will be replaced – anticipated date of repair no later than 7/1/26
45. 6th Floor	Unit 1-6-1	Upper Showers	105 CMR 451.123	Maintenance: Threshold epoxy damaged in shower # 3 Maintenance notified – frame will be repaired – anticipated date of repairs no later than 7/3/26
46. 6th Floor	Unit 1-6-1	Lower Shower Area	105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, handicapped shower attachment missing in shower # 3 Attachment replaced – 5/6/26
47. 6th Floor	Unit 1-6-1	Lower Shower Area	105 CMR 451.123	Maintenance: Ceiling vent dusty in shower # 1, 2, and 3 Vents cleaned - 5/21/26
48. 6th Floor	Unit 1-6-1	Lower Shower Area	105 CMR 451.123	Maintenance: Door frame rusted in shower # 1 and 3 Maintenance notified – frame will be repaired – anticipated date of repairs no later than 7/3/26
49. 6th Floor	Unit 1-6-2	Kitchenette	105 CMR 451.200	Food Storage, Preparation and Service: Food preparation not in compliance with 105 CMR 590.000, interior of microwave oven dirty near television and near cell # 16 Microwave cleaned – 4/27/26
50. 6th Floor	Unit 1-6-2	Upper Cells	105 CMR 451.103	Mattresses: Mattress cover missing in cell # 18 and 27 Mattresses replaced – 5/21/26
51. 6th Floor	Unit 1-6-2	Upper Showers	105 CMR 451.123*	Maintenance: Ceiling vent dusty in shower # 2 Vent cleaned - 5/21/26

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
52. 6th Floor	Unit 1-6-2	Upper Showers	105 CMR 451.123*	Maintenance: Wall damaged near water control in shower # 1 Maintenance notified – wall will be repaired– anticipated repair date no later than 7/3/26
53. 6th Floor	Unit 1-6-2	Upper Showers	105 CMR 451.123*	Maintenance: Walls dirty in shower # 2 Walls cleaned – 4/27/26
54. 6th Floor	Unit 1-6-2	Upper Showers	105 CMR 451.123	Maintenance: Sprinkler shroud rusted in shower # 1 and 2 Fire Safety Officer notified – shroud will be replaced – anticipated date of repair no later than 7/1/26
55. 6th Floor	Unit 1-6-2	Upper Showers	105 CMR 451.123	Maintenance: Door frame rusted in shower # 2 Maintenance notified
56. 6th Floor	Unit 1-6-2	Upper Showers	105 CMR 451.123	Maintenance: Ceiling vent dusty in shower # 3 Vent cleaned - 5/21/26
57. 6th Floor	Unit 1-6-2	Lower Showers	105 CMR 451.123*	Maintenance: Ceiling vent dusty in shower # 2 Vent cleaned - 5/21/26
58. 6th Floor	Unit 1-6-2	Lower Showers	105 CMR 451.123	Maintenance: Door frame rusted in shower # 1 and 2 Maintenance notified – frame will be repaired – anticipated date of repairs no later than 7/3/26
59. 6th Floor	Unit 1-6-2	Lower Showers	105 CMR 451.123	Maintenance: Drain flies observed in shower # 2 Shower cleaned– exterminator addressed the violation – 6/1/26
60. 6th Floor	Unit 1-6-2	Lower Showers	105 CMR 451.123	Maintenance: Shower curtain damaged in shower # 2 Curtain replaced – 5/22/26
61. 6th Floor	Unit 1-6-2	Lower Showers	105 CMR 451.123	Maintenance: Ceiling vent dusty in shower # 3 Vent cleaned - 5/21/26
62. 5th Floor	Unit 1-5-1	Shower Area	105 CMR 451.123	Maintenance: Door frame damaged in shower # 1 and 2 Frames repaired – 6/5/26
63. 5th Floor	Unit 1-5-1	Shower Area	105 CMR 451.123	Maintenance: Sprinkler shroud rusted in shower # 2 Fire Safety Officer notified – shroud will be replaced – anticipated date of repair no later than 7/1/26
64. 4th Floor	Staff Bathroom # 445		105 CMR 451.123	Maintenance: Ceiling vent dusty Vent cleaned - 5/21/26
65. 4th Floor	Slop Sink # 454		105 CMR 451.130	Plumbing: Plumbing not

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
				maintained in good repair, slop sink clogged Sink unclogged – 5/20/26
66. 4th Floor	Unit 1-4-1	Shower Area	105 CMR 451.123*	Maintenance: Walls dirty in shower # 1 Walls cleaned – 4/27/26
67. 4th Floor	Unit 1-4-1	Shower Area	105 CMR 451.123	Maintenance: Walls dirty in shower # 3 Walls cleaned – 4/27/26
68. 4th Floor	Unit 1-4-1	Shower Area	105 CMR 451.123	Maintenance: Ceiling vent dusty in shower # 1 Vent cleaned - 5/21/26
69. 4th Floor	Unit 1-4-1	Shower Area	105 CMR 451.123	Maintenance: Door frame damaged in shower # 1 Maintenance notified – frame will be repaired – anticipated repair date no later than 7/3/26
70. 4th Floor	Unit 1-4-1	Shower Area	105 CMR 451.123	Maintenance: Wet mop stored in bucket in shower # 2 Mop removed and stored properly – 4/27/26
71. 4th Floor	Unit 1-4-1	Shower Area	105 CMR 451.123	Maintenance: Debris in drain in shower # 2 Debris removed – 4/27/26
72. 4th Floor	Unit 1-4-1	Cells	105 CMR 451.103	Mattresses: Mattress cover missing in cell # 4 Mattress replaced – 5/21/26
73. 4th Floor	Unit 1-4-2	Shower Area	105 CMR 451.123*	Maintenance: Ceiling vent dusty in shower # 3 Vent cleaned - 5/21/26
74. 4th Floor	Unit 1-4-2	Shower Area	105 CMR 451.123	Maintenance: Wet mop stored on floor in shower # 1 Mop removed and stored properly – 4/27/26
75. 4th Floor	Unit 1-4-2	Shower Area	105 CMR 451.123	Maintenance: Toilet auger stored with cleaning supplies in shower # 1 Auger removed – 4/27/26
76. 4th Floor	Unit 1-4-2	Shower Area	105 CMR 451.123	Maintenance: Walls dirty in shower # 2 and 3 Walls cleaned – 4/27/26
77. 4th Floor	Unit 1-4-2	Shower Area	105 CMR 451.123	Maintenance: Ceiling vent dusty in shower # 2 Vent cleaned – 5/21/26
78. 4th Floor	Unit 1-4-2	Cells	105 CMR 451.103	Mattresses: Mattress damaged in cell # 3 Mattress replaced – 5/21/26
79. 3rd Floor	Unit 1-3-1	Cells	105 CMR 451.103	Mattresses: Mattress cover missing in cell # 8 Mattress replaced – 5/21/26
80. 3rd Floor	Unit 1-3-2	Staff Bathroom # 360	105 CMR 451.123	Maintenance: Objectionable odor observed

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
				Odor mitigated – 4/27/26
81. 3rd Floor	Unit 1-3-2	Shower Area	105 CMR 451.123*	Maintenance: Debris in drain in shower # 1 Debris removed – 4/27/26
82. 3rd Floor	Unit 1-3-2	Shower Area	105 CMR 451.123*	Maintenance: Debris on floor in shower # 1 Debris removed – 4/27/26
83. 3rd Floor	Unit 1-3-2	Shower Area	105 CMR 451.123*	Maintenance: Walls dirty in shower # 1 Walls cleaned – 4/27/26
84. 3rd Floor	Unit 1-3-2	Shower Area	105 CMR 451.123*	Maintenance: Ceiling dirty in shower # 1 Ceiling cleaned – 5/21/26
85. 3rd Floor	Unit 1-3-2	Shower Area	105 CMR 451.123	Maintenance: Ceiling vent dusty in shower # 1 and 3 Vents cleaned – 5/22/26
86. 3rd Floor	Unit 1-3-2	Shower Area	105 CMR 451.123	Maintenance: Door frame dirty in shower # 1 Frame cleaned – 5/22/26
87. 3rd Floor	Unit 1-3-2	Shower Area	105 CMR 451.123	Maintenance: Wet mop stored on floor in shower # 2 Mop removed and stored properly – 4/27/26
88. 3rd Floor	Unit 1-3-2	Shower Area	105 CMR 451.123	Maintenance: Debris on floor in shower # 2 and 3 Debris removed – 4/27/26
89. 3rd Floor	Unit 1-3-2	Shower Area	105 CMR 451.123	Maintenance: Door frame rusted in shower # 3 Maintenance notified - frame will be repaired – anticipated repair date no later than 7/3/26
90. 3rd Floor	Unit 1-3-2	Shower Area	105 CMR 451.123	Maintenance: Floor dirty in shower # 3 Floor cleaned – 4/27/26
91. 3rd Floor	Unit 1-3-2	Shower Area	105 CMR 451.123	Maintenance: Walls dirty in shower # 3 Walls cleaned – 4/27/26
92. 3rd Floor	Unit 1-3-2	Kitchenette	105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, debris in drain Debris removed – 4/27/26
93. 3rd Floor	Unit 1-3-2	Kitchenette	105 CMR 451.126	Hot Water for Bathing and Hygiene: Hot water temperature 59°F at handwash sink Water temperature adjusted to meet the appropriate regulatory requirements – 6/15/26
94. 2nd Floor	Unit 1-2-1	Common Area	105 CMR 451.200*	Food Storage, Preparation and Service: Food preparation not in compliance with 105 CMR 590.000, interior of microwave

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
				oven dirty near cell # 19 Microwave cleaned – 4/27/26
95. 2nd Floor	Unit 1-2-1	Bathroom # 230	105 CMR 451.123*	Maintenance: Walls dirty in shower # 4 Walls cleaned – 4/27/26
96. 2nd Floor	Unit 1-2-1	Bathroom # 230	105 CMR 451.123*	Maintenance: Floor dirty in shower # 1 Floor cleaned – 4/27/26
97. 2nd Floor	Unit 1-2-1	Bathroom # 230	105 CMR 451.123	Maintenance: No curtain at shower # 1 and 2 Curtains installed – 5/22/26
98. 2nd Floor	Unit 1-2-1	Bathroom # 230	105 CMR 451.123	Maintenance: Floor drain dirty in shower # 1 Drain cleaned – 4/27/26
99. 2nd Floor	Unit 1-2-1	Bathroom # 230	105 CMR 451.123	Maintenance: Floor dirty in shower # 3 and 4 Floors cleaned – 4/27/26
100. 2nd Floor	Unit 1-2-1	Bathroom # 230	105 CMR 451.123	Maintenance: Walls dirty in shower # 2 Walls cleaned – 4/27/26
101. 2nd Floor	Unit 1-2-1	Bathroom # 230	105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, showerhead missing in shower # 1 and 2 Showerhead replaced – 6/5/26
102. 2nd Floor	Unit 1-2-1	Bathroom # 230	105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, shower # 2 leaking Shower repaired – 6/5/26
103. 2nd Floor	Unit 1-2-1	Bathroom # 230	105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, showerhead covered in plastic bag in shower # 3 Plastic bag removed – 5/15/26
104. 2nd Floor	Unit 1-2-1	Bathroom # 230	105 CMR 451.123	Maintenance: Floor paint damaged outside showers Floor repaired – 6/15/26
105. 2nd Floor	Unit 1-2-1	Bathroom # 230	105 CMR 451.123	Maintenance: Ceiling vent rusted above toilet Vent repaired – 6/5/26
106. 2nd Floor	Unit 1-2-1	Cells	105 CMR 451.103	Mattresses: Mattress damaged in cell # 27 Mattress replaced – 5/22/26
107. 1st Floor	Female Bathroom # 140		105 CMR 451.130*	Plumbing: Plumbing not maintained in good repair, handwash sink # 1 out-of-order Sink repaired - 6/4/26

Deficiencies under the Recommended Standards (.300 series)

186 new deficiencies and 35 repeat deficiencies (indicated by an *) were found during the inspection:

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
------	--------------	--------------	------------	---------------------------

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
1. All Cells			105 CMR 451.320*	Cell Size: Inadequate floor space in all cells Cell design does not allow the facility to provide adequate floor space
2. 11th Floor	Unit 1-11-1	Common Area	105 CMR 451.353	Interior Maintenance: Wall dusty around vent near television Wall cleaned – 5/22/26
3. 11th Floor	Unit 1-11-1	Cells	105 CMR 451.353	Interior Maintenance: Wall vent blocked in cell # 15 Vent cleared – 5/22/26
4. 11th Floor	Unit 1-11-1	Cells	105 CMR 451.353*	Interior Maintenance: Wall vent blocked in cell # 4 Vent cleared – 5/22/26
5. 11th Floor	Unit 1-11-2	Common Area	105 CMR 451.353	Interior Maintenance: Wall dusty around vent near television Wall cleaned – 5/22/26
6. 11th Floor	Unit 1-11-2	Cells	105 CMR 451.353	Interior Maintenance: Ceiling vent blocked in cell # 2 and 15 Vents cleared – 5/22/26
7. 10th Floor	Offices		105 CMR 451.353	Interior Maintenance: Ceiling tiles dirty throughout Tiles replaced – 6/5/26
8. 10th Floor	Unit 1-10-1	Common Area	105 CMR 451.353	Interior Maintenance: Ceiling vent dusty Vent cleaned – 5/22/26
9. 10th Floor	Unit 1-10-1	Cells	105 CMR 451.353	Interior Maintenance: Wall vent blocked in cell # 10 and 15 Vents cleared – 5/22/26
10. 10th Floor	Unit 1-10-1	Cells	105 CMR 451.353	Interior Maintenance: Ceiling paint damaged in cell # 11, 15, and 16 Ceilings repaired – 6/3/26
11. 10th Floor	Unit 1-10-1	Cells	105 CMR 451.353	Interior Maintenance: Door window cracked in cell # 1 and 14 Operations & Planning notified – contractor will replace window glass – anticipated date of repairs no later than 6/28/26
12. 10th Floor	Unit 1-10-2	Common Area	105 CMR 451.353	Interior Maintenance: Ceiling vent dusty Vent cleaned – 5/22/26
13. 10th Floor	Unit 1-10-2	Kitchenette	105 CMR 451.353	Interior Maintenance: Cabinet below handwash sink dirty Cabinet cleaned – 5/22/26
14. 10th Floor	Unit 1-10-2	Cells	105 CMR 451.353	Interior Maintenance: Wall vent blocked in cell # 1 Vent cleared – 5/22/26
15. 10th Floor	Unit 1-10-2	Cells	105 CMR 451.353	Interior Maintenance: Ceiling paint damaged in cell # 10, 12, and 15 Ceilings repaired – 6/3/26

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
16. 10th Floor	Unit 1-10-4 Women's MAT Program	Supply Closet	105 CMR 451.344*	Illumination in Habitable Areas: Light(s) not functioning properly, light out Light repaired – 6/4/26
17. 10th Floor	Unit 1-10-4 Women's MAT Program	Supply Closet	105 CMR 451.353	Interior Maintenance: Wet mop stored in bucket Mop removed and stored properly - 4/27/26
18. 10th Floor	Unit 1-10-4 Women's MAT Program	Exam Room	105 CMR 451.353	Interior Maintenance: Ceiling vent dusty Wall cleaned – 5/22/26
19. 10th Floor	Unit 1-10-4 Women's MAT Program	Exam Room	105 CMR 451.353	Interior Maintenance: Ceiling paint damaged Ceiling repaired – 6/3/26
20. 10th Floor	Unit 1-10-4 Women's MAT Program	Cells	105 CMR 451.353	Interior Maintenance: Cell # 18 generally dirty Cell cleaned – 4/27/26
21. 10th Floor	Unit 1-10-4 Women's MAT Program	Cells	105 CMR 451.353	Interior Maintenance: Ceiling paint damaged in cell # 20 Ceiling repaired – 6/3/26
22. 10th Floor	Unit 1-10-3	Cells	105 CMR 451.353	Interior Maintenance: Ceiling paint damaged in cell # 6 Ceiling repaired – 6/3/26
23. 10th Floor	Unit 1-10-3	Cells	105 CMR 451.353	Interior Maintenance: Wall vent blocked in cell # 1 and 4 Vent cleared – 5/22/26
24. 9th Floor	Slop Sink # 956		105 CMR 451.353*	Interior Maintenance: Slop sink dirty Sink cleaned – 4/27/26
25. 9th Floor	Recreation Deck # 940		105 CMR 451.353*	Interior Maintenance: Ceiling paint damaged Maintenance notified – ceiling will be repaired – anticipated repair date no later than 7/3/26
26. 9th Floor	Recreation Deck # 940		105 CMR 451.353*	Interior Maintenance: Wall paint damaged Maintenance notified – wall will be repaired – anticipated repair date no later than 7/3/26
27. 9th Floor	Recreation Deck # 940		105 CMR 451.353*	Interior Maintenance: Light not secure to ceiling Maintenance notified – light will be secured – anticipated repair date no later than 7/3/26
28. 9th Floor	Programs/Education Offices		105 CMR 451.353	Interior Maintenance: Ceiling vent blocked Vent cleared – 5/22/26
29. 9th Floor	Programs/Education Offices		105 CMR 451.353	Interior Maintenance: Ceiling vent dusty Vent cleaned – 5/22/26
30. 9th Floor	Unit 1-9-1	Common Area	105 CMR 451.353	Interior Maintenance: Wall dusty around vent near television Wall cleaned – 5/22/26
31. 9th Floor	Unit 1-9-1	Common Area	105 CMR 451.353	Interior Maintenance: Vent dusty near Recreation Deck

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
				Vent cleaned – 5/22/26
32. 9th Floor	Unit 1-9-1	Kitchenette	105 CMR 451.353	Interior Maintenance: Cabinet under handwash sink dirty Cabinet cleaned – 5/22/26
33. 9th Floor	Unit 1-9-1	Cells	105 CMR 451.353	Interior Maintenance: Wall vent blocked in cell # 1, 2, 5, and 9 Vents cleared – 5/22/26
34. 9th Floor	Unit 1-9-1	Cells	105 CMR 451.353	Interior Maintenance: Ceiling paint damaged in cell # 7 and 8 Ceilings repaired – 6/3/26
35. 9th Floor	Unit 1-9-2	Kitchenette	105 CMR 451.353	Interior Maintenance: Cabinet under handwash sink dirty Cabinet cleaned – 5/22/26
36. 9th Floor	Unit 1-9-2	Cells	105 CMR 451.353	Interior Maintenance: Ceiling paint damaged in cell # 8 Ceiling repaired – 6/3/26
37. 8th Floor	Unit 1-8-1	Common Area	105 CMR 451.353	Interior Maintenance: Wall vent dusty near television Vent cleaned – 5/22/26
38. 8th Floor	Unit 1-8-1	Laundry Area	105 CMR 451.360	Protective Measures: Rodent droppings observed Area cleaned – exterminator addressed the violation – 6/1/26
39. 8th Floor	Unit 1-8-1	Utility Closet # 834	105 CMR 451.360*	Protective Measures: Rodent droppings observed Area cleaned – exterminator addressed the violation – 6/1/26
40. 8th Floor	Unit 1-8-1	Utility Closet # 834	105 CMR 451.353	Interior Maintenance: Floor dirty Floor cleaned – 4/27/26
41. 8th Floor	Unit 1-8-1	Utility Closet # 834	105 CMR 451.353	Interior Maintenance: Standing water stored in mop bucket Water removed – 4/27/26
42. 8th Floor	Unit 1-8-1	Cells	105 CMR 451.353	Interior Maintenance: Ceiling paint damaged in cell # 3 Ceiling repaired – 6/3/26
43. 8th Floor	Unit 1-8-1	Cells	105 CMR 451.353	Interior Maintenance: Wall vent blocked in cell # 5, 8, 9, 13, 14, and 16 Vents cleared – 5/21/26
44. 8th Floor	Unit 1-8-2	Recreation Deck	105 CMR 451.353	Interior Maintenance: Door knob damaged on 1-8-1 entrance to Recreation Deck Knob replaced – 5/1/26
45. 8th Floor	Unit 1-8-2	Staff Office	105 CMR 451.360	Protective Measures: Rodent droppings observed Area cleaned – exterminator addressed the violation – 6/1/26
46. 8th Floor	Unit 1-8-2	Common Area	105 CMR 451.353	Interior Maintenance: Wall vent dusty near television mount Vent cleaned – 5/22/26
47. 8th Floor	Unit 1-8-2	Common Area	105 CMR 451.353	Interior Maintenance: Ceiling dirty outside of cell # 15 Ceiling cleaned – 5/22/26
48. 8th Floor	Unit 1-8-2	Recreation	105 CMR 451.353	Interior Maintenance: Ceiling vent dusty near

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
		Deck		Recreation Deck Vent cleaned – 5/22/26
49. 8th Floor	Unit 1-8-2	Cells	105 CMR 451.353	Interior Maintenance: Wall vent blocked in cell # 7, 9, and 10 Vents cleared – 5/22/26
50. 6th Floor	Meeting Room and Dining Hall		105 CMR 451.353*	Interior Maintenance: White substance observed on floor under sink Substance removed – 5/23/26
51. 6th Floor	Meeting Room and Dining Hall		105 CMR 451.360*	Protective Measures: Rodent droppings observed on windowsills and floor Area cleaned – exterminator addressed the violation – 6/1/26
52. 6th Floor	Unit 1-6-1	Upper Cells	105 CMR 451.353	Interior Maintenance: Wall vent blocked in cell # 20, 22, 23, 24, 27, 28, 30, 31, and 32 Vents cleared – 5/22/26
53. 6th Floor	Unit 1-6-1	Lower Cells	105 CMR 451.353	Interior Maintenance: Wall vent blocked in cell # 2, 5, 7, 8, 9, 12, and 15 Vents cleared – 5/22/26
54. 6th Floor	Unit 1-6-1	Lower Laundry Area	105 CMR 451.360	Protective Measures: Rodent droppings observed Area cleaned – exterminator addressed the violation – 6/1/26
55. 6th Floor	Unit 1-6-2	Common Area	105 CMR 451.353	Interior Maintenance: Ceiling vent dust near Recreation Deck Vent cleaned – 5/22/26
56. 6th Floor	Unit 1-6-2	Common Area	105 CMR 451.353	Interior Maintenance: Window sill dirty near Recreation Deck Window sill cleaned – 4/27/26
57. 6th Floor	Unit 1-6-2	Office	105 CMR 451.353	Interior Maintenance: Ceiling paint damaged Ceiling repaired – 6/3/26
58. 6th Floor	Unit 1-6-2	Upper Storage Closet # 757	105 CMR 451.360*	Protective Measures: Rodent droppings observed Area cleaned – exterminator addressed the violation – 6/1/26
59. 6th Floor	Unit 1-6-2	Upper Cells	105 CMR 451.353	Interior Maintenance: Wall vent blocked in cell # 17, 20, 25, 31, and 32 Vents cleared – 5/22/26
60. 6th Floor	Unit 1-6-2	Upper Cells	105 CMR 451.353	Interior Maintenance: Ceiling paint damaged in cell # 35 Ceiling repaired – 6/3/26
61. 6th Floor	Unit 1-6-2	Lower Cells	105 CMR 451.353	Interior Maintenance: Ceiling paint damaged in cell # 3 Ceiling repaired – 6/3/26
62. 6th Floor	Unit 1-6-2	Lower Cells	105 CMR 451.353	Interior Maintenance: Wall vent blocked in cell # 3, 9, 11, and 16 Vents cleared – 5/22/26
63. 6th Floor	Unit 1-6-2	Slop Sink Closet	105 CMR 451.353	Interior Maintenance: Objectionable odor observed Odor mitigated – 5/23/26
64. 5th Floor	Unit 1-5-1	Common Area	105 CMR 451.353	Interior Maintenance: Ceiling vent dusty near Recreation Deck

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
				Vent cleaned – 5/22/26
65. 5th Floor	Unit 1-5-1	Utility Closet # 540	105 CMR 451.353	Interior Maintenance: Wet mop stored upside down Mop removed from upside down position and stored properly – 4/27/26
66. 5th Floor	Unit 1-5-1	Utility Closet # 540	105 CMR 451.353	Interior Maintenance: Wet mop stored on floor Mop stored properly – 4/27/26
67. 5th Floor	Unit 1-5-1	Utility Closet # 540	105 CMR 451.353	Interior Maintenance: Standing water stored in bucket Water removed – 4/27/26
68. 5th Floor	Unit 1-5-1	Cells	105 CMR 451.353	Interior Maintenance: Wall vent blocked in cell # 5, 6, 7, 9, 10, 11, 12, 13, 14, 15, and 16 Vents cleared – 5/22/26
69. 5th Floor	Unit 1-5-1	Cells	105 CMR 451.353	Interior Maintenance: Ceiling paint damaged in cell # 8 Ceiling repaired – 6/3/26
70. 4th Floor	Unit 1-4-1	Cells	105 CMR 451.353*	Interior Maintenance: Wall vent blocked in cell # 4, 6, and 7 Vents cleared – 5/22/26
71. 4th Floor	Unit 1-4-1	Cells	105 CMR 451.353	Interior Maintenance: Wall vent blocked in cell # 2, 3, 5, 8, 10, 11, 12, 13, 15, and 16 Vents cleared – 5/22/26
72. 4th Floor	Unit 1-4-2	Common Area	105 CMR 451.353	Interior Maintenance: Ceiling vent dusty near Recreation Deck Vent cleaned – 5/22/26
73. 4th Floor	Unit 1-4-2	Kitchenette	105 CMR 451.360	Protective Measures: Rodent droppings observed below handwash sink Area cleaned – exterminator addressed the violation – 6/1/26
74. 4th Floor	Unit 1-4-2	Kitchenette	105 CMR 451.353	Interior Maintenance: Cabinet under handwash sink dirty Cabinet cleaned – 5/22/26
75. 4th Floor	Unit 1-4-2	Cells	105 CMR 451.353*	Interior Maintenance: Wall vent blocked in cell # 1 Vents cleared – 5/22/26
76. 4th Floor	Unit 1-4-2	Cells	105 CMR 451.353	Interior Maintenance: Wall vent blocked in cell # 2, 6, 7, 9, 15, and 16 Vents cleared – 5/22/26
77. 4th Floor	Unit 1-4-2	Cells	105 CMR 451.353	Interior Maintenance: Bed not secure to wall in cell # 2 Bed secured – 6/4/26
78. 3rd Floor	Supervisor's Office		105 CMR 451.353	Interior Maintenance: Ceiling vent blocked Vent cleared – 5/22/26
79. 3rd Floor	Office # 347		105 CMR 451.353	Interior Maintenance: Ceiling vent blocked Vent cleared – 5/22/26
80. 3rd Floor	Office # 347		105 CMR 451.353	Interior Maintenance: Ceiling vent dusty Vent cleaned – 5/22/26
81. 3rd Floor	Unit 1-3-1	Storage Room # 336	105 CMR 451.360	Protective Measures: Rodent droppings observed Room cleaned – exterminator addressed the violation – 6/1/26

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
82. 3rd Floor	Unit 1-3-1	Cells	105 CMR 451.353*	Interior Maintenance: Wall vent blocked in cell # 3, 4, 5, 11, and 12 Vents cleared – 5/22/26
83. 3rd Floor	Unit 1-3-1	Cells	105 CMR 451.353	Interior Maintenance: Wall vent blocked in cell # 1, 2, 6, 7, 8, and 10 Vents cleared – 5/22/26
84. 3rd Floor	Unit 1-3-1	Recreation Room	105 CMR 451.353	Interior Maintenance: Trash observed on floor Trash removed – 4/27/26
85. 3rd Floor	Unit 1-3-1	Recreation Deck	105 CMR 451.353	Interior Maintenance: Trash observed on floor Trash removed – 4/27/26
86. 3rd Floor	Unit 1-3-1	Recreation Deck	105 CMR 451.353	Interior Maintenance: Ceiling paint damaged Maintenance notified – ceiling will be repaired – anticipated repair date no later than 7/3/26
87. 3rd Floor	Unit 1-3-1	Recreation Deck	105 CMR 451.353	Interior Maintenance: Wall paint damaged Maintenance notified – wall will be repaired – anticipated repair date no later than 7/3/26
88. 3rd Floor	Unit 1-3-2	Recreation Room # 368	105 CMR 451.353	Interior Maintenance: Ceiling dusty outside room Ceiling cleaned – 5/22/26
89. 3rd Floor	Unit 1-3-2	Recreation Room # 368	105 CMR 451.353	Interior Maintenance: Light switch cover missing Cover replaced – 6/4/26
90. 3rd Floor	Unit 1-3-2	Recreation Room # 368	105 CMR 451.353	Interior Maintenance: Walls dirty Walls cleaned – 5/22/26
91. 3rd Floor	Unit 1-3-2	Recreation Room # 368	105 CMR 451.353	Interior Maintenance: Trash observed on floor Trash removed – 4/27/26
92. 3rd Floor	Unit 1-3-2	Recreation Room # 368	105 CMR 451.353	Interior Maintenance: Ceiling vent dusty Vent cleaned – 5/22/26
93. 3rd Floor	Unit 1-3-2	Recreation Room # 368	105 CMR 451.346	Safe Wiring: Inappropriate use of temporary wiring, extension cord through door Extension cord removed – 4/27/26
94. 3rd Floor	Unit 1-3-2	Kitchenette	105 CMR 451.353	Interior Maintenance: Wall vent dusty near Kitchenette Wall cleaned – 5/22/26
95. 3rd Floor	Unit 1-3-2	Kitchenette	105 CMR 451.360	Protective Measures: Rodent droppings observed under handwash sink Area cleaned – exterminator addressed the violation – 6/1/26
96. 3rd Floor	Unit 1-3-2	Kitchenette	105 CMR 451.360	Protective Measures: Cabinet under handwash sink dirty Area cleaned – 5/22/26
97. 3rd Floor	Unit 1-3-2	Cells	105 CMR 451.353*	Interior Maintenance: Wall vent blocked in cell # 1, 2, 4, 6, 7, and 8 Vent cleaned – 5/22/26
98. 3rd Floor	Unit 1-3-2	Cells	105 CMR 451.353	Interior Maintenance: Wall vent blocked in cell # 3, 5, 8, 9, 10, 12, and 15 Vents cleaned – 5/22/26
99. 3rd Floor	Unit 1-3-2	Cells	105 CMR 451.353	Interior Maintenance: Ceiling paint damaged in cell # 1, 2, 3, 4, 5, 7, 8, 10, and 12 Ceilings repaired – 6/5/26
100. 3rd Floor	Unit 1-3-2	Cells	105 CMR 451.353	Interior Maintenance: Door dirty at cell # 8 Door cleaned – 4/27/26

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
101. 2nd Floor			105 CMR 451.353	Interior Maintenance: Ceiling tiles water damaged in hallway Tiles replaced – 6/4/26
102. 2nd Floor			105 CMR 451.353	Interior Maintenance: Ceiling vent dusty in Room # 257 Vent cleaned – 5/22/26
103. 2nd Floor	Mosque # 269		105 CMR 451.353*	Interior Maintenance: Ceiling damaged Ceiling repaired - 6/3/26
104. 2nd Floor	Mosque # 269		105 CMR 451.353*	Interior Maintenance: Mold on ceiling Mold removed – 6/3/36
105. 2nd Floor	Unit 1-2-1	Common Area	105 CMR 451.353*	Interior Maintenance: Ceiling water damaged Ceiling repaired – 6/5/26
106. 2nd Floor	Unit 1-2-1	Slop Sink Room # 229	105 CMR 451.353	Interior Maintenance: Wet mop stored upside down Mop removed from upside down position and stored properly – 4/27/26
107. 2nd Floor	Unit 1-2-1	Slop Sink Room # 229	105 CMR 451.360	Protective Measures: Rodent droppings observed Room cleaned – exterminator addressed the violation – 6/1/26
108. 2nd Floor	Unit 1-2-1	Closet # 236	105 CMR 451.360	Protective Measures: Rodent droppings observed Closet cleaned – exterminator addressed the violation – 6/1/26
109. 2nd Floor	Unit 1-2-1	Cells	105 CMR 451.353*	Interior Maintenance: Ceiling damaged in cell # 28 and 30 Ceiling repaired – 6/5/26
110. 2nd Floor	Unit 1-2-1	Cells	105 CMR 451.353*	Interior Maintenance: Ceiling vent blocked in cell # 21, 28, and 29 Vents cleared – 5/22/26
111. 2nd Floor	Unit 1-2-1	Cells	105 CMR 451.353*	Interior Maintenance: Mold on ceiling in cell # 28 Mold removed – 5/21/26
112. 2nd Floor	Unit 1-2-1	Cells	105 CMR 451.353	Interior Maintenance: Ceiling paint damaged in cell # 14 and 16 Ceilings repaired – 6/5/26
113. 2nd Floor	Unit 1-2-1	Cells	105 CMR 451.353	Interior Maintenance: Ceiling vent blocked in cell # 22, 23, 24, 25, 26, 27, 30, and 31 Vents cleared – 5/22/26
114. 2nd Floor	Unit 1-2-1	Cells	105 CMR 451.353	Interior Maintenance: Door window cracked in cell # 30 Operations & Planning notified – contractor will replace window glass – anticipated date of repairs no later than 6/28/26
115. 2nd Floor	Unit 1-2-1	Laundry Room	105 CMR 451.353	Interior Maintenance: Ceiling paint damaged Ceiling repaired – 6/5/26
116. 1st Floor	Re-Entry Center	Staff Bathroom # 121	105 CMR 451.353	Interior Maintenance: Ceiling damaged Ceiling repaired – 6/5/26

Building #2

Deficiencies under the Required Standards (.100 and .200 series)

1 new deficiency was found during the inspection:

Area	Regulation	Description of Deficiency
1. Staff Lounge	105 CMR 451.200	Food Storage, Preparation and Service: Food storage not in compliance with 105 CMR 590.000, interior of freezer dirty Freezer cleaned – 6/1/26

Building #3

Deficiencies under the Required Standards (.100 and .200 series)

42 new deficiencies and 38 repeat deficiencies (indicated by an *) were found during the inspection:

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
1. 4th Floor	Staff Bathroom		105 CMR 451.123	Maintenance: Ceiling vent dusty Vent cleaned – 5/22/25
2. 4th Floor	Unit 3-3	Staff Bathroom	105 CMR 451.123	Maintenance: Ceiling vent dusty Vent cleaned – 5/22/25
3. 4th Floor	Unit 3-3	Lower Shower Area	105 CMR 451.123*	Maintenance: Ceiling vent dusty in shower # 1, 2, 3, 4, and 5 Vents cleaned – 5/22/25
4. 4th Floor	Unit 3-3	Lower Shower Area	105 CMR 451.123*	Maintenance: Ceiling paint damaged in shower # 2 Ceiling repaired – 6/10/26
5. 4th Floor	Unit 3-3	Lower Shower Area	105 CMR 451.123*	Maintenance: Ceiling damaged outside showers Ceiling repaired – 6/10/26
6. 4th Floor	Unit 3-3	Lower Shower Area	105 CMR 451.123*	Maintenance: Door frame rusted in shower # 4 and 5 Maintenance notified – frame will be repaired – anticipated repair date no later than 7/3/26
7. 4th Floor	Unit 3-3	Lower Shower Area	105 CMR 451.123*	Maintenance: Mold on ceiling in shower # 5 Mold removed – 5/21/26
8. 4th Floor	Unit 3-3	Lower Shower Area	105 CMR 451.123*	Maintenance: Bottom of door frame separating from wall outside shower # 5 Maintenance notified – frame will be repaired– anticipated repair date no later than 7/3/26
9. 4th Floor	Unit 3-3	Lower Shower Area	105 CMR 451.123*	Maintenance: Access panel rusted in shower # 5 Panel repaired – 6/10/26
10. 4th Floor	Unit 3-3	Lower Shower Area	105 CMR 451.123*	Maintenance: Walls dirty in shower # 5 Walls cleaned – 4/28/26
11. 4th Floor	Unit 3-3	Lower Shower Area	105 CMR 451.123	Maintenance: Drain flies observed in shower # 1 Shower cleaned – exterminator addressed the violation – 6/1/26
12. 4th Floor	Unit 3-3	Lower Shower Area	105 CMR 451.123	Maintenance: Door frame rusted in shower # 1 and 3

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
				Maintenance notified – frames will be repaired – anticipated repair date not later than 7/3/26
13. 4th Floor	Unit 3-3	Lower Shower Area	105 CMR 451.123	Maintenance: Door frame damaged in shower # 4 Maintenance notified – frame will be repaired – anticipated repair date not later than 7/3/26
14. 4th Floor	Unit 3-3	Lower Shower Area	105 CMR 451.123	Maintenance: Dead drain flies observed on ceiling in shower # 5 Ceiling cleaned – exterminator addressed the violation – 6/1/26
15. 4th Floor	Unit 3-3	Kitchenette	105 CMR 451.200	Food Storage, Preparation and Service: Food preparation not in compliance with 105 CMR 590.000, interior of microwave oven dirty Microwave cleaned – 4/28/26
16. 4th Floor	Unit 3-3	Upper Shower Area	105 CMR 451.123*	Maintenance: Ceiling vent dusty in shower # 6 and 10 Vents cleaned -5/23/26
17. 4th Floor	Unit 3-3	Upper Shower Area	105 CMR 451.123*	Maintenance: Ceiling paint damaged in shower # 10 Ceiling repaired – 6/10/26
18. 4th Floor	Unit 3-3	Upper Shower Area	105 CMR 451.123*	Maintenance: Door frame paint damaged in shower # 6 Frame repaired – 6/10/26
19. 4th Floor	Unit 3-3	Upper Shower Area	105 CMR 451.123*	Maintenance: Access panel rusted in shower # 10 Panel repaired – 6/10/26
20. 4th Floor	Unit 3-3	Upper Shower Area	105 CMR 451.123*	Maintenance: Walls dirty in shower # 10 Walls cleaned – 4/28/26
21. 4th Floor	Unit 3-3	Upper Shower Area	105 CMR 451.123*	Maintenance: Metal brackets rusted in shower # 10 Maintenance notified – brackets will be repaired – anticipated repair date no later than 7/3/26
22. 4th Floor	Unit 3-3	Upper Shower Area	105 CMR 451.123*	Maintenance: Metal brackets rusted in shower # 10 Maintenance notified – brackets will be repaired– anticipated repair date no later than 7/3/26
23. 4th Floor	Unit 3-3	Upper Shower Area	105 CMR 451.123	Maintenance: Mold on ceiling in shower # 6 and 10 Mold remove – 5/22/26
24. 4th Floor	Unit 3-3	Upper Shower Area	105 CMR 451.123	Maintenance: Ceiling vent dusty in shower # 8 Vent cleaned - 5/23/26
25. 4th Floor	Unit 3-3	Slop Sink Room	105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, drain cover missing at slop sink

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
26. 4th Floor	Unit 3-4	Handicapped Shower # 3491	105 CMR 451.123*	Maintenance: Wall vent dusty outside shower Cover installed – 6/4/26
27. 4th Floor	Unit 3-4	Handicapped Shower # 3491	105 CMR 451.123	Maintenance: Ceiling vent dusty Vent cleaned – 5/23/26
28. 4th Floor	Unit 3-4	Staff Bathroom # 3494	105 CMR 451.123	Maintenance: Ceiling vent dusty Vent cleaned – 5/23/26
29. 4th Floor	Unit 3-4	Lower Shower Area	105 CMR 451.123*	Maintenance: Ceiling vent dusty in shower # 2, 3, and 4 Vents cleaned – 5/23/26
30. 4th Floor	Unit 3-4	Lower Shower Area	105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, shower # 1 and 5 out-of-order Showers repaired and placed back on-line – 6/6/26
31. 4th Floor	Unit 3-4	Lower Shower Area	105 CMR 451.130	Hot Water: Shower water temperature 90°F at shower # 2 Water temperature adjusted to meet the appropriate regulatory requirements – 6/15/26
32. 4th Floor	Unit 3-4	Upper Shower Area	105 CMR 451.123*	Maintenance: Ceiling vent dusty in shower # 6 and 10 Vents cleaned – 4/28/26
33. 4th Floor	Unit 3-4	Upper Shower Area	105 CMR 451.123*	Maintenance: Walls dirty in shower # 7 Walls cleaned – 4/28/26
34. 4th Floor	Unit 3-4	Upper Shower Area	105 CMR 451.123*	Maintenance: Floor damaged around drain in shower # 10 Floor repaired – 6/9/26
35. 4th Floor	Unit 3-4	Upper Shower Area	105 CMR 451.123	Maintenance: No curtain at shower # 6 Curtain installed – 5/23/26
36. 4th Floor	Unit 3-4	Upper Shower Area	105 CMR 451.123	Maintenance: Ceiling vent dusty in shower # 7 Vents cleaned – 5/23/26
37. 4th Floor	Unit 3-4	Upper Shower Area	105 CMR 451.123	Maintenance: Mold on wall in shower # 7 Mold removed – 5/22/26
38. 4th Floor	Unit 3-4	Upper Shower Area	105 CMR 451.123	Maintenance: Wall paint damaged in shower # 7 Wall repaired – 6/8/26
39. 4th Floor	Unit 3-4	Upper Shower Area	105 CMR 451.123	Maintenance: Ceiling paint damaged in shower # 9 Ceiling repaired – 6/8/26
40. 4th Floor	Unit 3-4	Cells	105 CMR 451.103	Mattresses: Mattress cover missing in cell # 22 and 56 Mattresses replaced – 5/23/26
41. 4th Floor	Unit 3-4	Cells	105 CMR 451.101	Blankets: Blanket damaged in cell # 39 Blanket replaced -5/23/26
42. 3rd Floor	Staff Bathroom		105 CMR 451.123	Maintenance: Ceiling vent dusty

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
	# 3378			Vent cleaned - 5/23/26
43. 2nd Floor	Unit 3-1	Lower Shower Area	105 CMR 451.123	Maintenance: Door frame rusted in shower # 5 Maintenance notified – frame will be repaired – anticipated repair date no later than 7/3/26
44. 2nd Floor	Unit 3-1	Cells	105 CMR 451.103	Mattresses: Mattress cover missing in cell # 41 Mattresses replaced – 5/23/26
45. 2nd Floor	Unit 3-2	Handicapped Shower # 3293	105 CMR 451.123	Maintenance: Debris in floor drain Debris removed – 4/28/26
46. 2nd Floor	Unit 3-2	Lower Shower Area	105 CMR 451.123*	Maintenance: Ceiling paint damaged in shower # 4 Ceiling repaired – 6/3/26
47. 2nd Floor	Unit 3-2	Lower Shower Area	105 CMR 451.123*	Maintenance: Floor damaged around drain in shower # 5 Floor repaired – 6/15/26
48. 2nd Floor	Unit 3-2	Lower Shower Area	105 CMR 451.123*	Maintenance: Walls dirty in shower # 4 Walls cleaned – 4/28/26
49. 2nd Floor	Unit 3-2	Lower Shower Area	105 CMR 451.123*	Maintenance: Ceiling vent dusty in shower # 1 Vent cleaned – 5/22/26
50. 2nd Floor	Unit 3-2	Lower Shower Area	105 CMR 451.123*	Maintenance: Dead drain flies observed on ceiling in shower # 4 Ceiling cleaned – exterminator addressed the violation – 6/1/26
51. 2nd Floor	Unit 3-2	Lower Shower Area	105 CMR 451.123*	Maintenance: Door frame rusted in shower # 4 Maintenance notified – frame will be repaired – anticipated repair date no later than 7/3/26
52. 2nd Floor	Unit 3-2	Lower Shower Area	105 CMR 451.123	Maintenance: Objectionable odor observed in shower # 2 and 5 Odor mitigated – 4/28/26
53. 2nd Floor	Unit 3-2	Kitchenette	105 CMR 451.200*	Food Storage, Preparation and Service: Food preparation not in compliance with 105 CMR 590.000, interior of microwave oven # 1 dirty Microwave cleaned – 4/28/26
54. 2nd Floor	Unit 3-2	Kitchenette	105 CMR 451.200	Food Storage, Preparation and Service: Food preparation not in compliance with 105 CMR 590.000, interior of microwave oven # 2 dirty Microwave cleaned – 4/28/26
55. 2nd Floor	Unit 3-2	Kitchenette	105 CMR 451.200	Food Storage, Preparation and Service: Food preparation not in compliance with 105 CMR 590.000, handle missing

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
				on microwave oven # 2 Microwave replaced – 6/1/26
56. 2nd Floor	Unit 3-2	Upper Shower Area	105 CMR 451.123*	Maintenance: Dead drain flies observed on ceiling in shower # 10 Ceiling cleaned – exterminator addressed the violation – 6/1/26
57. 2nd Floor	Unit 3-2	Upper Shower Area	105 CMR 451.123	Maintenance: Dead drain flies observed on ceiling in shower # 7 Ceiling cleaned – exterminator addressed the violation – 6/1/26
58. 2nd Floor	Unit 3-2	Upper Shower Area	105 CMR 451.123*	Maintenance: Walls dirty in shower # 7 Walls cleaned – 4/28/26
59. 2nd Floor	Unit 3-2	Cells	105 CMR 451.103	Mattresses: Mattress damaged in cell # 22 Mattress replaced – 5/23/26
60. 2nd Floor	Unit 3-2	Cells	105 CMR 451.103	Mattresses: Mattress cover missing in cell # 38, 45, and 54 Mattresses replaced – 5/23/36
61. 1st Floor	Education Area	Inmate Bathroom # 3162	105 CMR 451.123	Maintenance: Ceiling paint damaged Ceiling repaired – 6/2/26
62. 1st Floor	Education Area	Inmate Bathroom # 3162	105 CMR 451.123	Maintenance: Floor paint damaged Floor repaired – 6/2/26
63. 1st Floor	Education Area	Inmate Bathroom # 3162	105 CMR 451.123	Maintenance: Standing water on floor Water removed – 4/28/26
64. 1st Floor	Canteen	Canteen Bathroom	105 CMR 451.123	Maintenance: Ceiling vent dusty Vent cleaned – 5/23/36

Deficiencies under the Recommended Standards (.300 series)

93 new deficiencies and 47 repeat deficiencies (indicated by an *) were found during the inspection:

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
1. All Cells			105 CMR 451.320*	Cell Size: Inadequate floor space in all cells Cell design does not allow the facility to provide adequate floor space
2. 4th Floor	Unit 3-3	Common Area	105 CMR 451.353*	Interior Maintenance: Wall damaged near stairs near cell # 13 Maintenance notified – wall will be repaired – anticipated repair date not later than 7/3/26
3. 4th Floor	Unit 3-3	Case Worker's Office	105 CMR 451.353	Interior Maintenance: Ceiling vent blocked Vent cleared – 5/23/26
4. 4th Floor	Unit 3-3	Case Worker's Office	105 CMR 451.353	Interior Maintenance: Ceiling vent dusty Vent cleaned – 5/23/26

	Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
5.	4th Floor	Unit 3-3	Lower Laundry Area	105 CMR 451.353	Interior Maintenance: Dryer vent not properly connected Vent reconnected – 5/23/26
6.	4th Floor	Unit 3-3	Kitchenette	105 CMR 451.353	Interior Maintenance: Ceiling beam damaged near Kitchenette Maintenance notified –beam will be repaired – anticipated repair date no later than 7/3/26
7.	4th Floor	Unit 3-3	Upper Laundry Area	105 CMR 451.360*	Protective Measures: Rodent droppings observed Area cleaned – exterminator addressed the violation – 6/1/26
8.	4th Floor	Unit 3-3	Slop Sink Room	105 CMR 451.360*	Protective Measures: Rodent droppings observed Room cleaned – exterminator addressed the violation – 6/1/26
9.	4th Floor	Unit 3-3	Slop Sink Room	105 CMR 451.353*	Interior Maintenance: Ceiling vent dusty Vent cleaned – 5/23/26
10.	4th Floor	Unit 3-3	Uniform Storage Room # 3566	105 CMR 451.360	Protective Measures: Rodent droppings observed Room cleaned – exterminator addressed the violation – 6/1/26
11.	4th Floor	Unit 3-3	Cells	105 CMR 451.353*	Interior Maintenance: Wall vent blocked in cell # 20, 22, 28, 30, 34, 35, 37, 46, 48, 61, 62, and 63 Vents cleared – 5/23/26
12.	4th Floor	Unit 3-3	Cells	105 CMR 451.353*	Interior Maintenance: Ceiling paint damaged in cell # 10, 40, and 43 Ceilings repaired – 6/4/26
13.	4th Floor	Unit 3-3	Cells	105 CMR 451.353	Interior Maintenance: Food debris in window sill near cell # 60 Food debris removed – 4/28/26
14.	4th Floor	Unit 3-3	Cells	105 CMR 451.353	Interior Maintenance: Wall dirty near cell # 16 and 28 Walls cleaned – 4/28/26
15.	4th Floor	Unit 3-3	Cells	105 CMR 451.353	Interior Maintenance: Ceiling paint damaged in cell # 15, 29, 34, 37, 38, 39, 42, 45, 46, 49, 61, and 63 Vents cleared – 5/23/26
16.	4th Floor	Unit 3-3	Cells	105 CMR 451.353	Interior Maintenance: Wall vent blocked in cell # 24, 33, 34, 41, 47, 49, 51, 52, 55, 59, and 64 Vents cleared – 5/23/26
17.	4th Floor	Unit 3-3	Cells	105 CMR 451.360	Protective Measures: Rodent droppings observed on window sill near cell # 28 Ceiling cleaned – exterminator addressed the violation – 6/1/26
18.	4th Floor	Unit 3-4	Common Area	105 CMR 451.353*	Interior Maintenance: Floor tiles

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
				missing and damaged Maintenance notified – floor tiles will be replaced – anticipated repair date no later than 7/6/26
19. 4th Floor	Unit 3-4	Recreation Deck	105 CMR 451.353*	Interior Maintenance: Wall paint damaged Maintenance notified – wall will be repaired – anticipated repair date no later than 7/3/26
20. 4th Floor	Unit 3-4	Recreation Deck	105 CMR 451.350	Structural Maintenance: Wall panels rotted on Recreation Deck Maintenance notified – panels will be repaired – anticipated repair date no later than 7/8/26
21. 4th Floor	Unit 3-4	Closet # 3492	105 CMR 451.353	Interior Maintenance: Floor dirty Floor cleaned – 4/28/26
22. 4th Floor	Unit 3-4	Lower Laundry Area	105 CMR 451.353	Interior Maintenance: Dryer vent not connected properly Vent reconnected – 5/23/26
23. 4th Floor	Unit 3-4	Uniform Storage # 3581	105 CMR 451.360*	Protective Measures: Rodent droppings observed Room cleaned – exterminator addressed the violation – 6/1/26
24. 4th Floor	Unit 3-4	Uniform Storage # 3581	105 CMR 451.344	Illumination in Habitable Areas: Light(s) not functioning properly, light out Light repaired – 6/4/26
25. 4th Floor	Unit 3-4	Cells	105 CMR 451.353*	Interior Maintenance: Wall vent blocked in cell # 3, 17, 21, 22, 26, 27, 43, and 51 Vents cleared – 5/23/26
26. 4th Floor	Unit 3-4	Cells	105 CMR 451.353*	Interior Maintenance: Ceiling paint damaged in cell # 8, 10, 11, 13, 15, 28, 43, 45, and 60 Ceilings repaired – 6/8/26
27. 4th Floor	Unit 3-4	Cells	105 CMR 451.353	Interior Maintenance: Wall vent blocked in cell # 7, 13, 14, 16, 19, and 46 Vents cleared – 5/23/26
28. 4th Floor	Unit 3-4	Cells	105 CMR 451.353	Interior Maintenance: Wall paint damaged in cell # 4, 40, 58, and 59 Walls repaired – 6/8/26
29. 4th Floor	Unit 3-4	Cells	105 CMR 451.353	Interior Maintenance: Ceiling paint damaged in cell # 21, 23, 30, and 64 Ceilings repaired – 6/8/26
30. 2nd Floor	Unit 3-1	Case Worker's Office # 3269	105 CMR 451.353	Interior Maintenance: Ceiling vent dusty Vent cleaned – 5/23/26
31. 2nd Floor	Unit 3-1	Kitchenette	105 CMR 451.353	Interior Maintenance: Floor dirty under handwash sink Floor cleaned – 4/28/26

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
32. 2nd Floor	Unit 3-1	Common Area	105 CMR 451.353	Interior Maintenance: Floor dirty in mechanical room between cell # 5 and 6 Vents cleaned – 5/23/26
33. 2nd Floor	Unit 3-1	Common Area	105 CMR 451.360	Protective Measures: Rodent droppings observed on floor in mechanical room between cell # 5 and 6 Room cleaned – exterminator addressed the violation – 6/1/26
34. 2nd Floor	Unit 3-1	Cells	105 CMR 451.353*	Interior Maintenance: Wall vent blocked in cell # 62 Vent cleared – 5/23/26
35. 2nd Floor	Unit 3-1	Cells	105 CMR 451.353	Interior Maintenance: Wall vent blocked in cell # 2, 4, 5, 14, 22, 33, 40, 43, 58, and 59 Vents cleared – 5/23/26
36. 2nd Floor	Unit 3-1	Cells	105 CMR 451.344	Illumination in Habitable Areas: Light(s) not functioning properly, light out in cell # 19 Light repaired – 6/15/26
37. 2nd Floor	Unit 3-1	Cells	105 CMR 451.353	Interior Maintenance: Ceiling paint damaged in cell # 2, 15, 47, and 58 Ceilings repaired – 6/4/26
38. 2nd Floor	Unit 3-2	Storage Closet # 3294	105 CMR 451.353	Interior Maintenance: Standing water stored in mop bucket Water removed – 4/28/26
39. 2nd Floor	Unit 3-2	Upper Laundry Area	105 CMR 451.360	Protective Measures: Rodent droppings observed Area cleaned – exterminator addressed the violation – 6/1/26
40. 2nd Floor	Unit 3-2	Cells	105 CMR 451.353*	Interior Maintenance: Ceiling paint damaged in cell # 21 and 35 Ceilings repaired – 6/4/26
41. 2nd Floor	Unit 3-2	Cells	105 CMR 451.353*	Interior Maintenance: Wall vent blocked in cell # 27 Vent cleared – 5/23/26
42. 2nd Floor	Unit 3-2	Cells	105 CMR 451.353	Interior Maintenance: Ceiling paint damaged in cell # 4, 8, 16, 25, 33, 36, 46, and 49 Ceilings repaired – 6/4/26
43. 2nd Floor	Unit 3-2	Cells	105 CMR 451.353	Interior Maintenance: Wall vent blocked in cell # 8, 10, 11, 16, 20, 24, 55, and 62 Vents cleared – 5/23/26
44. 2nd Floor	Unit 3-2	Cells	105 CMR 451.353	Interior Maintenance: Wall paint damaged in cell # 15 and 25 Walls repaired – 6/4/26
45. 2nd Floor	Unit 3-2	Cells	105 CMR 451.353	Interior Maintenance: Ceiling water damaged in cell # 56 Ceiling repaired – 6/4/26

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
46. 1st Floor	Education Area		105 CMR 451.353	Interior Maintenance: Ceiling water damaged throughout Maintenance notified – ceiling will be repaired – anticipated repair date no later than 7/6/26
47. 1st Floor	Education Area	Classrooms	105 CMR 451.353*	Interior Maintenance: Mold on ceiling outside of Room # 3132 Ceiling cleaned – mold removed - – 5/20/26
48. 1st Floor	MAT Outside Classroom		105 CMR 451.350*	Structural Maintenance: Ceiling tiles missing and water damaged Tiles replaced – 6/15/26
49. 1st Floor	Canteen		105 CMR 451.350*	Structural Maintenance: Ceiling tiles missing and water damaged Tiles replaced / installed – 6/15/26
50. 1st Floor	Main Laundry	Hallway	105 CMR 451.353	Interior Maintenance: Area around ceiling vent dusty Area cleaned – 6/1/26

Building #4

Deficiencies under the Required Standards (.100 and .200 series)

47 new deficiencies and 13 repeat deficiencies (indicated by an *) were found during the inspection:

Area	Sub Area # 1	Regulation	Description of Deficiency
1. Unit 4-1	Common Area	105 CMR 451.200	Food Storage, Preparation and Service: Food preparation not in compliance with 105 CMR 590.000, interior of microwave oven dirty near telephones and cell # 5 Microwave cleaned – 4/29/26
2. Unit 4-1	Lower Shower Area	105 CMR 451.123	Maintenance: Ceiling vent dusty in shower # 1 Vent cleaned – 5/23/26
3. Unit 4-1	Lower Shower Area	105 CMR 451.123	Maintenance: Drain flies observed in shower # 2 and 3 Showers cleaned - exterminator addressed the violation – 6/1/26
4. Unit 4-1	Lower Shower Area	105 CMR 451.123	Maintenance: No curtain at shower # 4 Curtain installed – 5/24/26
5. Unit 4-1	Lower Shower Area	105 CMR 451.123	Maintenance: Debris in drain in shower # 5 Debris removed - 4/29/26
6. Unit 4-1	Upper Shower Area	105 CMR 451.123*	Maintenance: Walls dirty in shower # 7, 8, 9, and 12 Walls cleaned – 4/29/26
7. Unit 4-1	Upper Shower Area	105 CMR 451.123*	Maintenance: Ceiling vent dusty in shower # 8 Vent cleaned – 5/24/26
8. Unit 4-1	Upper Shower Area	105 CMR 451.123	Maintenance: Walls dirty in shower # 10 Walls cleaned – 4/29/26
9. Unit 4-1	Upper Shower Area	105 CMR 451.123	Maintenance: Ceiling vent dusty in shower # 7 Vent cleaned – 5/24/26
10. Unit 4-1	Upper Shower Area	105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, shower # 9 leaking Shower repaired - 6/4/26

Area	Sub Area # 1	Regulation	Description of Deficiency
11. Unit 4-1	Cells	105 CMR 451.103	Mattresses: Mattress cover missing in cell # 20 Mattress replaced – 5/24/26
12. Unit 4-2	Kitchenette	105 CMR 451.200	Food Storage, Preparation and Service: Food preparation not in compliance with 105 CMR 590.000, interior of microwave oven dirty Microwave cleaned – 4/29/26
13. Unit 4-2	1st Tier Bathroom # 4257 and 4268	105 CMR 451.123	Maintenance: Ceiling vent dusty Vent cleaned – 5/24/26
14. Unit 4-2	1st Tier Bathroom # 4257 and 4268	105 CMR 451.123	Maintenance: Drain flies observed Area cleaned – exterminator addressed the violation – 6/1/26
15. Unit 4-2	1st Tier Bathroom # 4257 and 4268	105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, handwash sink # 1 out-of-order Sink repaired -placed back on-line – 6/4/26
16. Unit 4-2	1st Tier Bathroom # 4257 and 4268	105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, urinal # 1 out-of-order Urinal repaired - placed back on-line – 6/4/26
17. Unit 4-2	1st Tier Bathroom # 4257 and 4268	105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, toilet # 5 out-of-order Toilet repaired - placed back on-line – 6/4/26
18. Unit 4-2	1st Tier Bathroom # 4257 and 4268	105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, handwash sink # 7 leaking Sink repaired – 6/4/26
19. Unit 4-2	1st Tier Bathroom # 4257 and 4268	105 CMR 451.123	Maintenance: Standing water observed on floor Water removed – 4/29/26
20. Unit 4-2	1st Tier Bathroom # 4285 and 4275	105 CMR 451.130*	Plumbing: Plumbing not maintained in good repair, toilet # 1 out-of-order Toilet repaired - placed back on-line – 6/4/26
21. Unit 4-2	1st Tier Bathroom # 4285 and 4275	105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, toilet # 2 out-of-order Toilet repaired - placed back on-line – 6/4/26
22. Unit 4-2	2nd Tier Bathroom # 4366 and 4354	105 CMR 451.123	Maintenance: Floor dirty Floor cleaned – 4/29/26
23. Unit 4-2	2nd Tier Bathroom # 4366 and 4354	105 CMR 451.123	Maintenance: Dead insects observed on floor Floor cleaned – 5/20/26
24. Unit 4-2	2nd Tier Bathroom # 4374 and 4387	105 CMR 451.117	Toilet Fixtures: Toilet fixtures dirty in stall # 1, 2, and 4 Fixtures cleaned – 5/24/26
25. Unit 4-2	2nd Tier Bathroom # 4374 and 4387	105 CMR 451.117	Toilet Fixtures: Urinal # 3 dirty Urinal cleaned – 5/24/26
26. Unit 4-2	2nd Tier Bathroom # 4374 and 4387	105 CMR 451.123	Maintenance: Floor dirty Floor cleaned – 5/24/26
27. Unit 4-3	Common Area	105 CMR 451.200	Food Storage, Preparation and Service: Food preparation not in compliance with 105 CMR 590.000, interior of microwave oven dirty near cell # 5 and 8 Microwave cleaned – 4/29/26
28. Unit 4-3	Lower Shower Area	105 CMR 451.123*	Maintenance: Walls dirty in shower # 1, 2, and 3 Walls cleaned – 4/29/26
29. Unit 4-3	Lower Shower Area	105 CMR 451.123*	Maintenance: Ceiling vent dusty in shower # 1, 2, and 3

Area	Sub Area # 1	Regulation	Description of Deficiency
			Vents cleaned – 4/29/26
30. Unit 4-3	Lower Shower Area	105 CMR 451.123	Maintenance: Drain flies observed in shower # 1, 5, and 6 Shower cleaned – exterminator addressed violation – 6/1/26
31. Unit 4-3	Lower Shower Area	105 CMR 451.123	Maintenance: Door frame rusted in shower # 1, 2, 3, 4, and 5 Maintenance notified – frames will be repaired – anticipated date of repairs no later than 7/6/26
32. Unit 4-3	Lower Shower Area	105 CMR 451.123	Maintenance: Curtain dirty in shower # 2 and 4 Curtains replaced – 5/24/26
33. Unit 4-3	Lower Shower Area	105 CMR 451.123	Maintenance: Ceiling vent dusty in shower # 6 Vent cleaned – 5/24/26
34. Unit 4-3	Upper Shower Area	105 CMR 451.123*	Maintenance: Ceiling vent dusty in shower # 8 Vent cleaned – 5/24/26
35. Unit 4-3	Upper Shower Area	105 CMR 451.123	Maintenance: Ceiling vent dusty in shower # 7, 9, 10, and 11 Vents cleaned – 5/24/26
36. Unit 4-3	Upper Shower Area	105 CMR 451.123	Maintenance: Walls dirty in shower # 8 and 11 Walls cleaned – 4/29/26
37. Unit 4-3	Upper Shower Area	105 CMR 451.123	Maintenance: Drain flies observed in shower # 12 Shower cleaned – exterminator addressed violation – 6/1/26
38. Unit 4-3	Upper Shower Area	105 CMR 451.123	Maintenance: Dead drain flies observed on ceiling in shower # 12 Ceiling cleaned – exterminator addressed violation – 6/1/26

Deficiencies under the Recommended Standards (.300 series)

4 new deficiencies and 1 repeat deficiency (indicated by an *) were found during the inspection:

Area	Sub Area # 1	Regulation	Description of Deficiency
1. Dining Hall # 4137		105 CMR 451.353	Interior Maintenance: Wet mop stored in bucket Mop removed – 4/29/26
2. Unit 4-2	Common Area	105 CMR 451.353	Interior Maintenance: Ceiling vents dusty Vents cleaned – 5/24/26
3. Unit 4-2	Common Area	105 CMR 451.353	Interior Maintenance: Ceiling tiles dusty Tiles cleaned – 6/8/26
4. Unit 4-2	Laundry Area	105 CMR 451.353	Interior Maintenance: Dryer vent not properly connected Vent reconnected – 5/24/26
5. Unit 4-2	2nd Tier Utility Room # 4388	105 CMR 451.360*	Protective Measures: Rodent droppings observed Room cleaned – exterminator addressed the violation – 6/1/26

Building #5

Deficiencies under the Required Standards (.100 and .200 series)

70 new deficiencies and 40 repeat deficiencies (indicated by an *) were found during the inspection:

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
1. Food Service	Section 1	Inmate Locker	105 CMR 451.123*	Maintenance: Soap dispenser

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
Area		Room		damaged Dispenser replaced – 6/8/26
2. Food Service Area	Section 1	Inmate Locker Room	105 CMR 451.123*	Maintenance: Floor paint damaged Painting Supervisor notified – floor will be repaired – anticipated repair date no later than 7/6/26
3. Food Service Area	Section 1	Inmate Locker Room	105 CMR 451.123*	Maintenance: Ceiling dirty Ceiling cleaned – 5/20/26
4. Food Service Area	Section 1	Inmate Locker Room	105 CMR 451.123*	Maintenance: Insects observed Room cleaned – exterminator addressed the violation – 6/1/26
5. Food Service Area	Section 1	Inmate Locker Room	105 CMR 451.123*	Maintenance: Encrusted food debris on trash can Trash can cleaned – 4/27/26
6. Food Service Area	Section 1	Slop Sink Room	105 CMR 451.200*	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Facility not cleaned as often as necessary, standing water observed. Standard found in 105 CMR 590; FC 6-501.12(A). Water removed – 4/27/26
7. Food Service Area	Section 1	Slop Sink Room	105 CMR 451.200	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Wet mop stored in bucket. Standard found in 105 CMR 590; FC 6-501.16. Mop removed – 4/27/26
8. Food Service Area	Section 1	Slop Sink Room	105 CMR 451.200	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Standing water stored in mop bucket. Standard found in 105 CMR 590; FC 6-501.16. Water removed – 4/27/26
9. Food Service Area	Section 1	Slop Sink Room	105 CMR 451.200	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Facility not cleaned as often as necessary, slop sink dirty. Standard found in 105 CMR 590; FC 6-501.12(A). Sink cleaned – 4/27/26
10. Food Service Area	Section 1	Chemical Storage	105 CMR 451.200*	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Premises not maintained free of rodents, rodent droppings observed.

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
				Standard found in 105 CMR 590; FC 6-501.111. ** Corrected On-Site **
11. Food Service Area	Section 1	Chemical Storage	105 CMR 451.200	Design, Construction, and Installation; Functionality: Outer openings not protected against the entry of insects and rodents, exterior door damaged. Standard found in 105 CMR 590; FC 6-202.15(A)(3). Door sweep installed - 6/5/26
12. Food Service Area	Section 1	Staff Bathroom	105 CMR 451.123	Maintenance: Ceiling vent dusty Vent cleaned – 5/22/26
13. Food Service Area	Section 1	Mechanical Warewashing Area	105 CMR 451.200*	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Facility not cleaned as often as necessary, mold on wall above single compartment sink. Standard found in 105 CMR 590; FC 6-501.12(A). Wall cleaned – mold removed - 5/21/26
14. Food Service Area	Section 1	Mechanical Warewashing Area	105 CMR 451.200*	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Facility not cleaned as often as necessary, ceiling dirty. Standard found in 105 CMR 590; FC 6-501.12(A). Ceiling cleaned - mold removed– 5/22/26
15. Food Service Area	Section 1	Mechanical Warewashing Area	105 CMR 451.200*	Maintenance and Operation, Equipment: Inadequate water temperature in the mechanical warewashing machine (Pf), temperature recorded at 153°F. Standard found in 105 CMR 590; FC 4-501.112(A)(2). Warewashing machine's temperature adjusted to the appropriate regulatory temperature – 5/4/26
16. Food Service Area	Section 1	Mechanical Warewashing Area	105 CMR 451.200*	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Facility not cleaned as often as necessary, mold on ceiling. Standard found in 105 CMR 590; FC 6-501.12(A). Ceiling cleaned - mold removed – 5/22/26

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
17. Food Service Area	Section 1	Mechanical Warewashing Area	105 CMR 451.200*	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Facility not cleaned as often as necessary, walls dirty. Standard found in 105 CMR 590; FC 6-501.12(A). Walls cleaned – 4/27/26
18. Food Service Area	Section 1	Mechanical Warewashing Area	105 CMR 451.200	Cleaning of Equipment and Utensils, Objective: Nonfood contact surfaces of equipment dirty, splash curtain dirty on warewash machine. Standard found in 105 CMR 590; FC 4-601.11(C). Curtain cleaned – 5/22/26
19. Food Service Area	Section 1	Mechanical Warewashing Area	105 CMR 451.200	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Facility not in good repair, junction box cover missing. Standard found in 105 CMR 590; FC 6-501.11. Cover replaced – 5/4/26
20. Food Service Area	Section 1	Mechanical Warewashing Area	105 CMR 451.200	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Facility not in good repair, outlet cover missing below wall fan. Standard found in 105 CMR 590; FC 6-501.11. Cover replaced – 5/4/26
21. Food Service Area	Section 1	Mechanical Warewashing Area	105 CMR 451.200	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Facility not cleaned as often as necessary, wall mounted fan dusty. Standard found in 105 CMR 590; FC 6-501.12(A). ** Corrected On-Site **
22. Food Service Area	Section 1	Mechanical Warewashing Area	105 CMR 451.200	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Premises not maintained free of rodents, rodent droppings observed. Standard found in 105 CMR 590; FC 6-501.111. Area cleaned – exterminator addressed violation – 6/1/26
23. Food Service Area	Section 1	Mechanical Warewashing Area	105 CMR 451.200	Maintenance and Operation; Premises, Structure,

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
				Attachments, and Fixtures - Methods: Facility not cleaned as often as necessary, drying racks dirty. Standard found in 105 CMR 590; FC 6-501.12(A). Drying racks cleaned – 4/27/26
24. Food Service Area	Section 1	Mechanical Warewashing Area	105 CMR 451.200	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Premises not maintained free of insects, drain flies observed. Standard found in 105 CMR 590; FC 6-501.111. Area cleaned – exterminator addressed violation – 4/29/26
25. Food Service Area	Section 1	Mechanical Warewashing Area	105 CMR 451.200	Maintenance and Operation; Equipment: Warewashing machine not operating in accordance with manufacturer's instructions, warewash machine leaking. Standard found in 105 CMR 590; FC 4-501.15(A). Leak repaired – 4/29/26
26. Food Service Area	Section 1	Mechanical Warewashing Area	105 CMR 451.200	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Facility not cleaned as often as necessary, standing water observed. Standard found in 105 CMR 590; FC 6-501.12(A). Water removed – 4/27/26
27. Food Service Area	Section 1	Mechanical Warewashing Area	105 CMR 451.200	Plumbing System; Operation and Maintenance: Plumbing system not maintained in good repair. pipe in ceiling leaking into single compartment sink. Standard found in 105 CMR 590; FC 5-205.15(B). Maintenance notified – leak will be repaired – anticipated date of repair no later than 7/6/26
28. Food Service Area	Section 1	Pot Wash Area	105 CMR 451.200*	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Premises not maintained free of insects, drain flies observed. Standard found in 105 CMR 590; FC 6-501.111. Area cleaned – exterminator addressed the violation – 6/5/26

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
29. Food Service Area	Section 1	Pot Wash Area	105 CMR 451.200	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Facility not cleaned as often as necessary, signage hung on wall moldy. Standard found in 105 CMR 590; FC 6-501.12(A). Signage replaced– 5/22/26
30. Food Service Area	Section 1	Pot Wash Area	105 CMR 451.200*	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Facility not in good repair, wall damaged. Standard found in 105 CMR 590; FC 6-501.11. Maintenance notified – wall will be repaired - anticipated repair date not later than 7/6/26
31. Food Service Area	Section 1	Pot Wash Area	105 CMR 451.200*	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Facility not cleaned as often as necessary, sprayer head dirty. Standard found in 105 CMR 590; FC 6-501.12(A). Sprayer head cleaned – 4/29/26
32. Food Service Area	Section 1	Pot Wash Area	105 CMR 451.200*	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Non-functional equipment not repaired or removed from premises, garbage disposal out-of-order. Standard found in 105 CMR 590; FC 6-501.114(A). Food service contractor notified – disposal will be replaced - anticipated repair date no later than 7/10/26
33. Food Service Area	Section 1	Pot Wash Area	105 CMR 451.200*	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Facility not cleaned as often as necessary, standing water observed on floor. Standard found in 105 CMR 590; FC 6-501.12(A). Water removed – 4/27/26
34. Food Service Area	Section 1	Pot Wash Area	105 CMR 451.200*	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures -

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
				Methods: Facility not cleaned as often as necessary, walls dirty. Standard found in 105 CMR 590; FC 6-501.12(A). Walls cleaned – 4/27/26
35. Food Service Area	Section 1	Pot Wash Area	105 CMR 451.200*	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Facility not cleaned as often as necessary, mold on walls. Standard found in 105 CMR 590; FC 6-501.12(A). Walls cleaned- 4/27/26
36. Food Service Area	Section 1	Pot Wash Area	105 CMR 451.200*	Design, Construction, and Installation; Cleanability: Floors not smooth and easily cleanable. floor damaged. Standard found in 105 CMR 590; FC 6-201.11. Operations and Planning notified – contractor contacted to make necessary repairs – anticipated date of repairs no later than 7/10/26
37. Food Service Area	Section 1	Pot Wash Area	105 CMR 451.200	Plumbing System; Operation and Maintenance: Plumbing system not maintained in good repair, middle sink compartment leaking. Standard found in 105 CMR 590; FC 5-205.15(B). Sink repaired – 6/4/26
38. Food Service Area	Section 1	Pot Wash Handwash Sink	105 CMR 451.200	Plumbing System; Operation and Maintenance: Plumbing system not maintained in good repair, handwash sink out-of-order. Standard found in 105 CMR 590; FC 5-205.15(B). ** Corrected On-Site **
39. Food Service Area	Section 1	Pot Wash Handwash Sink	105 CMR 451.200	Numbers and Capacity; Handwashing Sinks: No soap at handwash sink(Pf). Standard found in 105 CMR 590.000, FC 6-301.11. ** Corrected On-Site **
40. Food Service Area	Section 1	Tray Area Handwash Sink	105 CMR 451.200*	Plumbing System; Design, Construction and Installation: Insufficient hot water temperature at handwashing sinks (Pf), temperature recorded at 87°F. Standard found in 105 CMR 590; FC 5-202.12(A). Water temperature adjusted to meet the appropriate regulatory

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency requirements – 6/15/26
41. Food Service Area	Section 1	Tray Area Handwash Sink	105 CMR 451.200*	Plumbing System; Operations and Maintenance: Handwashing sink not accessible (Pf), cart stored in front of handwash sink. Standard found in 105 CMR 590; FC 5-205.11(A). Cart removed – 4/27/29
42. Food Service Area	Section 1	Tray Area Handwash Sink	105 CMR 451.200	Numbers and Capacity; Handwashing Sinks: No hand drying method available at handwashing sink (Pf). Standard found in 105 CMR 590; FC 6-301.12. ** Corrected On-Site **
43. Food Service Area	Section 1	Tray Area Handwash Sink	105 CMR 451.200	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Facility not in good repair, paper towel dispenser not working properly. Standard found in 105 CMR 590; FC 6-501.11. Towel dispenser repaired – 5/22/26
44. Food Service Area	Section 2	Prep Table/Sink	105 CMR 451.200*	Maintenance and Operation; Equipment: Quaternary ammonium compound (QAC) solution lower than the manufacturers recommended concentration. Standard found in 105 CMR 590; FC 4-501.114(C)(2). ** Corrected On-Site **
45. Food Service Area	Section 2	Pot/Pan Storage Room	105 CMR 451.200*	Protection of Clean Items, Storing: Pots and pans not stored in a self-draining position, items stacked wet. Standard found in 105 CMR 590; FC 4-903.11(B)(1). ** Corrected On-Site **
46. Food Service Area	Section 2	Pot/Pan Storage Room	105 CMR 451.200*	Cleaning of Equipment and Utensils, Objective: Food contact surface dirty (Pf), pots and pans stored dirty. Standard found in 105 CMR 590; FC 4-601.11(A). ** Corrected On-Site **
47. Food Service Area	Section 2	Pot/Pan Storage Room	105 CMR 451.200*	Cleaning of Equipment and Utensils, Objective: Food contact surface dirty (Pf), trays stored greasy. Standard found in 105 CMR 590; FC 4-601.11(A).

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency ** Corrected On-Site **
48. Food Service Area	Section 2	Pot/Pan Storage Room	105 CMR 451.200*	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Facility not cleaned as often as necessary, ceiling dirty. Standard found in 105 CMR 590; FC 6-501.12(A). ** Corrected On-Site **
49. Food Service Area	Section 2	Pot/Pan Storage Room	105 CMR 451.200*	Design, Construction, and Installation; Cleanability: Wall not easily cleanable, wall paint damaged. Standard found in 105 CMR 590; FC 6-201.16(A). Paint Supervisor notified – wall will be repaired – anticipated date of repair no later than 7/3/26
50. Food Service Area	Section 2	Pot/Pan Storage Room	105 CMR 451.200*	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Premises not maintained free of rodents, rodent droppings observed on floor. Standard found in 105 CMR 590; FC 6-501.111. ** Corrected On-Site **
51. Food Service Area	Section 2	Pot/Pan Storage Room	105 CMR 451.200	Cleaning of Equipment and Utensils, Objective: Food contact surface dirty (Pf), rodent droppings observed on pans. Standard found in 105 CMR 590; FC 4-601.11(A). ** Corrected On-Site **
52. Food Service Area	Section 2	Pot/Pan Storage Room	105 CMR 451.200	Cleaning of Equipment and Utensils, Objective: Food contact surface dirty (Pf), dry baskets stored greasy. Standard found in 105 CMR 590; FC 4-601.11(A). Baskets cleaned – 4/27/26
53. Food Service Area	Section 2	Pot/Pan Storage Room	105 CMR 451.200	Protection from Contamination After Receiving; Preventing Contamination from Equipment, Utensils, and Linens: Grease from dry baskets dripping onto clean items. Standard found in 105 CMR 590; FC 3-304.12(B). ** Corrected On-Site **
54. Food Service	Section 3		105 CMR 451.200*	Maintenance and Operation;

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
Area				Premises, Structure, Attachments, and Fixtures - Methods: Premises not maintained free of rodents, rodent droppings observed on rear of stove. Standard found in 105 CMR 590; FC 6-501.111. ** Corrected On-Site **
55. Food Service Area	Section 3		105 CMR 451.200	Maintenance and Operation; Equipment: Quaternary ammonium compound (QAC) solution lower than the manufacturers recommended concentration. Standard found in 105 CMR 590; FC 4-501.114(C)(2). ** Corrected On-Site **
56. Food Service Area	Section 4	Refrigerator # 1	105 CMR 451.200	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Facility not cleaned as often as necessary, ceiling dirty. Standard found in 105 CMR 590; FC 6-501.12(A). Ceiling cleaned – 5/22/26
57. Food Service Area	Section 4	Refrigerator # 2	105 CMR 451.200*	Protection from Contamination After Receiving; Preventing Contamination from Equipment, Utensils, and Linens: Utensil handle not stored above the food in the container, scoop observed in sugar and flour containers. Standard found in 105 CMR 590; FC 3-304.12(B). ** Corrected On-Site **
58. Food Service Area	Section 4	Refrigerator # 2	105 CMR 451.200	Preventing Contamination after Receiving; Preventing Food and Ingredient Contamination: Food not appropriately covered, breadcrumbs stored uncovered. Standard found in 105 CMR 590; FC 3-302.11(A)(4). ** Corrected On-Site **
59. Food Service Area	Section 4	Refrigerator # 2	105 CMR 451.200	Protection from Contamination After Receiving, Preventing Food and Ingredient Contamination: Food or food ingredients that

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
				have been removed from original packages not labeled with common name of food, bulk containers not labeled. Standard found in 105 CMR 590; FC 3-302.12. ** Corrected On-Site **
60. Food Service Area	Section 4	Refrigerator # 2	105 CMR 451.200	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Facility not cleaned as often as necessary, sugar and flour container dirty. Standard found in 105 CMR 590; FC 6-501.12(A). ** Corrected On-Site **
61. Food Service Area	Section 4	Refrigerator # 2	105 CMR 451.200	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Facility not cleaned as often as necessary, walls dirty. Standard found in 105 CMR 590; FC 6-501.12(A). Walls cleaned – 5/22/26
62. Food Service Area	Section 4	Refrigerator # 2	105 CMR 451.200	Preventing Contamination from the Premises; Food Storage: Food exposed to splash, dust, or other contamination, fans in cooler dusty. Standard found in 105 CMR 590; FC 3-305.11(A)(2). ** Corrected On-Site **
63. Food Service Area	Section 4	Refrigerator # 2	105 CMR 451.200	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Facility not cleaned as often as necessary, spilled food debris on storage pallets. Standard found in 105 CMR 590; FC 6-501.12(A). ** Corrected On-Site **
64. Food Service Area	Section 4	Refrigerator # 2	105 CMR 451.200	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Facility not cleaned as often as necessary, produce storage rack dirty. Standard found in 105 CMR 590; FC 6-501.12(A). ** Corrected On-Site **
65. Food Service Area	Section 4	Refrigerator # 2	105 CMR 451.200	Characteristics; Condition: Food not safe, unadulterated, and honestly presented (Pf), rotten

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
				produce observed. Standard found in 105 CMR 590; FC 3-101.11. ** Corrected On-Site **
66. Food Service Area	Section 4	Freezer # 4	105 CMR 451.200*	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Facility not in good repair, threshold damaged. Standard found in 105 CMR 590; FC 6-501.11. Maintenance notified – threshold will be repaired – anticipated date of repair no later than 7/3/26
67. Food Service Area	Section 5	Diet Area	105 CMR 451.200*	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Facility not in good repair, pipe insulation damaged. Standard found in 105 CMR 590; FC 6-501.11. Insulation repaired – 6/15/26
68. Food Service Area	Section 5	Diet Area	105 CMR 451.200	Limitation of Growth of Organisms of Public Health Concern, Temperature and Time Control: Time/temperature control for safety food not held at 135°F or above (Pf), temperature of chicken recorded at 88°F. Standard found in 105 CMR 590; FC 3-501.16(A)(1). ** Corrected On-Site **
69. Food Service Area	Section 5		105 CMR 451.200	Limitation of Growth of Organisms of Public Health Concern, Temperature and Time Control: Time/temperature control for safety food not held at 135°F or above (Pf), temperature of rice recorded at 111°F. Standard found in 105 CMR 590; FC 3-501.16(A)(1). ** Corrected On-Site **
70. Food Service Area	Section 5	Diet Area	105 CMR 451.200	Maintenance and Operation, Equipment: Equipment not maintained in a state of good repair, available outlet not compatible with hot holding equipment. Standard found in 105 CMR 590; FC 4-501.11(A). Compatible outlet installed –

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency 4/29/26
71. Food Service Area	Section 5	Diet Area	105 CMR 451.200	Maintenance and Operation, Equipment: Equipment components not maintained in a state of good repair, warmer gaskets dirty and damaged. Standard found in 105 CMR 590; FC 4-501.11(B). Food Service contractor notified – contractor will replace gaskets – anticipated date of repairs no later 7/15/26. Current gaskets cleaned – 4/27/26
72. Food Service Area	Section 5	Diet Area	105 CMR 451.200	Hygienic Practices Food Contamination Prevention: Food service personnel eating in an inappropriate area, employee food observed in diet area. Standard found in 105 CMR 590; FC 2-401.11(A). ** Corrected On-Site **
73. Food Service Area	Section 5	Diet Area	105 CMR 451.200	Preventing Contamination after Receiving; Preventing Food and Ingredient Contamination: Food not appropriately covered, peas stored uncovered. Standard found in 105 CMR 590; FC 3-302.11(A)(4). ** Corrected On-Site **
74. Food Service Area	Section 5	Diet Area	105 CMR 451.200	Protection of Clean Items, Storing: Food product stored in an inappropriate location, peas stored below damaged pipe. Standard found in 105 CMR 590; FC 4-903-12(A)(8). ** Corrected On-Site **
75. Food Service Area	Section 5	Dry Storage Area	105 CMR 451.200*	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures -

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
				Methods: Premises not maintained free of rodents, rodent droppings observed. Standard found in 105 CMR 590; FC 6-501.111. ** Corrected On-Site **
76. Food Service Area	Section 5	Dry Storage Area	105 CMR 451.200	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Facility not cleaned as often as necessary, spilled food observed on floor. Standard found in 105 CMR 590; FC 6-501.12(A). ** Corrected On-Site **
77. Food Service Area	Section 5	Loading Dock	105 CMR 451.200*	Design, Construction, and Installation; Functionality: Outer openings not protected against the entry of insects and rodents, garage door not rodent and weathertight. Standard found in 105 CMR 590; FC 6-202.15(A)(3). Door sweep installed- 6/15/26
78. Food Service Area	Section 6	Refrigerator # 6	105 CMR 451.200*	Maintenance and Operation, Equipment: Equipment components not maintained in a state of good repair, gaskets dirty. Standard found in 105 CMR 590; FC 4-501.11(B). Gaskets cleaned – 5/22/26
79. Food Service Area	Section 6	Refrigerator # 6	105 CMR 451.200*	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Premises not maintained free of rodents, rodent droppings observed. Standard found in 105 CMR 590; FC 6-501.111. ** Corrected On-Site **
80. Food Service Area	Section 6	Refrigerator # 6	105 CMR 451.200	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Facility not cleaned as often as necessary, ceiling dirty. Standard found in 105 CMR 590; FC 6-501.12(A). Ceiling cleaned – 5/22/26
81. Food Service Area	Section 6	Refrigerator # 6	105 CMR 451.200	Maintenance and Operation, Equipment: Equipment

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
				components not maintained in a state of good repair, fan cover not secure. Standard found in 105 CMR 590; FC 4-501.11(B). ** Corrected On-Site **
82. Food Service Area	Section 6	Refrigerator # 6	105 CMR 451.200	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Facility not cleaned as often as necessary, spilled food debris observed on floor. Standard found in 105 CMR 590; FC 6-501.12(A). ** Corrected On-Site **
83. Food Service Area	Section 6	2-Compartment Sink Area	105 CMR 451.200	Plumbing System; Operation and Maintenance: Plumbing system not maintained in good repair, left side sink out-of-order. Standard found in 105 CMR 590; FC 5-205.15(B). Sink repaired and placed back on-line 6/3/26
84. Food Service Area	Section 6	2-Compartment Sink Area	105 CMR 451.200	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Premises not maintained free of insects, drain flies observed. Standard found in 105 CMR 590; FC 6-501.111. Area cleaned – exterminator addressed violation – 6/2/26
85. Food Service Area	Section 6	2-Compartment Sink Area	105 CMR 451.200	Design, Construction, and Installation; Cleanability: Wall not easily cleanable, wall damaged. Standard found in 105 CMR 590; FC 6-201.16(A). Maintenance notified – wall be repaired - anticipated date of repairs no later than 7/10/26
86. Food Service Area	Section 6	2-Compartment Sink Area	105 CMR 451.200	Plumbing System; Operations and Maintenance: Handwashing sink not accessible (Pf), carts stored in front of handwash sink. Standard found in 105 CMR 590; FC 5-205.11(A). ** Corrected On-Site **

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
87. Food Service Area	Section 6	Prep-Refrigerators and Tray Assembly Line	105 CMR 451.200*	Protection of Clean Items, Storing: Serving Trays not stored in a self-draining position. Standard found in 105 CMR 590; FC 4-903.11(B)(1). Trays stored in self-draining position – 4/28/26
88. Food Service Area	Section 6	Prep-Refrigerators and Tray Assembly Line	105 CMR 451.200*	Design, Construction, and Installation; Functionality: Outer openings not protected against the entry of insects and rodents, exterior door not rodent and weathertight. Standard found in 105 CMR 590; FC 6-202.15(A)(3). Door sweep installed – 5/22/26
89. Food Service Area	Section 6	Prep-Refrigerators and Tray Assembly Line	105 CMR 451.200*	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Facility not cleaned as often as necessary, vent dusty above warmers. Standard found in 105 CMR 590; FC 6-501.12(A). Vent cleaned – 5/22/26
90. Food Service Area	Section 6	Prep-Refrigerators and Tray Assembly Line	105 CMR 451.200	Cleaning of Equipment and Utensils, Objective: Food contact surface dirty (Pf). trays dirty. Standard found in 105 CMR 590; FC 4-601.11(A). Trays cleaned – 4/27/26
91. Food Service Area	Section 6	Prep-Refrigerators and Tray Assembly Line	105 CMR 451.200	Maintenance and Operation, Equipment: Equipment components not maintained in a state of good repair, warmer gaskets dirty. Standard found in 105 CMR 590; FC 4-501.11(B). Gasket cleaned – 5/22/26
92. Food Service Area	Section 6	Prep-Refrigerators and Tray Assembly Line	105 CMR 451.200	Maintenance and Operation, Equipment: Equipment components not maintained in a state of good repair, cooler gaskets damaged. Standard found in 105 CMR 590; FC 4-501.11(B). Food Service contractor notified – contractor will replace gaskets – anticipated date of repairs not later than 6/30/26
93. Food Service Area	Section 6	Prep-Refrigerators and Tray Assembly Line	105 CMR 451.200	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures -

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
				Methods: Premises not maintained free of rodents, rodent droppings observed. Standard found in 105 CMR 590; FC 6-501.111. Area cleaned – exterminator addressed violation – 6/2/26
94. Food Service Area	Section 6	Prep-Refrigerators and Tray Assembly Line	105 CMR 451.200	Cleaning of Equipment and Utensils, Objective: Nonfood contact surfaces of equipment dirty, encrusted food debris on tray carts. Standard found in 105 CMR 590; FC 4-601.11(C). Tray carts cleaned – 4/27/26
95. Food Service Area	Section 6	Staff Food Line	105 CMR 451.200	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Facility not cleaned as often as necessary, floor dirty below staff line. Standard found in 105 CMR 590; FC 6-501.12(A). ** Corrected On-Site **
96. Food Service Area	Section 6	Staff Food Line	105 CMR 451.200	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Premises not maintained free of rodents, rodent droppings observed throughout area. Standard found in 105 CMR 590; FC 6-501.111. ** Corrected On-Site **
97. Food Service Area	Section 6	Staff Dining Room	105 CMR 451.200	Cleaning of Equipment and Utensils, Objective: Food contact surface dirty (Pf), hairnet used in coffee brewer. Standard found in 105 CMR 590; FC 4-601.11(A). ** Corrected On-Site **
98. Food Service Area	Section 6	Staff Dining Room	105 CMR 451.200	Protection of Clean Items, Storing: Single-Use Items not stored at least 6 inches above the floor. Standard found in 105 CMR 590; FC 4-903.11(A)(3). ** Corrected On-Site **
99. Food Service Area	Section 6	Staff Dining Room	105 CMR 451.200	Protection from Contamination After Receiving, Preventing Food and Ingredient Contamination: Food or food ingredients that have been removed from original

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
				packages not labeled with common name of food, sugar not labeled. Standard found in 105 CMR 590; FC 3-302.12. Food container labeled – 4/27/26
100. Food Service Area	Section 6	Staff Dining Room	105 CMR 451.200	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Premises not maintained free of insects, fruit flies observed. Standard found in 105 CMR 590; FC 6-501.111. Dining room cleaned - exterminator addressed violation – 6/2/26
101. Food Service Area	Section 6	Staff Food Line	105 CMR 451.200	Cleaning of Equipment and Utensils, Objective: Nonfood contact surfaces of equipment dirty, exterior of warmer dirty. Standard found in 105 CMR 590; FC 4-601.11(C). ** Corrected On-Site **
102. Food Service Area	Section 6	Staff Dining Room	105 CMR 451.200	Limitation of Growth of Organisms of Public Health Concern, Temperature and Time Control: Time/temperature control for safety food not held at 41°F or less (Pf), temperature of chicken recorded at 60°F at salad bar. Standard found in 105 CMR 590; FC 3-501.16(A)(2). ** Corrected On-Site **
103. Food Service Area	Section 6	Staff Dining Room	105 CMR 451.200	Protection from Contamination After Receiving, Preventing Food and Ingredient Contamination: Food or food ingredients that have been removed from original packages not labeled with common name of food, dressing not labeled at salad bar. Standard found in 105 CMR 590; FC 3-302.12. ** Corrected On-Site **
104. Food Service Area	Section 6	Staff Dining Room	105 CMR 451.200	Maintenance and Operation, Equipment: Equipment components not maintained in a state of good repair, refrigerator gaskets dirty and damaged. Standard found in 105 CMR 590; FC 4-501.11(B). Gasket cleaned – 5/22/26

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
105. Food Service Area	Section 6	Staff Dining Room	105 CMR 451.200	Protection from Contamination After Receiving, Preventing Food and Ingredient Contamination: Food or food ingredients that have been removed from original packages not labeled with common name of food, several items not labeled in refrigerator. Standard found in 105 CMR 590; FC 3-302.12. Food container labeled – 4/27/26
106. Food Service Area	Section 6	Staff Dining Room	105 CMR 451.200	Protection of Clean Items, Storing: Use Items not stored at least 6 inches above the floor. Standard found in 105 CMR 590; FC 4-903.11(A)(3). ** Corrected On-Site **
107. Food Service Area	Section 6	Staff Dining Room	105 CMR 451.200	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Facility not cleaned as often as necessary, ceiling dirty around vent. Standard found in 105 CMR 590; FC 6-501.12(A). Ceiling cleaned – 5/22/26
108. Culinary Arts Kitchen	Slop Sink		105 CMR 451.200	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Wet mop stored in slop sink. Standard found in 105 CMR 590; FC 6-501.16. Mop removed and stored appropriately – 5/22/26
109. Culinary Arts Kitchen	Bathroom		105 CMR 451.123	Maintenance: Floor dirty Floor cleaned -5/22/26
110. Culinary Arts Kitchen	Classroom Section		105 CMR 451.200	Design, Construction, and Installation; Functionality: Outer openings not protected against the entry of insects and rodents, exterior door not rodent and weathertight. Standard found in 105 CMR 590; FC 6-202.15(A)(3). Door sweep installed – 5/22/26

Building #6**Deficiencies under the Required Standards (.100 and .200 series)**

6 new deficiencies and 1 repeat deficiency (indicated by an *) were found during the inspection:

Area	Sub Area # 1	Regulation	Description of Deficiency
1. Health Services Medical Area	Inmate Bathroom # 6229	105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, handwash sink leaking Maintenance notified – sink will repaired– anticipated date of repairs no later than 7/3/26
2. Health Services Medical Area	Inmate Bathroom # 6229	105 CMR 451.123	Maintenance: Ceiling vent dusty Vent cleaned – 5/23/26
3. Medical Unit	Room # 6258	105 CMR 451.200	Food Storage, Preparation and Service: Food preparation not in compliance with 105 CMR 590.000, interior of microwave oven dirty Microwave cleaned – 4/28/26
4. Medical Unit	Shower Area	105 CMR 451.123	Maintenance: Ceiling vent dusty in shower # 1 Vent cleaned – 5/22/26
5. Medical Unit	Cells	105 CMR 451.103	Mattresses: Mattress damaged in cell # 8 and 12 Mattresses replaced – 5/22/26
6. Booking Area	Staff Bathroom # 6135	105 CMR 451.130*	Plumbing: Plumbing not maintained in good repair, water control not secure at handwash sink Control secured – 6/4/26

Deficiencies under the Recommended Standards (.300 series)

10 new deficiencies and 3 repeat deficiencies (indicated by an *) were found during the inspection:

Area	Sub Area # 1	Regulation	Description of Deficiency
1. Medical Unit	Hallway	105 CMR 451.353	Interior Maintenance: Ceiling vent dusty Vent cleaned – 5/23/26
2. Medical Unit	Room # 6258	105 CMR 451.353	Interior Maintenance: Ceiling vent blocked Vent cleared – 5/23/26
3. Medical Unit	Isolation Cells (# 3 and 5)	105 CMR 451.353	Interior Maintenance: Ceiling vent blocked in cell # 5 Vent cleared – 5/23/26
4. Medical Unit	Isolation Cells (# 3 and 5)	105 CMR 451.353	Interior Maintenance: Ceiling vent dusty outside of cell # 5 and 7 Vent cleaned – 5/23/26
5. Medical Unit	Medical Waste/Biohazard Storage # 6250	105 CMR 451.353*	Interior Maintenance: Ceiling vent dusty Vent cleaned – 5/23/26
6. Medical Unit	Chemical Storage Room # 6248	105 CMR 451.353	Interior Maintenance: Ceiling vent dusty Vent cleaned – 5/23/26
7. Medical Unit	Inmate Property # 6246	105 CMR 451.360*	Protective Measures: Rodent droppings observed Area cleaned – exterminator addressed the violation – 6/2/26
8. Medical Unit	Cells	105 CMR 451.353	Interior Maintenance: Ceiling vent blocked in cell # 2 and 9 Vents cleared – 5/23/26
9. Medical Unit	Cells	105 CMR 451.353	Interior Maintenance: Ceiling vent dusty in cell # 13 Vent cleaned – 5/23/26
10. Medical Unit	Cells	105 CMR 451.353	Interior Maintenance: Objectionable odor observed in cell # 18 Odor mitigated – 4/28/26

Area	Sub Area # 1	Regulation	Description of Deficiency
11. Booking Area	Male Property Room # 6106	105 CMR 451.353*	Interior Maintenance: Ceiling water damaged Ceiling repaired – 6/2/26

Deficiencies under 105 CMR 451.402(B) (other conditions that may constitute a threat to health or safety)

1 new deficiency was found during the inspection:

Area	Sub Area # 1	Regulation	Description of Deficiency
1. Medical Unit	Medical Waste/Biohazard Storage # 6250	105 CMR 451.402(B)	Storage Area: Storage area not used exclusively for waste storage, clean blankets and clothing stored on top of full biohazard boxes. Standard found in 105 CMR 480.100(B). Clean blankets and clothing removed – 4/28/16

Building # 7

Deficiencies under the Recommended Standards (.300 series)

1 new deficiency and 1 repeat deficiency (indicated by an *) were found during the inspection:

Area	Sub Area # 1	Regulation	Description of Deficiency
1. Vehicle Trap	1st Floor	105 CMR 451.353*	Interior Maintenance: Ceiling water damaged Ceiling repaired – 6/2/26
2. Vehicle Trap	2nd Floor	105 CMR 451.353	Interior Maintenance: Ceiling water damaged Ceiling repaired – 6/2/26

Building # 8

Deficiencies under the Required Standards (.100 and .200 series)

22 new deficiencies and 19 repeat deficiencies (indicated by an *) were found during the inspection:

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
1. 1st Floor - Unit 8-1	Staff Area	Staff Bathroom # 8-106	105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, handwash sink leaking Sink repaired – 6/4/26
2. 1st Floor - Unit 8-1	Common Area		105 CMR 451.200	Food Storage, Preparation and Service: Food preparation not in compliance with 105 CMR 590.000, interior of microwave oven dirty Microwave cleaned – 4/29/26
3. 1st Floor - Unit 8-1	Common Area		105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, bubbler # 2 clogged Bubbler unclogged- 6/3/26
4. 1st Floor - Unit 8-1	Housing Area	Inmate Bathroom # 8-122	105 CMR 451.123	Maintenance: Wall vent dusty above showers Vent cleaned – 5/23/26
5. 2nd Floor - Unit 8-2	Staff Area	Staff Bathroom # 8-206	105 CMR 451.123*	Maintenance: Ceiling vent dusty Ceiling repaired – 6/2/26
6. 2nd Floor -	Common Area	Recreation Room #	105 CMR 451.200	Food Storage, Preparation and

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
Unit 8-2		8-215		Service: Food preparation not in compliance with 105 CMR 590.000, interior of microwave oven dirty Microwave cleaned – 4/29/26
7. 2nd Floor - Unit 8-2	Housing Area	Inmate Bathroom # 8-221	105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, water control leaking at handwash sink # 2 Sink Repaired – 6/4/26
8. 2nd Floor - Unit 8-2	Housing Area	Inmate Bathroom # 8-221	105 CMR 451.123	Maintenance: Wall vent dusty above showers Ceiling repaired – 6/2/26
9. 2nd Floor - Unit 8-2	Housing Area	Inmate Bathroom # 8-222	105 CMR 451.123	Maintenance: Wall vent dusty above showers Vent cleaned – 5/22/26
10. 2nd Floor - Unit 8-2	Housing Area	Cells	105 CMR 451.103	Mattresses: Mattress damaged in cell # 1 Mattress replaced – 5/23/26
11. 3rd Floor - Unit 8-3	Common Area	Recreation Room # 8-316	105 CMR 451.200*	Food Storage, Preparation and Service: Food preparation not in compliance with 105 CMR 590.000, interior of microwave oven dirty Microwave cleaned – 4/29/26
12. 3rd Floor - Unit 8-3	Housing Area	Inmate Bathroom # 8-322	105 CMR 451.123*	Maintenance: Floor dirty outside showers Floor cleaned – 4/29/26
13. 3rd Floor - Unit 8-3	Housing Area	Inmate Bathroom # 8-322	105 CMR 451.123*	Maintenance: Wall vent dusty above showers Vent cleaned – 5/23/26
14. 3rd Floor - Unit 8-3	Housing Area	Inmate Bathroom # 8-322	105 CMR 451.123	Maintenance: Walls dirty in shower # 2 and 4 Walls cleaned – 4/29/26
15. 3rd Floor - Unit 8-3	Housing Area	Inmate Bathroom # 8-322	105 CMR 451.123	Maintenance: Curtain dirty in shower # 4 Curtin replaced – 5/23/26
16. 3rd Floor - Unit 8-3	Housing Area	Inmate Bathroom # 8-322	105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, water control leaking at handwash sink # 2 Sink Repaired – 6/4/26
17. 3rd Floor - Unit 8-3	Housing Area	Inmate Bathroom # 8-322	105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, shower # 5 continuously running Shower repaired – 6/1/26
18. 3rd Floor - Unit 8-3	Housing Area	Inmate Bathroom # 8-322	105 CMR 451.130	Hot Water: Shower water temperature 121°F at shower # 5 Water temperature adjusted to meet the appropriate regulatory requirements – 6/15/26
19. 3rd Floor - Unit 8-3	Housing Area	Inmate Bathroom # 8-321	105 CMR 451.123*	Maintenance: Walls dirty in shower # 1, 3, and 5 Walls cleaned – 4/29/26
20. 4th Floor - Unit 8-4	Housing Area	Bathroom # 8-421	105 CMR 451.123	Maintenance: Floor dirty throughout bathroom

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
				Floor cleaned – 4/29/26
21. 4th Floor - Unit 8-4	Housing Area	Bathroom # 8-421	105 CMR 451.123*	Maintenance: Wall vent dusty above shower Vent cleaned – 5/23/26
22. 4th Floor - Unit 8-4	Housing Area	Bathroom # 8-421	105 CMR 451.123*	Maintenance: Walls dirty in shower # 1, 2, 3, 4, and 5 Walls cleaned – 4/29/26
23. 4th Floor - Unit 8-4	Housing Area	Bathroom # 8-421	105 CMR 451.123*	Maintenance: Floor dirty in shower # 1 Floor cleaned – 4/29/26
24. 4th Floor - Unit 8-4	Housing Area	Bathroom # 8-422	105 CMR 451.123*	Maintenance: Wall vent dusty above shower Vent cleaned – 5/23/26
25. 4th Floor - Unit 8-4	Housing Area	Bathroom # 8-422	105 CMR 451.123*	Maintenance: Area around handwash sinks dirty Area cleaned – 4/29/26
26. 4th Floor - Unit 8-4	Housing Area	Bathroom # 8-422	105 CMR 451.123*	Maintenance: Floor stained Floor cleaned – 5/23/26
27. 4th Floor - Unit 8-4	Housing Area	Bathroom # 8-422	105 CMR 451.123*	Maintenance: Light near showers damaged and dirty Light repaired and cleaned – 5/23/26
28. 4th Floor - Unit 8-4	Housing Area	Bathroom # 8-422	105 CMR 451.123*	Maintenance: Ceiling damaged Maintenance notified – ceiling will be repaired – anticipated date of repairs no later than 7/6/26
29. 4th Floor - Unit 8-4	Housing Area	Bathroom # 8-422	105 CMR 451.123	Maintenance: Walls dirty near handwash sinks Walls cleaned – 4/29/26
30. 4th Floor - Unit 8-4	Housing Area	Bathroom # 8-422	105 CMR 451.123	Maintenance: Walls dirty in shower # 1, 2, 3, 4, and 5 Walls cleaned – 4/29/26

Deficiencies under the Recommended Standards (.300 series)

17 new deficiencies and 3 repeat deficiencies (indicated by an *) were found during the inspection:

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
1. Building Entrance			105 CMR 451.350*	Structural Maintenance: Left side exterior door at entrance damaged Maintenance notified – door will be repaired – anticipated date of repairs no later than 7/6/26
2. 1st Floor - Unit 8-1	Common Area	Office # 8-115	105 CMR 451.353	Interior Maintenance: Ceiling vent blocked Vent cleared – 4/29/26
3. 1st Floor - Unit 8-1	Common Area	Staff Break Room # 8-116	105 CMR 451.353	Interior Maintenance: Ceiling vent dusty Vent cleaned – 5/23/26
4. 1st Floor - Unit 8-1	Common Area	Slop Sink Room # 8-123	105 CMR 451.353	Interior Maintenance: Wet mop stored in bucket Mop removed and stored appropriately – 4/29/26
5. 2nd Floor - Unit	Staff Area	Property # 8-211	105 CMR 451.344*	Illumination in Habitable Areas:

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
8-2				Light(s) not functioning properly, light out Light repaired – 6/4/26
6. 2nd Floor - Unit 8-2	Staff Area	Electrical # 8-226	105 CMR 451.353	Interior Maintenance: Ceiling vent dusty Vent cleaned – 5/23/26
7. 2nd Floor - Unit 8-2	Common Area		105 CMR 451.353*	Interior Maintenance: Floor tiles damaged throughout Tiles repaired – 5/28/26
8. 2nd Floor - Unit 8-2	Common Area	Recreation Room # 8-215	105 CMR 451.353	Interior Maintenance: Ceiling vent dusty Vent cleaned – 5/23/26
9. 2nd Floor - Unit 8-2	Common Area	Laundry Area	105 CMR 451.353	Interior Maintenance: Area around handwash sink dirty Area cleaned – 4/29/26
10. 2nd Floor - Unit 8-2	Housing Area	Slop Sink # 8-223	105 CMR 451.353	Interior Maintenance: Ceiling vent dusty Vent cleaned – 5/23/26
11. 3rd Floor - Unit 8-3	Common Area	Recreation Room # 8-315	105 CMR 451.353	Interior Maintenance: Ceiling vent dusty Vent cleaned – 5/23/26
12. 3rd Floor - Unit 8-3	Common Area	Recreation Room # 8-316	105 CMR 451.353	Interior Maintenance: Padding damaged on exercise machine Maintenance notified – padding will be repaired – anticipated date of repairs no later than 7/6/26
13. 3rd Floor - Unit 8-3	Common Area	Laundry Area	105 CMR 451.353	Interior Maintenance: Area around handwash sink dirty Area cleaned – 4/29/26
14. 3rd Floor - Unit 8-3	Common Area	Laundry Area	105 CMR 451.360	Protective Measures: Rodent droppings observed Area cleaned – exterminator addressed the violation – 6/2/26
15. 3rd Floor - Unit 8-3	Housing Area	Slop Sink Room # 8-323	105 CMR 451.353	Interior Maintenance: Wet mop stored upside down Mop removed from upside down position and stored properly – 4/27/26
16. 3rd Floor - Unit 8-3	Housing Area	Slop Sink Room # 8-323	105 CMR 451.353	Interior Maintenance: Wet mop stored in bucket Mop removed and stored appropriately – 4/29/26
17. 3rd Floor - Unit 8-3	Housing Area	Slop Sink Room # 8-323	105 CMR 451.353	Interior Maintenance: Standing water stored in mop bucket Water removed – 4/29/26
18. 4th Floor - Unit 8-4	Common Area	TV Room # 8-415	105 CMR 451.353	Interior Maintenance: Floor dirty Floor cleaned – 4/29/26
19. 4th Floor - Unit 8-4	Common Area	TV Room # 8-416	105 CMR 451.353	Interior Maintenance: Ceiling vent dusty Vent cleaned – 5/23/26

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
20. 4th Floor - Unit 8-4	Housing Area		105 CMR 451.353	Interior Maintenance: Floor dirty throughout Floor cleaned – 4/29/26

SECTION 2: Areas Found to be in Compliance

EHRHS inspected 272 additional areas of the facility which were found to be in compliance

SECTION 3: Areas EHRHS did not Inspect

EHRHS did not inspect 3 areas of the facility because they were either in use, locked, or under construction.

Area	Sub Area # 1	Sub Area # 2	Sub Area # 3	Description of Deficiency
1. Building # 1	11th Floor	Unit 1-11-2	Kitchenette	Unable to Inspect – In Use
2. Building # 1	2nd Floor	Unit 1-2-1	Bathroom # 235	Unable to Inspect – In Use
3. Building # 8	1st Floor - Unit 8-1	Housing Area	Inmate Bathroom # 8-121	Unable to Inspect – In Use

SECTION 4: Plan of Correction

This facility does not comply with the Department’s regulations cited above. In accordance with 105 CMR 451.404, please submit a plan of correction within 10 working days of receipt of this notice which includes:

1. Specific corrective steps to be taken
2. A timetable for the corrective actions for larger projects
3. The date by which correction will be achieved
4. Any interim measures being implemented to ensure the health and safety of incarcerated individuals and facility staff
5. A signature by the Superintendent or Administrator responsible for the plan. The signed plan should be submitted to my attention, at the address listed above.

SECTION 5: Observations and Recommendations

1. The inmate population was 1093 at the time of inspection.
2. During the facility inspection, the EHRHS noted numerous deficiencies related to cleanliness. The conditions noted throughout the facility can lead to bacterial growth and pest infestation, increasing the risk of illness for staff and inmates. The EHRHS suggests a routine cleaning schedule be developed and implemented to ensure all areas of the facility are cleaned at a higher frequency.
3. During the inspection of the food service area, the EHRHS noted numerous deficiencies related to improper food serving procedures and failure to properly clean and sanitize surfaces and equipment. The conditions noted throughout the food service area can lead to cross contamination and pathogen growth, increasing the risk of foodborne illness or injury. The EHRHS recommends:
 - A routine cleaning schedule be developed and implemented to ensure all areas of the kitchen are cleaned at a higher frequency; and
 - Kitchen management develop a program and train staff on proper food serving temperatures and record keeping protocols.

To review the specific regulatory requirements, please visit the [Massachusetts Department of Public Health Regulatory and Compliance Unit](#) and [read the minimum health and sanitation standards for correctional facilities](#) available in both PDF and RTF formats. For more specific information about the food standards, you can [download the merged food code](#).

An inspection may also include observations of other conditions which could constitute a threat to the health or safety of inmates or employees, including but not limited to the standards set forth by the Department as follows, and report on such pursuant to 451.402(B). You can use these links below to review these standards:


- [105 CMR 205.000](#): Minimum Standards Governing Medical Records and Conduct of Physical Examinations in Correctional Facilities
- [105 CMR 480.000](#): Minimum requirements for the Management of Medical or Biological Waste
- [105 CMR 500.000](#): Good Manufacturing Practices for Food

This inspection report is true and accurate to the best of my knowledge.

Sincerely,



Hannah LeBeau
Environmental Health Officer, EHRS, BCEH

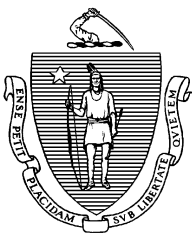

The Commonwealth of Massachusetts
Executive Office of Health and Human Services
Department of Public Health
Bureau of Climate and Environmental Health
Division of Environmental Health Regulations and Standards
67 Forest Street, Suite # 100
Marlborough, MA 01752
617-624-6000 | mass.gov/dph

Maura T. Healey
Governor

Kimberley Driscoll
Lieutenant Governor

Kiame Mahaniah, MD, MBA
Secretary

Robert Goldstein, MD, PhD
Commissioner

June 25, 2026

Steven W. Tompkins, Sheriff
Suffolk County Sheriff's Department
20 Bradston Street
Boston, MA 02118 (electronic copy)

Re: Plan of Correction – Suffolk County House of Correction, Boston

Dear Sheriff Tompkins:

The Massachusetts Department of Public Health, Division of Environmental Regulations and Standards (EHRS) has received your Plan of Correction in response to my inspection conducted on April 27, 28, and 29, 2026. After review, the EHRS finds the plan addresses all the deficiencies noted with the following exceptions:

1. In regards to the issue of overcrowding, the EHRS appreciates the limitations of correctional facilities and the need to accommodate the ever-increasing population; however we remain concerned with the overcrowded conditions; and
2. Please provide specific corrective action and an estimated date of completion for the following items:
 - a. Door frame rusted in shower # 2 in Unit 1-6-2 Upper Showers; and
 - b. Wall vent dusty above showers in Inmate Bathroom # 8-221 in Unit 8-2.


Thank you for your prompt attention to this matter, should you have any questions please contact me at the address listed above.

Sincerely,

Hannah LeBeau
Environmental Health Officer, EHRS, BCEH

cc: Michael Lally, Superintendent
Sergeant Tyler Crocker, EHSO/FSO

(electronic copy)
(electronic copy)

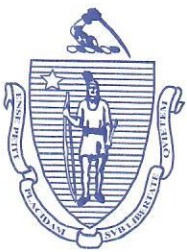

STEVEN W. TOMPKINS
SHERIFF

Suffolk County Sheriff's Department

Jail
200 Nashua Street
Boston, MA 02114
(617) 635-1100

House of Correction
20 Bradston Street
Boston, MA 02118
(617) 635-1000



June 25, 2026

Hannah LeBeau
Environmental Health Inspector
Department of Public Health
Bureau of Environmental Health
Community Sanitation Program
5 Randolph St.
Canton, MA 02021

Dear Inspector LeBeau,


Enclosed is this Department's updated Plan of Action to correct deficiencies noted in the Minimum Health and Sanitation Standards Inspection of the Suffolk County House of Correction conducted on April 27, 28 and 29, 2026.

1. Thank you for your concern with overcrowding conditions. The House of Correction's Custody Assessment Division monitors overcrowding condition on a regular basis and attempts to ease these conditions whenever possible.
2. The deficiencies noted in your response were addressed with corrective action and a date of completion or an estimated date of completion.

As always, we look forward to any recommendations or suggestions your department raises, and will address those issues to the best of our abilities in a timely manner.

Sincerely,

Michael S. Lally,
Superintendent

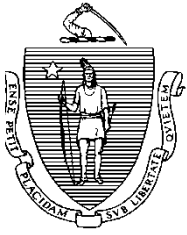

The Commonwealth of Massachusetts
Executive Office of Health and Human Services
Department of Public Health
250 Washington Street, Boston, MA 02108-4619
617-624-6000 | mass.gov/dph

Maura T. Healey
Governor

Kimberley Driscoll
Lieutenant Governor

Kiame Mahaniah, MD, MBA
Secretary

Robert Goldstein, MD, PhD
Commissioner

May 20, 2026

Steven W. Tompkins, Sheriff
Suffolk County Sheriff's Department
20 Bradston Street
Boston, MA 02118 (electronic copy)

Re: Facility Inspection – Suffolk County House of Corrections, Boston

Dear Sheriff Tompkins:

The Massachusetts Department of Public Health (Department) Division of Environmental Health Regulations and Standards (EHRS) conducted an inspection of the Suffolk County House of Corrections on April 27, 28, and 29, 2026 accompanied by Captain Brian Reynolds, in accordance with Department regulations 105 CMR 451.000: Minimum Health and Sanitation Standards and Inspection Procedures for Correctional Facilities.

The inspection identified 833 total deficiencies: 291 new deficiencies under the Required Standards (.100 and .200 series), 141 repeat deficiencies under the Required Standards, 310 new deficiencies under the Recommended Standards (.300 series), 90 repeat deficiencies under the Recommended Standards, and 1 new deficiency under 105 CMR 451.402(B).

Overview

Section 1 provides details of all deficiencies, including repeat deficiencies, found during the inspection. These are categorized by Required Standards, Recommended Standards, or additional applicable regulatory standards.

Section 2 provides information on areas that EHRS found to be compliant.

Section 3 documents the areas that EHRS did not inspect.

Section 4 provides information on submitting a Plan of Correction for the identified deficiencies.

Section 5 outlines observations and recommendations related to the inspection.

SECTION 1: Health and Safety Deficiencies

Building #1

Deficiencies under the Required Standards (.100 and .200 series)

102 new deficiencies and 29 repeat deficiencies (indicated by an *) were found during the inspection:

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
1. 11th Floor	Slop Sink Room # 1158		105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, drain clogged at slop sink Drain unclogged – 4/27/26
2. 11th Floor	Unit 1-11-1	Showers	105 CMR 451.130*	Hot Water: Shower water temperature 69°F at shower # 3 Water temperature adjusted to meet the appropriate regulatory requirements – 6/15/26
3. 11th Floor	Unit 1-11-1	Showers	105 CMR 451.123*	Maintenance: Walls dirty in shower # 1, 2, and 3 Walls cleaned – 4/27/26
4. 11th Floor	Unit 1-11-1	Showers	105 CMR 451.123*	Maintenance: Ceiling vent dusty in shower # 2 Vent cleaned 5/21/26
5. 11th Floor	Unit 1-11-1	Showers	105 CMR 451.123	Maintenance: Ceiling vent dusty in shower # 1 and 3 Vents cleaned - 5/21/26
6. 11th Floor	Unit 1-11-1	Kitchenette	105 CMR 451.200	Food Storage, Preparation and Service: Food preparation not in compliance with 105 CMR 590.000, interior of microwave oven dirty Microwave cleaned – 4/27/26
7. 11th Floor	Unit 1-11-2	Showers	105 CMR 451.123*	Maintenance: Walls dirty in shower # 1 and 2 Walls cleaned – 4/27/26
8. 11th Floor	Unit 1-11-2	Showers	105 CMR 451.123*	Maintenance: Ceiling vent dusty in shower # 3 Vent cleaned - 5/21/26
9. 10th Floor	Staff Bathroom # 1074		105 CMR 451.123	Maintenance: Ceiling vent dusty Vent cleaned - 5/21/26
10. 10th Floor	Unit 1-10-1	Showers	105 CMR 451.123	Maintenance: Mop stored upside down in shower # 1 Mop removed from upside down position and stored properly – 4/27/26
11. 10th Floor	Unit 1-10-1	Showers	105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, shower # 1 continuously running Shower repaired – 4/27/26
12. 10th Floor	Unit 1-10-1	Kitchenette	105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, drain cover missing at handwash sink

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
				Cover installed – 6/4/26
13. 10th Floor	Unit 1-10-1	Cells	105 CMR 451.103	Mattresses: Mattress cover damaged in cell # 9 Mattress removed – 5/21/26
14. 10th Floor	Unit 1-10-2	Showers	105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, shower # 1 leaking Shower repaired – 6/4/326
15. 10th Floor	Unit 1-10-2	Showers	105 CMR 451.123	Maintenance: Ceiling vent dusty in shower # 1, 2, and 3 Vents cleaned - 5/21/26
16. 10th Floor	Unit 1-10-2	Kitchenette	105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, handwash sink out-of-order Sink repaired – placed back on-line – 6/1/26
17. 10th Floor	Unit 1-10-2	Kitchenette	105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, handwash sink clogged Sink unclogged – 6/1/26
18. 10th Floor	Unit 1-10-4 Women's MAT Program	Staff Bathroom	105 CMR 451.123	Maintenance: Soap dispenser damaged Soap dispenser repaired – 6/4/26
19. 10th Floor	Unit 1-10-4 Women's MAT Program	Shower	105 CMR 451.123*	Maintenance: Wall damaged around water control Wall repaired – 6/8/26
20. 10th Floor	Unit 1-10-4 Women's MAT Program	Staff Bathroom	105 CMR 451.123*	Maintenance: Ceiling vent dusty Vent cleaned – 5/21/26
21. 9th Floor	Staff Bathroom # 944		105 CMR 451.123*	Maintenance: Ceiling vent dusty Vent cleaned - 5/21/26
22. 9th Floor	Unit 1-9-1	Shower Area	105 CMR 451.123*	Maintenance: Walls dirty in shower # 1 Walls cleaned – 4/27/26
23. 9th Floor	Unit 1-9-1	Shower Area	105 CMR 451.123	Maintenance: Ceiling vent dusty in shower # 1 Vent cleaned – 5/21/26
24. 9th Floor	Unit 1-9-1	Shower Area	105 CMR 451.123	Maintenance: Door frame damaged in shower # 1 Frame repaired – 6/4/26
25. 9th Floor	Unit 1-9-1	Shower Area	105 CMR 451.123	Maintenance: Walls dirty in shower # 3 Walls cleaned – 4/27/26
26. 9th Floor	Unit 1-9-1	Shower Area	105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, shower # 3 continuously running Shower repaired – 4/27/26
27. 9th Floor	Unit 1-9-1	Shower Area	105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, handicapped shower

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
				attachment missing Attachment replaced – 5/6/26
28. 9th Floor	Unit 1-9-1	Kitchenette	105 CMR 451.200	Food Storage, Preparation and Service: Food preparation not in compliance with 105 CMR 590.000, microwave oven damaged Microwave replaced – 5/21/26
29. 9th Floor	Unit 1-9-1	Kitchenette	105 CMR 451.126	Hot Water for Bathing and Hygiene: Hot water temperature 88°F at handwash sink Water temperature adjusted to meet the appropriate regulatory requirements – 6/15/26
30. 9th Floor	Unit 1-9-2	Shower Area	105 CMR 451.123	Maintenance: Wall paint damaged in shower # 1 Wall repaired – 6/5/26
31. 9th Floor	Unit 1-9-2	Shower Area	105 CMR 451.123	Maintenance: Ceiling vent rusted in shower # 2 Vent replaced – 6/5/26
32. 9th Floor	Unit 1-9-2	Shower Area	105 CMR 451.123	Maintenance: Walls dirty in shower # 2 Walls cleaned – 4/27/26
33. 8th Floor	Unit 1-8-1	Showers	105 CMR 451.123*	Maintenance: Walls dirty in shower # 1 and 2 Walls cleaned – 4/27/26
34. 8th Floor	Unit 1-8-1	Showers	105 CMR 451.123*	Maintenance: Ceiling vent dusty in shower # 1 Vent cleaned - 5/21/26
35. 8th Floor	Unit 1-8-2	Showers	105 CMR 451.123	Maintenance: Ceiling vent dusty in shower # 2 and 3 Vents cleaned - 5/21/26
36. 8th Floor	Unit 1-8-2	Showers	105 CMR 451.123	Maintenance: Drain flies observed in shower # 1 Shower cleaned – Exterminator addressed issue – 6/2/26
37. 8th Floor	Unit 1-8-2	Showers	105 CMR 451.123	Maintenance: Walls dirty in shower # 2 Walls cleaned – 4/27/26
38. 8th Floor	Unit 1-8-2	Showers	105 CMR 451.123	Maintenance: Ceiling paint damaged in shower # 2 Ceiling repaired – 6/5/26
39. 8th Floor	Unit 1-8-2	Cells	105 CMR 451.103	Mattresses: Mattress cover missing in cell # 6, 11, and 14 Mattresses replaced – 5/21/26
40. 6th Floor	Unit 1-6-1	Kitchenette	105 CMR 451.200	Food Storage, Preparation and Service: Food preparation not in compliance with 105 CMR 590.000, interior of microwave oven dirty Microwave cleaned – 4/27/26

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
41. 6th Floor	Unit 1-6-1	Upper Showers	105 CMR 451.123	Maintenance: Door frame rusted in shower # 3 Maintenance notified – frame will be repaired – anticipated date of repairs no later than 7/3/26
42. 6th Floor	Unit 1-6-1	Upper Showers	105 CMR 451.123	Maintenance: Walls dirty in shower # 1 Walls cleaned – 4/27/26
43. 6th Floor	Unit 1-6-1	Upper Showers	105 CMR 451.123	Maintenance: Ceiling vent dusty in shower # 1 and 2 Vents cleaned - 5/21/26
44. 6th Floor	Unit 1-6-1	Upper Showers	105 CMR 451.123	Maintenance: Sprinkler shroud rusted in shower # 3 Fire Safety Officer notified – shroud will be replaced – anticipated date of repair no later than 7/1/26
45. 6th Floor	Unit 1-6-1	Upper Showers	105 CMR 451.123	Maintenance: Threshold epoxy damaged in shower # 3 Maintenance notified – frame will be repaired – anticipated date of repairs no later than 7/3/26
46. 6th Floor	Unit 1-6-1	Lower Shower Area	105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, handicapped shower attachment missing in shower # 3 Attachment replaced – 5/6/26
47. 6th Floor	Unit 1-6-1	Lower Shower Area	105 CMR 451.123	Maintenance: Ceiling vent dusty in shower # 1, 2, and 3 Vents cleaned - 5/21/26
48. 6th Floor	Unit 1-6-1	Lower Shower Area	105 CMR 451.123	Maintenance: Door frame rusted in shower # 1 and 3 Maintenance notified – frame will be repaired – anticipated date of repairs no later than 7/3/26
49. 6th Floor	Unit 1-6-2	Kitchenette	105 CMR 451.200	Food Storage, Preparation and Service: Food preparation not in compliance with 105 CMR 590.000, interior of microwave oven dirty near television and near cell # 16 Microwave cleaned – 4/27/26
50. 6th Floor	Unit 1-6-2	Upper Cells	105 CMR 451.103	Mattresses: Mattress cover missing in cell # 18 and 27 Mattresses replaced – 5/21/26
51. 6th Floor	Unit 1-6-2	Upper Showers	105 CMR 451.123*	Maintenance: Ceiling vent dusty in shower # 2 Vent cleaned - 5/21/26

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
52. 6th Floor	Unit 1-6-2	Upper Showers	105 CMR 451.123*	Maintenance: Wall damaged near water control in shower # 1 Maintenance notified – wall will be repaired– anticipated repair date no later than 7/3/26
53. 6th Floor	Unit 1-6-2	Upper Showers	105 CMR 451.123*	Maintenance: Walls dirty in shower # 2 Walls cleaned – 4/27/26
54. 6th Floor	Unit 1-6-2	Upper Showers	105 CMR 451.123	Maintenance: Sprinkler shroud rusted in shower # 1 and 2 Fire Safety Officer notified – shroud will be replaced – anticipated date of repair no later than 7/1/26
55. 6th Floor	Unit 1-6-2	Upper Showers	105 CMR 451.123	Maintenance: Door frame rusted in shower # 2 Maintenance notified - – frame will be repaired – anticipated date of repairs no later than 7/7/26
56. 6th Floor	Unit 1-6-2	Upper Showers	105 CMR 451.123	Maintenance: Ceiling vent dusty in shower # 3 Vent cleaned - 5/21/26
57. 6th Floor	Unit 1-6-2	Lower Showers	105 CMR 451.123*	Maintenance: Ceiling vent dusty in shower # 2 Vent cleaned - 5/21/26
58. 6th Floor	Unit 1-6-2	Lower Showers	105 CMR 451.123	Maintenance: Door frame rusted in shower # 1 and 2 Maintenance notified – frame will be repaired – anticipated date of repairs no later than 7/3/26
59. 6th Floor	Unit 1-6-2	Lower Showers	105 CMR 451.123	Maintenance: Drain flies observed in shower # 2 Shower cleaned– exterminator addressed the violation – 6/1/26
60. 6th Floor	Unit 1-6-2	Lower Showers	105 CMR 451.123	Maintenance: Shower curtain damaged in shower # 2 Curtain replaced – 5/22/26
61. 6th Floor	Unit 1-6-2	Lower Showers	105 CMR 451.123	Maintenance: Ceiling vent dusty in shower # 3 Vent cleaned - 5/21/26
62. 5th Floor	Unit 1-5-1	Shower Area	105 CMR 451.123	Maintenance: Door frame damaged in shower # 1 and 2 Frames repaired – 6/5/26
63. 5th Floor	Unit 1-5-1	Shower Area	105 CMR 451.123	Maintenance: Sprinkler shroud rusted in shower # 2 Fire Safety Officer notified – shroud will be replaced – anticipated date of repair no later than 7/1/26

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
64. 4th Floor	Staff Bathroom # 445		105 CMR 451.123	Maintenance: Ceiling vent dusty Vent cleaned - 5/21/26
65. 4th Floor	Slop Sink # 454		105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, slop sink clogged Sink unclogged – 5/20/26
66. 4th Floor	Unit 1-4-1	Shower Area	105 CMR 451.123*	Maintenance: Walls dirty in shower # 1 Walls cleaned – 4/27/26
67. 4th Floor	Unit 1-4-1	Shower Area	105 CMR 451.123	Maintenance: Walls dirty in shower # 3 Walls cleaned – 4/27/26
68. 4th Floor	Unit 1-4-1	Shower Area	105 CMR 451.123	Maintenance: Ceiling vent dusty in shower # 1 Vent cleaned - 5/21/26
69. 4th Floor	Unit 1-4-1	Shower Area	105 CMR 451.123	Maintenance: Door frame damaged in shower # 1 Maintenance notified – frame will be repaired – anticipated repair date no later than 7/3/26
70. 4th Floor	Unit 1-4-1	Shower Area	105 CMR 451.123	Maintenance: Wet mop stored in bucket in shower # 2 Mop removed and stored properly – 4/27/26
71. 4th Floor	Unit 1-4-1	Shower Area	105 CMR 451.123	Maintenance: Debris in drain in shower # 2 Debris removed – 4/27/26
72. 4th Floor	Unit 1-4-1	Cells	105 CMR 451.103	Mattresses: Mattress cover missing in cell # 4 Mattress replaced – 5/21/26
73. 4th Floor	Unit 1-4-2	Shower Area	105 CMR 451.123*	Maintenance: Ceiling vent dusty in shower # 3 Vent cleaned - 5/21/26
74. 4th Floor	Unit 1-4-2	Shower Area	105 CMR 451.123	Maintenance: Wet mop stored on floor in shower # 1 Mop removed and stored properly – 4/27/26
75. 4th Floor	Unit 1-4-2	Shower Area	105 CMR 451.123	Maintenance: Toilet auger stored with cleaning supplies in shower # 1 Auger removed – 4/27/26
76. 4th Floor	Unit 1-4-2	Shower Area	105 CMR 451.123	Maintenance: Walls dirty in shower # 2 and 3 Walls cleaned – 4/27/26
77. 4th Floor	Unit 1-4-2	Shower Area	105 CMR 451.123	Maintenance: Ceiling vent dusty in shower # 2 Vent cleaned – 5/21/26
78. 4th Floor	Unit 1-4-2	Cells	105 CMR 451.103	Mattresses: Mattress damaged in cell # 3 Mattress replaced – 5/21/26
79. 3rd Floor	Unit 1-3-1	Cells	105 CMR 451.103	Mattresses: Mattress cover missing in cell # 8

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
				Mattress replaced – 5/21/26
80. 3rd Floor	Unit 1-3-2	Staff Bathroom # 360	105 CMR 451.123	Maintenance: Objectionable odor observed Odor mitigated – 4/27/26
81. 3rd Floor	Unit 1-3-2	Shower Area	105 CMR 451.123*	Maintenance: Debris in drain in shower # 1 Debris removed – 4/27/26
82. 3rd Floor	Unit 1-3-2	Shower Area	105 CMR 451.123*	Maintenance: Debris on floor in shower # 1 Debris removed – 4/27/26
83. 3rd Floor	Unit 1-3-2	Shower Area	105 CMR 451.123*	Maintenance: Walls dirty in shower # 1 Walls cleaned – 4/27/26
84. 3rd Floor	Unit 1-3-2	Shower Area	105 CMR 451.123*	Maintenance: Ceiling dirty in shower # 1 Ceiling cleaned – 5/21/26
85. 3rd Floor	Unit 1-3-2	Shower Area	105 CMR 451.123	Maintenance: Ceiling vent dusty in shower # 1 and 3 Vents cleaned – 5/22/26
86. 3rd Floor	Unit 1-3-2	Shower Area	105 CMR 451.123	Maintenance: Door frame dirty in shower # 1 Frame cleaned – 5/22/26
87. 3rd Floor	Unit 1-3-2	Shower Area	105 CMR 451.123	Maintenance: Wet mop stored on floor in shower # 2 Mop removed and stored properly – 4/27/26
88. 3rd Floor	Unit 1-3-2	Shower Area	105 CMR 451.123	Maintenance: Debris on floor in shower # 2 and 3 Debris removed – 4/27/26
89. 3rd Floor	Unit 1-3-2	Shower Area	105 CMR 451.123	Maintenance: Door frame rusted in shower # 3 Maintenance notified - frame will be repaired – anticipated repair date no later than 7/3/26
90. 3rd Floor	Unit 1-3-2	Shower Area	105 CMR 451.123	Maintenance: Floor dirty in shower # 3 Floor cleaned – 4/27/26
91. 3rd Floor	Unit 1-3-2	Shower Area	105 CMR 451.123	Maintenance: Walls dirty in shower # 3 Walls cleaned – 4/27/26
92. 3rd Floor	Unit 1-3-2	Kitchenette	105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, debris in drain Debris removed – 4/27/26
93. 3rd Floor	Unit 1-3-2	Kitchenette	105 CMR 451.126	Hot Water for Bathing and Hygiene: Hot water temperature 59°F at handwash sink Water temperature adjusted to meet the appropriate regulatory requirements – 6/15/26
94. 2nd Floor	Unit 1-2-1	Common Area	105 CMR 451.200*	Food Storage, Preparation and

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
				Service: Food preparation not in compliance with 105 CMR 590.000, interior of microwave oven dirty near cell # 19 Microwave cleaned – 4/27/26
95. 2nd Floor	Unit 1-2-1	Bathroom # 230	105 CMR 451.123*	Maintenance: Walls dirty in shower # 4 Walls cleaned – 4/27/26
96. 2nd Floor	Unit 1-2-1	Bathroom # 230	105 CMR 451.123*	Maintenance: Floor dirty in shower # 1 Floor cleaned – 4/27/26
97. 2nd Floor	Unit 1-2-1	Bathroom # 230	105 CMR 451.123	Maintenance: No curtain at shower # 1 and 2 Curtains installed – 5/22/26
98. 2nd Floor	Unit 1-2-1	Bathroom # 230	105 CMR 451.123	Maintenance: Floor drain dirty in shower # 1 Drain cleaned – 4/27/26
99. 2nd Floor	Unit 1-2-1	Bathroom # 230	105 CMR 451.123	Maintenance: Floor dirty in shower # 3 and 4 Floors cleaned – 4/27/26
100. 2nd Floor	Unit 1-2-1	Bathroom # 230	105 CMR 451.123	Maintenance: Walls dirty in shower # 2 Walls cleaned – 4/27/26
101. 2nd Floor	Unit 1-2-1	Bathroom # 230	105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, showerhead missing in shower # 1 and 2 Showerhead replaced – 6/5/26
102. 2nd Floor	Unit 1-2-1	Bathroom # 230	105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, shower # 2 leaking Shower repaired – 6/5/26
103. 2nd Floor	Unit 1-2-1	Bathroom # 230	105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, showerhead covered in plastic bag in shower # 3 Plastic bag removed – 5/15/26
104. 2nd Floor	Unit 1-2-1	Bathroom # 230	105 CMR 451.123	Maintenance: Floor paint damaged outside showers Floor repaired – 6/15/26
105. 2nd Floor	Unit 1-2-1	Bathroom # 230	105 CMR 451.123	Maintenance: Ceiling vent rusted above toilet Vent repaired – 6/5/26
106. 2nd Floor	Unit 1-2-1	Cells	105 CMR 451.103	Mattresses: Mattress damaged in cell # 27 Mattress replaced – 5/22/26
107. 1st Floor	Female Bathroom # 140		105 CMR 451.130*	Plumbing: Plumbing not maintained in good repair, handwash sink # 1 out-of-order Sink repaired - 6/4/26

Deficiencies under the Recommended Standards (.300 series)

186 new deficiencies and 35 repeat deficiencies (indicated by an *) were found during the inspection:

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
1. All Cells			105 CMR 451.320*	Cell Size: Inadequate floor space in all cells Cell design does not allow the facility to provide adequate floor space
2. 11th Floor	Unit 1-11-1	Common Area	105 CMR 451.353	Interior Maintenance: Wall dusty around vent near television Wall cleaned – 5/22/26
3. 11th Floor	Unit 1-11-1	Cells	105 CMR 451.353	Interior Maintenance: Wall vent blocked in cell # 15 Vent cleared – 5/22/26
4. 11th Floor	Unit 1-11-1	Cells	105 CMR 451.353*	Interior Maintenance: Wall vent blocked in cell # 4 Vent cleared – 5/22/26
5. 11th Floor	Unit 1-11-2	Common Area	105 CMR 451.353	Interior Maintenance: Wall dusty around vent near television Wall cleaned – 5/22/26
6. 11th Floor	Unit 1-11-2	Cells	105 CMR 451.353	Interior Maintenance: Ceiling vent blocked in cell # 2 and 15 Vents cleared – 5/22/26
7. 10th Floor	Offices		105 CMR 451.353	Interior Maintenance: Ceiling tiles dirty throughout Tiles replaced – 6/5/26
8. 10th Floor	Unit 1-10-1	Common Area	105 CMR 451.353	Interior Maintenance: Ceiling vent dusty Vent cleaned – 5/22/26
9. 10th Floor	Unit 1-10-1	Cells	105 CMR 451.353	Interior Maintenance: Wall vent blocked in cell # 10 and 15 Vents cleared – 5/22/26
10. 10th Floor	Unit 1-10-1	Cells	105 CMR 451.353	Interior Maintenance: Ceiling paint damaged in cell # 11, 15, and 16 Ceilings repaired – 6/3/26
11. 10th Floor	Unit 1-10-1	Cells	105 CMR 451.353	Interior Maintenance: Door window cracked in cell # 1 and 14 Operations & Planning notified – contractor will replace window glass – anticipated date of repairs no later than 6/28/26
12. 10th Floor	Unit 1-10-2	Common Area	105 CMR 451.353	Interior Maintenance: Ceiling vent dusty Vent cleaned – 5/22/26
13. 10th Floor	Unit 1-10-2	Kitchenette	105 CMR 451.353	Interior Maintenance: Cabinet below handwash sink dirty Cabinet cleaned – 5/22/26
14. 10th Floor	Unit 1-10-2	Cells	105 CMR 451.353	Interior Maintenance: Wall vent blocked in cell # 1 Vent cleared – 5/22/26
15. 10th Floor	Unit 1-10-2	Cells	105 CMR 451.353	Interior Maintenance: Ceiling paint damaged in cell # 10, 12, and 15 Ceilings repaired – 6/3/26

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
16. 10th Floor	Unit 1-10-4 Women's MAT Program	Supply Closet	105 CMR 451.344*	Illumination in Habitable Areas: Light(s) not functioning properly, light out Light repaired – 6/4/26
17. 10th Floor	Unit 1-10-4 Women's MAT Program	Supply Closet	105 CMR 451.353	Interior Maintenance: Wet mop stored in bucket Mop removed and stored properly - 4/27/26
18. 10th Floor	Unit 1-10-4 Women's MAT Program	Exam Room	105 CMR 451.353	Interior Maintenance: Ceiling vent dusty Wall cleaned – 5/22/26
19. 10th Floor	Unit 1-10-4 Women's MAT Program	Exam Room	105 CMR 451.353	Interior Maintenance: Ceiling paint damaged Ceiling repaired – 6/3/26
20. 10th Floor	Unit 1-10-4 Women's MAT Program	Cells	105 CMR 451.353	Interior Maintenance: Cell # 18 generally dirty Cell cleaned – 4/27/26
21. 10th Floor	Unit 1-10-4 Women's MAT Program	Cells	105 CMR 451.353	Interior Maintenance: Ceiling paint damaged in cell # 20 Ceiling repaired – 6/3/26
22. 10th Floor	Unit 1-10-3	Cells	105 CMR 451.353	Interior Maintenance: Ceiling paint damaged in cell # 6 Ceiling repaired – 6/3/26
23. 10th Floor	Unit 1-10-3	Cells	105 CMR 451.353	Interior Maintenance: Wall vent blocked in cell # 1 and 4 Vent cleared – 5/22/26
24. 9th Floor	Slop Sink # 956		105 CMR 451.353*	Interior Maintenance: Slop sink dirty Sink cleaned – 4/27/26
25. 9th Floor	Recreation Deck # 940		105 CMR 451.353*	Interior Maintenance: Ceiling paint damaged Maintenance notified – ceiling will be repaired – anticipated repair date no later than 7/3/26
26. 9th Floor	Recreation Deck # 940		105 CMR 451.353*	Interior Maintenance: Wall paint damaged Maintenance notified – wall will be repaired – anticipated repair date no later than 7/3/26
27. 9th Floor	Recreation Deck # 940		105 CMR 451.353*	Interior Maintenance: Light not secure to ceiling Maintenance notified – light will be secured – anticipated repair date no later than 7/3/26
28. 9th Floor	Programs/Education Offices		105 CMR 451.353	Interior Maintenance: Ceiling vent blocked Vent cleared – 5/22/26
29. 9th Floor	Programs/Education Offices		105 CMR 451.353	Interior Maintenance: Ceiling vent dusty Vent cleaned – 5/22/26
30. 9th Floor	Unit 1-9-1	Common Area	105 CMR 451.353	Interior Maintenance: Wall dusty around vent near television Wall cleaned – 5/22/26
31. 9th Floor	Unit 1-9-1	Common Area	105 CMR 451.353	Interior Maintenance: Vent dusty near Recreation Deck

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
				Vent cleaned – 5/22/26
32. 9th Floor	Unit 1-9-1	Kitchenette	105 CMR 451.353	Interior Maintenance: Cabinet under handwash sink dirty Cabinet cleaned – 5/22/26
33. 9th Floor	Unit 1-9-1	Cells	105 CMR 451.353	Interior Maintenance: Wall vent blocked in cell # 1, 2, 5, and 9 Vents cleared – 5/22/26
34. 9th Floor	Unit 1-9-1	Cells	105 CMR 451.353	Interior Maintenance: Ceiling paint damaged in cell # 7 and 8 Ceilings repaired – 6/3/26
35. 9th Floor	Unit 1-9-2	Kitchenette	105 CMR 451.353	Interior Maintenance: Cabinet under handwash sink dirty Cabinet cleaned – 5/22/26
36. 9th Floor	Unit 1-9-2	Cells	105 CMR 451.353	Interior Maintenance: Ceiling paint damaged in cell # 8 Ceiling repaired – 6/3/26
37. 8th Floor	Unit 1-8-1	Common Area	105 CMR 451.353	Interior Maintenance: Wall vent dusty near television Vent cleaned – 5/22/26
38. 8th Floor	Unit 1-8-1	Laundry Area	105 CMR 451.360	Protective Measures: Rodent droppings observed Area cleaned – exterminator addressed the violation – 6/1/26
39. 8th Floor	Unit 1-8-1	Utility Closet # 834	105 CMR 451.360*	Protective Measures: Rodent droppings observed Area cleaned – exterminator addressed the violation – 6/1/26
40. 8th Floor	Unit 1-8-1	Utility Closet # 834	105 CMR 451.353	Interior Maintenance: Floor dirty Floor cleaned – 4/27/26
41. 8th Floor	Unit 1-8-1	Utility Closet # 834	105 CMR 451.353	Interior Maintenance: Standing water stored in mop bucket Water removed – 4/27/26
42. 8th Floor	Unit 1-8-1	Cells	105 CMR 451.353	Interior Maintenance: Ceiling paint damaged in cell # 3 Ceiling repaired – 6/3/26
43. 8th Floor	Unit 1-8-1	Cells	105 CMR 451.353	Interior Maintenance: Wall vent blocked in cell # 5, 8, 9, 13, 14, and 16 Vents cleared – 5/21/26
44. 8th Floor	Unit 1-8-2	Recreation Deck	105 CMR 451.353	Interior Maintenance: Door knob damaged on 1-8-1 entrance to Recreation Deck Knob replaced – 5/1/26
45. 8th Floor	Unit 1-8-2	Staff Office	105 CMR 451.360	Protective Measures: Rodent droppings observed Area cleaned – exterminator addressed the violation – 6/1/26
46. 8th Floor	Unit 1-8-2	Common Area	105 CMR 451.353	Interior Maintenance: Wall vent dusty near television mount Vent cleaned – 5/22/26
47. 8th Floor	Unit 1-8-2	Common Area	105 CMR 451.353	Interior Maintenance: Ceiling dirty outside of cell # 15 Ceiling cleaned – 5/22/26
48. 8th Floor	Unit 1-8-2	Recreation	105 CMR 451.353	Interior Maintenance: Ceiling vent dusty near

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
		Deck		Recreation Deck Vent cleaned – 5/22/26
49. 8th Floor	Unit 1-8-2	Cells	105 CMR 451.353	Interior Maintenance: Wall vent blocked in cell # 7, 9, and 10 Vents cleared – 5/22/26
50. 6th Floor	Meeting Room and Dining Hall		105 CMR 451.353*	Interior Maintenance: White substance observed on floor under sink Substance removed – 5/23/26
51. 6th Floor	Meeting Room and Dining Hall		105 CMR 451.360*	Protective Measures: Rodent droppings observed on windowsills and floor Area cleaned – exterminator addressed the violation – 6/1/26
52. 6th Floor	Unit 1-6-1	Upper Cells	105 CMR 451.353	Interior Maintenance: Wall vent blocked in cell # 20, 22, 23, 24, 27, 28, 30, 31, and 32 Vents cleared – 5/22/26
53. 6th Floor	Unit 1-6-1	Lower Cells	105 CMR 451.353	Interior Maintenance: Wall vent blocked in cell # 2, 5, 7, 8, 9, 12, and 15 Vents cleared – 5/22/26
54. 6th Floor	Unit 1-6-1	Lower Laundry Area	105 CMR 451.360	Protective Measures: Rodent droppings observed Area cleaned – exterminator addressed the violation – 6/1/26
55. 6th Floor	Unit 1-6-2	Common Area	105 CMR 451.353	Interior Maintenance: Ceiling vent dust near Recreation Deck Vent cleaned – 5/22/26
56. 6th Floor	Unit 1-6-2	Common Area	105 CMR 451.353	Interior Maintenance: Window sill dirty near Recreation Deck Window sill cleaned – 4/27/26
57. 6th Floor	Unit 1-6-2	Office	105 CMR 451.353	Interior Maintenance: Ceiling paint damaged Ceiling repaired – 6/3/26
58. 6th Floor	Unit 1-6-2	Upper Storage Closet # 757	105 CMR 451.360*	Protective Measures: Rodent droppings observed Area cleaned – exterminator addressed the violation – 6/1/26
59. 6th Floor	Unit 1-6-2	Upper Cells	105 CMR 451.353	Interior Maintenance: Wall vent blocked in cell # 17, 20, 25, 31, and 32 Vents cleared – 5/22/26
60. 6th Floor	Unit 1-6-2	Upper Cells	105 CMR 451.353	Interior Maintenance: Ceiling paint damaged in cell # 35 Ceiling repaired – 6/3/26
61. 6th Floor	Unit 1-6-2	Lower Cells	105 CMR 451.353	Interior Maintenance: Ceiling paint damaged in cell # 3 Ceiling repaired – 6/3/26
62. 6th Floor	Unit 1-6-2	Lower Cells	105 CMR 451.353	Interior Maintenance: Wall vent blocked in cell # 3, 9, 11, and 16 Vents cleared – 5/22/26
63. 6th Floor	Unit 1-6-2	Slop Sink Closet	105 CMR 451.353	Interior Maintenance: Objectionable odor observed Odor mitigated – 5/23/26
64. 5th Floor	Unit 1-5-1	Common Area	105 CMR 451.353	Interior Maintenance: Ceiling vent dusty near Recreation Deck

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
				Vent cleaned – 5/22/26
65. 5th Floor	Unit 1-5-1	Utility Closet # 540	105 CMR 451.353	Interior Maintenance: Wet mop stored upside down Mop removed from upside down position and stored properly – 4/27/26
66. 5th Floor	Unit 1-5-1	Utility Closet # 540	105 CMR 451.353	Interior Maintenance: Wet mop stored on floor Mop stored properly – 4/27/26
67. 5th Floor	Unit 1-5-1	Utility Closet # 540	105 CMR 451.353	Interior Maintenance: Standing water stored in bucket Water removed – 4/27/26
68. 5th Floor	Unit 1-5-1	Cells	105 CMR 451.353	Interior Maintenance: Wall vent blocked in cell # 5, 6, 7, 9, 10, 11, 12, 13, 14, 15, and 16 Vents cleared – 5/22/26
69. 5th Floor	Unit 1-5-1	Cells	105 CMR 451.353	Interior Maintenance: Ceiling paint damaged in cell # 8 Ceiling repaired – 6/3/26
70. 4th Floor	Unit 1-4-1	Cells	105 CMR 451.353*	Interior Maintenance: Wall vent blocked in cell # 4, 6, and 7 Vents cleared – 5/22/26
71. 4th Floor	Unit 1-4-1	Cells	105 CMR 451.353	Interior Maintenance: Wall vent blocked in cell # 2, 3, 5, 8, 10, 11, 12, 13, 15, and 16 Vents cleared – 5/22/26
72. 4th Floor	Unit 1-4-2	Common Area	105 CMR 451.353	Interior Maintenance: Ceiling vent dusty near Recreation Deck Vent cleaned – 5/22/26
73. 4th Floor	Unit 1-4-2	Kitchenette	105 CMR 451.360	Protective Measures: Rodent droppings observed below handwash sink Area cleaned – exterminator addressed the violation – 6/1/26
74. 4th Floor	Unit 1-4-2	Kitchenette	105 CMR 451.353	Interior Maintenance: Cabinet under handwash sink dirty Cabinet cleaned – 5/22/26
75. 4th Floor	Unit 1-4-2	Cells	105 CMR 451.353*	Interior Maintenance: Wall vent blocked in cell # 1 Vents cleared – 5/22/26
76. 4th Floor	Unit 1-4-2	Cells	105 CMR 451.353	Interior Maintenance: Wall vent blocked in cell # 2, 6, 7, 9, 15, and 16 Vents cleared – 5/22/26
77. 4th Floor	Unit 1-4-2	Cells	105 CMR 451.353	Interior Maintenance: Bed not secure to wall in cell # 2 Bed secured – 6/4/26
78. 3rd Floor	Supervisor's Office		105 CMR 451.353	Interior Maintenance: Ceiling vent blocked Vent cleared – 5/22/26
79. 3rd Floor	Office # 347		105 CMR 451.353	Interior Maintenance: Ceiling vent blocked Vent cleared – 5/22/26
80. 3rd Floor	Office # 347		105 CMR 451.353	Interior Maintenance: Ceiling vent dusty Vent cleaned – 5/22/26
81. 3rd Floor	Unit 1-3-1	Storage Room # 336	105 CMR 451.360	Protective Measures: Rodent droppings observed Room cleaned – exterminator addressed the violation – 6/1/26

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
82. 3rd Floor	Unit 1-3-1	Cells	105 CMR 451.353*	Interior Maintenance: Wall vent blocked in cell # 3, 4, 5, 11, and 12 Vents cleared – 5/22/26
83. 3rd Floor	Unit 1-3-1	Cells	105 CMR 451.353	Interior Maintenance: Wall vent blocked in cell # 1, 2, 6, 7, 8, and 10 Vents cleared – 5/22/26
84. 3rd Floor	Unit 1-3-1	Recreation Room	105 CMR 451.353	Interior Maintenance: Trash observed on floor Trash removed – 4/27/26
85. 3rd Floor	Unit 1-3-1	Recreation Deck	105 CMR 451.353	Interior Maintenance: Trash observed on floor Trash removed – 4/27/26
86. 3rd Floor	Unit 1-3-1	Recreation Deck	105 CMR 451.353	Interior Maintenance: Ceiling paint damaged Maintenance notified – ceiling will be repaired – anticipated repair date no later than 7/3/26
87. 3rd Floor	Unit 1-3-1	Recreation Deck	105 CMR 451.353	Interior Maintenance: Wall paint damaged Maintenance notified – wall will be repaired – anticipated repair date no later than 7/3/26
88. 3rd Floor	Unit 1-3-2	Recreation Room # 368	105 CMR 451.353	Interior Maintenance: Ceiling dusty outside room Ceiling cleaned – 5/22/26
89. 3rd Floor	Unit 1-3-2	Recreation Room # 368	105 CMR 451.353	Interior Maintenance: Light switch cover missing Cover replaced – 6/4/26
90. 3rd Floor	Unit 1-3-2	Recreation Room # 368	105 CMR 451.353	Interior Maintenance: Walls dirty Walls cleaned – 5/22/26
91. 3rd Floor	Unit 1-3-2	Recreation Room # 368	105 CMR 451.353	Interior Maintenance: Trash observed on floor Trash removed – 4/27/26
92. 3rd Floor	Unit 1-3-2	Recreation Room # 368	105 CMR 451.353	Interior Maintenance: Ceiling vent dusty Vent cleaned – 5/22/26
93. 3rd Floor	Unit 1-3-2	Recreation Room # 368	105 CMR 451.346	Safe Wiring: Inappropriate use of temporary wiring, extension cord through door Extension cord removed – 4/27/26
94. 3rd Floor	Unit 1-3-2	Kitchenette	105 CMR 451.353	Interior Maintenance: Wall vent dusty near Kitchenette Wall cleaned – 5/22/26
95. 3rd Floor	Unit 1-3-2	Kitchenette	105 CMR 451.360	Protective Measures: Rodent droppings observed under handwash sink Area cleaned – exterminator addressed the violation – 6/1/26
96. 3rd Floor	Unit 1-3-2	Kitchenette	105 CMR 451.360	Protective Measures: Cabinet under handwash sink dirty Area cleaned – 5/22/26
97. 3rd Floor	Unit 1-3-2	Cells	105 CMR 451.353*	Interior Maintenance: Wall vent blocked in cell # 1, 2, 4, 6, 7, and 8 Vent cleaned – 5/22/26
98. 3rd Floor	Unit 1-3-2	Cells	105 CMR 451.353	Interior Maintenance: Wall vent blocked in cell # 3, 5, 8, 9, 10, 12, and 15 Vents cleaned – 5/22/26
99. 3rd Floor	Unit 1-3-2	Cells	105 CMR 451.353	Interior Maintenance: Ceiling paint damaged in cell # 1, 2, 3, 4, 5, 7, 8, 10, and 12 Ceilings repaired – 6/5/26
100. 3rd Floor	Unit 1-3-2	Cells	105 CMR 451.353	Interior Maintenance: Door dirty at cell # 8 Door cleaned – 4/27/26

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
101. 2nd Floor			105 CMR 451.353	Interior Maintenance: Ceiling tiles water damaged in hallway Tiles replaced – 6/4/26
102. 2nd Floor			105 CMR 451.353	Interior Maintenance: Ceiling vent dusty in Room # 257 Vent cleaned – 5/22/26
103. 2nd Floor	Mosque # 269		105 CMR 451.353*	Interior Maintenance: Ceiling damaged Ceiling repaired - 6/3/26
104. 2nd Floor	Mosque # 269		105 CMR 451.353*	Interior Maintenance: Mold on ceiling Mold removed – 6/3/36
105. 2nd Floor	Unit 1-2-1	Common Area	105 CMR 451.353*	Interior Maintenance: Ceiling water damaged Ceiling repaired – 6/5/26
106. 2nd Floor	Unit 1-2-1	Slop Sink Room # 229	105 CMR 451.353	Interior Maintenance: Wet mop stored upside down Mop removed from upside down position and stored properly – 4/27/26
107. 2nd Floor	Unit 1-2-1	Slop Sink Room # 229	105 CMR 451.360	Protective Measures: Rodent droppings observed Room cleaned – exterminator addressed the violation – 6/1/26
108. 2nd Floor	Unit 1-2-1	Closet # 236	105 CMR 451.360	Protective Measures: Rodent droppings observed Closet cleaned – exterminator addressed the violation – 6/1/26
109. 2nd Floor	Unit 1-2-1	Cells	105 CMR 451.353*	Interior Maintenance: Ceiling damaged in cell # 28 and 30 Ceiling repaired – 6/5/26
110. 2nd Floor	Unit 1-2-1	Cells	105 CMR 451.353*	Interior Maintenance: Ceiling vent blocked in cell # 21, 28, and 29 Vents cleared – 5/22/26
111. 2nd Floor	Unit 1-2-1	Cells	105 CMR 451.353*	Interior Maintenance: Mold on ceiling in cell # 28 Mold removed – 5/21/26
112. 2nd Floor	Unit 1-2-1	Cells	105 CMR 451.353	Interior Maintenance: Ceiling paint damaged in cell # 14 and 16 Ceilings repaired – 6/5/26
113. 2nd Floor	Unit 1-2-1	Cells	105 CMR 451.353	Interior Maintenance: Ceiling vent blocked in cell # 22, 23, 24, 25, 26, 27, 30, and 31 Vents cleared – 5/22/26
114. 2nd Floor	Unit 1-2-1	Cells	105 CMR 451.353	Interior Maintenance: Door window cracked in cell # 30 Operations & Planning notified – contractor will replace window glass – anticipated date of repairs no later than 6/28/26
115. 2nd Floor	Unit 1-2-1	Laundry Room	105 CMR 451.353	Interior Maintenance: Ceiling paint damaged Ceiling repaired – 6/5/26
116. 1st Floor	Re-Entry Center	Staff Bathroom # 121	105 CMR 451.353	Interior Maintenance: Ceiling damaged Ceiling repaired – 6/5/26

Building #2

Deficiencies under the Required Standards (.100 and .200 series)

1 new deficiency was found during the inspection:

Area	Regulation	Description of Deficiency
1. Staff Lounge	105 CMR 451.200	Food Storage, Preparation and Service: Food storage not in compliance with 105 CMR 590.000, interior of freezer dirty Freezer cleaned – 6/1/26

Building #3

Deficiencies under the Required Standards (.100 and .200 series)

42 new deficiencies and 38 repeat deficiencies (indicated by an *) were found during the inspection:

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
1. 4th Floor	Staff Bathroom		105 CMR 451.123	Maintenance: Ceiling vent dusty Vent cleaned – 5/22/25
2. 4th Floor	Unit 3-3	Staff Bathroom	105 CMR 451.123	Maintenance: Ceiling vent dusty Vent cleaned – 5/22/25
3. 4th Floor	Unit 3-3	Lower Shower Area	105 CMR 451.123*	Maintenance: Ceiling vent dusty in shower # 1, 2, 3, 4, and 5 Vents cleaned – 5/22/25
4. 4th Floor	Unit 3-3	Lower Shower Area	105 CMR 451.123*	Maintenance: Ceiling paint damaged in shower # 2 Ceiling repaired – 6/10/26
5. 4th Floor	Unit 3-3	Lower Shower Area	105 CMR 451.123*	Maintenance: Ceiling damaged outside showers Ceiling repaired – 6/10/26
6. 4th Floor	Unit 3-3	Lower Shower Area	105 CMR 451.123*	Maintenance: Door frame rusted in shower # 4 and 5 Maintenance notified – frame will be repaired – anticipated repair date no later than 7/3/26
7. 4th Floor	Unit 3-3	Lower Shower Area	105 CMR 451.123*	Maintenance: Mold on ceiling in shower # 5 Mold removed – 5/21/26
8. 4th Floor	Unit 3-3	Lower Shower Area	105 CMR 451.123*	Maintenance: Bottom of door frame separating from wall outside shower # 5 Maintenance notified – frame will be repaired– anticipated repair date no later than 7/3/26
9. 4th Floor	Unit 3-3	Lower Shower Area	105 CMR 451.123*	Maintenance: Access panel rusted in shower # 5 Panel repaired – 6/10/26
10. 4th Floor	Unit 3-3	Lower Shower Area	105 CMR 451.123*	Maintenance: Walls dirty in shower # 5 Walls cleaned – 4/28/26
11. 4th Floor	Unit 3-3	Lower Shower Area	105 CMR 451.123	Maintenance: Drain flies observed in shower # 1 Shower cleaned – exterminator addressed the violation – 6/1/26
12. 4th Floor	Unit 3-3	Lower Shower Area	105 CMR 451.123	Maintenance: Door frame rusted in shower # 1 and 3

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
				Maintenance notified – frames will be repaired – anticipated repair date not later than 7/3/26
13. 4th Floor	Unit 3-3	Lower Shower Area	105 CMR 451.123	Maintenance: Door frame damaged in shower # 4 Maintenance notified – frame will be repaired – anticipated repair date not later than 7/3/26
14. 4th Floor	Unit 3-3	Lower Shower Area	105 CMR 451.123	Maintenance: Dead drain flies observed on ceiling in shower # 5 Ceiling cleaned – exterminator addressed the violation – 6/1/26
15. 4th Floor	Unit 3-3	Kitchenette	105 CMR 451.200	Food Storage, Preparation and Service: Food preparation not in compliance with 105 CMR 590.000, interior of microwave oven dirty Microwave cleaned – 4/28/26
16. 4th Floor	Unit 3-3	Upper Shower Area	105 CMR 451.123*	Maintenance: Ceiling vent dusty in shower # 6 and 10 Vents cleaned -5/23/26
17. 4th Floor	Unit 3-3	Upper Shower Area	105 CMR 451.123*	Maintenance: Ceiling paint damaged in shower # 10 Ceiling repaired – 6/10/26
18. 4th Floor	Unit 3-3	Upper Shower Area	105 CMR 451.123*	Maintenance: Door frame paint damaged in shower # 6 Frame repaired – 6/10/26
19. 4th Floor	Unit 3-3	Upper Shower Area	105 CMR 451.123*	Maintenance: Access panel rusted in shower # 10 Panel repaired – 6/10/26
20. 4th Floor	Unit 3-3	Upper Shower Area	105 CMR 451.123*	Maintenance: Walls dirty in shower # 10 Walls cleaned – 4/28/26
21. 4th Floor	Unit 3-3	Upper Shower Area	105 CMR 451.123*	Maintenance: Metal brackets rusted in shower # 10 Maintenance notified – brackets will be repaired – anticipated repair date no later than 7/3/26
22. 4th Floor	Unit 3-3	Upper Shower Area	105 CMR 451.123*	Maintenance: Metal brackets rusted in shower # 10 Maintenance notified – brackets will be repaired– anticipated repair date no later than 7/3/26
23. 4th Floor	Unit 3-3	Upper Shower Area	105 CMR 451.123	Maintenance: Mold on ceiling in shower # 6 and 10 Mold remove – 5/22/26
24. 4th Floor	Unit 3-3	Upper Shower Area	105 CMR 451.123	Maintenance: Ceiling vent dusty in shower # 8 Vent cleaned - 5/23/26
25. 4th Floor	Unit 3-3	Slop Sink Room	105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, drain cover missing at slop sink

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
26. 4th Floor	Unit 3-4	Handicapped Shower # 3491	105 CMR 451.123*	Cover installed – 6/4/26 Maintenance: Wall vent dusty outside shower Vent cleaned – 5/23/26
27. 4th Floor	Unit 3-4	Handicapped Shower # 3491	105 CMR 451.123	Maintenance: Ceiling vent dusty Vent cleaned – 5/23/26
28. 4th Floor	Unit 3-4	Staff Bathroom # 3494	105 CMR 451.123	Maintenance: Ceiling vent dusty Vent cleaned – 5/23/26
29. 4th Floor	Unit 3-4	Lower Shower Area	105 CMR 451.123*	Maintenance: Ceiling vent dusty in shower # 2, 3, and 4 Vents cleaned – 5/23/26
30. 4th Floor	Unit 3-4	Lower Shower Area	105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, shower # 1 and 5 out-of-order Showers repaired and placed back on-line – 6/6/26
31. 4th Floor	Unit 3-4	Lower Shower Area	105 CMR 451.130	Hot Water: Shower water temperature 90°F at shower # 2 Water temperature adjusted to meet the appropriate regulatory requirements – 6/15/26
32. 4th Floor	Unit 3-4	Upper Shower Area	105 CMR 451.123*	Maintenance: Ceiling vent dusty in shower # 6 and 10 Vents cleaned – 4/28/26
33. 4th Floor	Unit 3-4	Upper Shower Area	105 CMR 451.123*	Maintenance: Walls dirty in shower # 7 Walls cleaned – 4/28/26
34. 4th Floor	Unit 3-4	Upper Shower Area	105 CMR 451.123*	Maintenance: Floor damaged around drain in shower # 10 Floor repaired – 6/9/26
35. 4th Floor	Unit 3-4	Upper Shower Area	105 CMR 451.123	Maintenance: No curtain at shower # 6 Curtain installed – 5/23/26
36. 4th Floor	Unit 3-4	Upper Shower Area	105 CMR 451.123	Maintenance: Ceiling vent dusty in shower # 7 Vents cleaned – 5/23/26
37. 4th Floor	Unit 3-4	Upper Shower Area	105 CMR 451.123	Maintenance: Mold on wall in shower # 7 Mold removed – 5/22/26
38. 4th Floor	Unit 3-4	Upper Shower Area	105 CMR 451.123	Maintenance: Wall paint damaged in shower # 7 Wall repaired – 6/8/26
39. 4th Floor	Unit 3-4	Upper Shower Area	105 CMR 451.123	Maintenance: Ceiling paint damaged in shower # 9 Ceiling repaired – 6/8/26
40. 4th Floor	Unit 3-4	Cells	105 CMR 451.103	Mattresses: Mattress cover missing in cell # 22 and 56 Mattresses replaced – 5/23/26
41. 4th Floor	Unit 3-4	Cells	105 CMR 451.101	Blankets: Blanket damaged in cell # 39 Blanket replaced -5/23/26
42. 3rd Floor	Staff Bathroom		105 CMR 451.123	Maintenance: Ceiling vent dusty

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
	# 3378			Vent cleaned - 5/23/26
43. 2nd Floor	Unit 3-1	Lower Shower Area	105 CMR 451.123	Maintenance: Door frame rusted in shower # 5 Maintenance notified – frame will be repaired – anticipated repair date no later than 7/3/26
44. 2nd Floor	Unit 3-1	Cells	105 CMR 451.103	Mattresses: Mattress cover missing in cell # 41 Mattresses replaced – 5/23/26
45. 2nd Floor	Unit 3-2	Handicapped Shower # 3293	105 CMR 451.123	Maintenance: Debris in floor drain Debris removed – 4/28/26
46. 2nd Floor	Unit 3-2	Lower Shower Area	105 CMR 451.123*	Maintenance: Ceiling paint damaged in shower # 4 Ceiling repaired – 6/3/26
47. 2nd Floor	Unit 3-2	Lower Shower Area	105 CMR 451.123*	Maintenance: Floor damaged around drain in shower # 5 Floor repaired – 6/15/26
48. 2nd Floor	Unit 3-2	Lower Shower Area	105 CMR 451.123*	Maintenance: Walls dirty in shower # 4 Walls cleaned – 4/28/26
49. 2nd Floor	Unit 3-2	Lower Shower Area	105 CMR 451.123*	Maintenance: Ceiling vent dusty in shower # 1 Vent cleaned – 5/22/26
50. 2nd Floor	Unit 3-2	Lower Shower Area	105 CMR 451.123*	Maintenance: Dead drain flies observed on ceiling in shower # 4 Ceiling cleaned – exterminator addressed the violation – 6/1/26
51. 2nd Floor	Unit 3-2	Lower Shower Area	105 CMR 451.123*	Maintenance: Door frame rusted in shower # 4 Maintenance notified – frame will be repaired – anticipated repair date no later than 7/3/26
52. 2nd Floor	Unit 3-2	Lower Shower Area	105 CMR 451.123	Maintenance: Objectionable odor observed in shower # 2 and 5 Odor mitigated – 4/28/26
53. 2nd Floor	Unit 3-2	Kitchenette	105 CMR 451.200*	Food Storage, Preparation and Service: Food preparation not in compliance with 105 CMR 590.000, interior of microwave oven # 1 dirty Microwave cleaned – 4/28/26
54. 2nd Floor	Unit 3-2	Kitchenette	105 CMR 451.200	Food Storage, Preparation and Service: Food preparation not in compliance with 105 CMR 590.000, interior of microwave oven # 2 dirty Microwave cleaned – 4/28/26
55. 2nd Floor	Unit 3-2	Kitchenette	105 CMR 451.200	Food Storage, Preparation and Service: Food preparation not in compliance with 105 CMR 590.000, handle missing

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
				on microwave oven # 2 Microwave replaced – 6/1/26
56. 2nd Floor	Unit 3-2	Upper Shower Area	105 CMR 451.123*	Maintenance: Dead drain flies observed on ceiling in shower # 10 Ceiling cleaned – exterminator addressed the violation – 6/1/26
57. 2nd Floor	Unit 3-2	Upper Shower Area	105 CMR 451.123	Maintenance: Dead drain flies observed on ceiling in shower # 7 Ceiling cleaned – exterminator addressed the violation – 6/1/26
58. 2nd Floor	Unit 3-2	Upper Shower Area	105 CMR 451.123*	Maintenance: Walls dirty in shower # 7 Walls cleaned – 4/28/26
59. 2nd Floor	Unit 3-2	Cells	105 CMR 451.103	Mattresses: Mattress damaged in cell # 22 Mattress replaced – 5/23/26
60. 2nd Floor	Unit 3-2	Cells	105 CMR 451.103	Mattresses: Mattress cover missing in cell # 38, 45, and 54 Mattresses replaced – 5/23/36
61. 1st Floor	Education Area	Inmate Bathroom # 3162	105 CMR 451.123	Maintenance: Ceiling paint damaged Ceiling repaired – 6/2/26
62. 1st Floor	Education Area	Inmate Bathroom # 3162	105 CMR 451.123	Maintenance: Floor paint damaged Floor repaired – 6/2/26
63. 1st Floor	Education Area	Inmate Bathroom # 3162	105 CMR 451.123	Maintenance: Standing water on floor Water removed – 4/28/26
64. 1st Floor	Canteen	Canteen Bathroom	105 CMR 451.123	Maintenance: Ceiling vent dusty Vent cleaned – 5/23/36

Deficiencies under the Recommended Standards (.300 series)

93 new deficiencies and 47 repeat deficiencies (indicated by an *) were found during the inspection:

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
1. All Cells			105 CMR 451.320*	Cell Size: Inadequate floor space in all cells Cell design does not allow the facility to provide adequate floor space
2. 4th Floor	Unit 3-3	Common Area	105 CMR 451.353*	Interior Maintenance: Wall damaged near stairs near cell # 13 Maintenance notified – wall will be repaired – anticipated repair date not later than 7/3/26
3. 4th Floor	Unit 3-3	Case Worker's Office	105 CMR 451.353	Interior Maintenance: Ceiling vent blocked Vent cleared – 5/23/26
4. 4th Floor	Unit 3-3	Case Worker's Office	105 CMR 451.353	Interior Maintenance: Ceiling vent dusty Vent cleaned – 5/23/26

	Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
5.	4th Floor	Unit 3-3	Lower Laundry Area	105 CMR 451.353	Interior Maintenance: Dryer vent not properly connected Vent reconnected – 5/23/26
6.	4th Floor	Unit 3-3	Kitchenette	105 CMR 451.353	Interior Maintenance: Ceiling beam damaged near Kitchenette Maintenance notified –beam will be repaired – anticipated repair date no later than 7/3/26
7.	4th Floor	Unit 3-3	Upper Laundry Area	105 CMR 451.360*	Protective Measures: Rodent droppings observed Area cleaned – exterminator addressed the violation – 6/1/26
8.	4th Floor	Unit 3-3	Slop Sink Room	105 CMR 451.360*	Protective Measures: Rodent droppings observed Room cleaned – exterminator addressed the violation – 6/1/26
9.	4th Floor	Unit 3-3	Slop Sink Room	105 CMR 451.353*	Interior Maintenance: Ceiling vent dusty Vent cleaned – 5/23/26
10.	4th Floor	Unit 3-3	Uniform Storage Room # 3566	105 CMR 451.360	Protective Measures: Rodent droppings observed Room cleaned – exterminator addressed the violation – 6/1/26
11.	4th Floor	Unit 3-3	Cells	105 CMR 451.353*	Interior Maintenance: Wall vent blocked in cell # 20, 22, 28, 30, 34, 35, 37, 46, 48, 61, 62, and 63 Vents cleared – 5/23/26
12.	4th Floor	Unit 3-3	Cells	105 CMR 451.353*	Interior Maintenance: Ceiling paint damaged in cell # 10, 40, and 43 Ceilings repaired – 6/4/26
13.	4th Floor	Unit 3-3	Cells	105 CMR 451.353	Interior Maintenance: Food debris in window sill near cell # 60 Food debris removed – 4/28/26
14.	4th Floor	Unit 3-3	Cells	105 CMR 451.353	Interior Maintenance: Wall dirty near cell # 16 and 28 Walls cleaned – 4/28/26
15.	4th Floor	Unit 3-3	Cells	105 CMR 451.353	Interior Maintenance: Ceiling paint damaged in cell # 15, 29, 34, 37, 38, 39, 42, 45, 46, 49, 61, and 63 Vents cleared – 5/23/26
16.	4th Floor	Unit 3-3	Cells	105 CMR 451.353	Interior Maintenance: Wall vent blocked in cell # 24, 33, 34, 41, 47, 49, 51, 52, 55, 59, and 64 Vents cleared – 5/23/26
17.	4th Floor	Unit 3-3	Cells	105 CMR 451.360	Protective Measures: Rodent droppings observed on window sill near cell # 28 Ceiling cleaned – exterminator addressed the violation – 6/1/26
18.	4th Floor	Unit 3-4	Common Area	105 CMR 451.353*	Interior Maintenance: Floor tiles

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
				missing and damaged Maintenance notified – floor tiles will be replaced – anticipated repair date no later than 7/6/26
19. 4th Floor	Unit 3-4	Recreation Deck	105 CMR 451.353*	Interior Maintenance: Wall paint damaged Maintenance notified – wall will be repaired – anticipated repair date no later than 7/3/26
20. 4th Floor	Unit 3-4	Recreation Deck	105 CMR 451.350	Structural Maintenance: Wall panels rotted on Recreation Deck Maintenance notified – panels will be repaired – anticipated repair date no later than 7/8/26
21. 4th Floor	Unit 3-4	Closet # 3492	105 CMR 451.353	Interior Maintenance: Floor dirty Floor cleaned – 4/28/26
22. 4th Floor	Unit 3-4	Lower Laundry Area	105 CMR 451.353	Interior Maintenance: Dryer vent not connected properly Vent reconnected – 5/23/26
23. 4th Floor	Unit 3-4	Uniform Storage # 3581	105 CMR 451.360*	Protective Measures: Rodent droppings observed Room cleaned – exterminator addressed the violation – 6/1/26
24. 4th Floor	Unit 3-4	Uniform Storage # 3581	105 CMR 451.344	Illumination in Habitable Areas: Light(s) not functioning properly, light out Light repaired – 6/4/26
25. 4th Floor	Unit 3-4	Cells	105 CMR 451.353*	Interior Maintenance: Wall vent blocked in cell # 3, 17, 21, 22, 26, 27, 43, and 51 Vents cleared – 5/23/26
26. 4th Floor	Unit 3-4	Cells	105 CMR 451.353*	Interior Maintenance: Ceiling paint damaged in cell # 8, 10, 11, 13, 15, 28, 43, 45, and 60 Ceilings repaired – 6/8/26
27. 4th Floor	Unit 3-4	Cells	105 CMR 451.353	Interior Maintenance: Wall vent blocked in cell # 7, 13, 14, 16, 19, and 46 Vents cleared – 5/23/26
28. 4th Floor	Unit 3-4	Cells	105 CMR 451.353	Interior Maintenance: Wall paint damaged in cell # 4, 40, 58, and 59 Walls repaired – 6/8/26
29. 4th Floor	Unit 3-4	Cells	105 CMR 451.353	Interior Maintenance: Ceiling paint damaged in cell # 21, 23, 30, and 64 Ceilings repaired – 6/8/26
30. 2nd Floor	Unit 3-1	Case Worker's Office # 3269	105 CMR 451.353	Interior Maintenance: Ceiling vent dusty Vent cleaned – 5/23/26
31. 2nd Floor	Unit 3-1	Kitchenette	105 CMR 451.353	Interior Maintenance: Floor dirty under handwash sink Floor cleaned – 4/28/26

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
32. 2nd Floor	Unit 3-1	Common Area	105 CMR 451.353	Interior Maintenance: Floor dirty in mechanical room between cell # 5 and 6 Vents cleaned – 5/23/26
33. 2nd Floor	Unit 3-1	Common Area	105 CMR 451.360	Protective Measures: Rodent droppings observed on floor in mechanical room between cell # 5 and 6 Room cleaned – exterminator addressed the violation – 6/1/26
34. 2nd Floor	Unit 3-1	Cells	105 CMR 451.353*	Interior Maintenance: Wall vent blocked in cell # 62 Vent cleared – 5/23/26
35. 2nd Floor	Unit 3-1	Cells	105 CMR 451.353	Interior Maintenance: Wall vent blocked in cell # 2, 4, 5, 14, 22, 33, 40, 43, 58, and 59 Vents cleared – 5/23/26
36. 2nd Floor	Unit 3-1	Cells	105 CMR 451.344	Illumination in Habitable Areas: Light(s) not functioning properly, light out in cell # 19 Light repaired – 6/15/26
37. 2nd Floor	Unit 3-1	Cells	105 CMR 451.353	Interior Maintenance: Ceiling paint damaged in cell # 2, 15, 47, and 58 Ceilings repaired – 6/4/26
38. 2nd Floor	Unit 3-2	Storage Closet # 3294	105 CMR 451.353	Interior Maintenance: Standing water stored in mop bucket Water removed – 4/28/26
39. 2nd Floor	Unit 3-2	Upper Laundry Area	105 CMR 451.360	Protective Measures: Rodent droppings observed Area cleaned – exterminator addressed the violation – 6/1/26
40. 2nd Floor	Unit 3-2	Cells	105 CMR 451.353*	Interior Maintenance: Ceiling paint damaged in cell # 21 and 35 Ceilings repaired – 6/4/26
41. 2nd Floor	Unit 3-2	Cells	105 CMR 451.353*	Interior Maintenance: Wall vent blocked in cell # 27 Vent cleared – 5/23/26
42. 2nd Floor	Unit 3-2	Cells	105 CMR 451.353	Interior Maintenance: Ceiling paint damaged in cell # 4, 8, 16, 25, 33, 36, 46, and 49 Ceilings repaired – 6/4/26
43. 2nd Floor	Unit 3-2	Cells	105 CMR 451.353	Interior Maintenance: Wall vent blocked in cell # 8, 10, 11, 16, 20, 24, 55, and 62 Vents cleared – 5/23/26
44. 2nd Floor	Unit 3-2	Cells	105 CMR 451.353	Interior Maintenance: Wall paint damaged in cell # 15 and 25 Walls repaired – 6/4/26
45. 2nd Floor	Unit 3-2	Cells	105 CMR 451.353	Interior Maintenance: Ceiling water damaged in cell # 56 Ceiling repaired – 6/4/26

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
46. 1st Floor	Education Area		105 CMR 451.353	Interior Maintenance: Ceiling water damaged throughout Maintenance notified – ceiling will be repaired – anticipated repair date no later than 7/6/26
47. 1st Floor	Education Area	Classrooms	105 CMR 451.353*	Interior Maintenance: Mold on ceiling outside of Room # 3132 Ceiling cleaned – mold removed - – 5/20/26
48. 1st Floor	MAT Outside Classroom		105 CMR 451.350*	Structural Maintenance: Ceiling tiles missing and water damaged Tiles replaced – 6/15/26
49. 1st Floor	Canteen		105 CMR 451.350*	Structural Maintenance: Ceiling tiles missing and water damaged Tiles replaced / installed – 6/15/26
50. 1st Floor	Main Laundry	Hallway	105 CMR 451.353	Interior Maintenance: Area around ceiling vent dusty Area cleaned – 6/1/26

Building #4

Deficiencies under the Required Standards (.100 and .200 series)

47 new deficiencies and 13 repeat deficiencies (indicated by an *) were found during the inspection:

Area	Sub Area # 1	Regulation	Description of Deficiency
1. Unit 4-1	Common Area	105 CMR 451.200	Food Storage, Preparation and Service: Food preparation not in compliance with 105 CMR 590.000, interior of microwave oven dirty near telephones and cell # 5 Microwave cleaned – 4/29/26
2. Unit 4-1	Lower Shower Area	105 CMR 451.123	Maintenance: Ceiling vent dusty in shower # 1 Vent cleaned – 5/23/26
3. Unit 4-1	Lower Shower Area	105 CMR 451.123	Maintenance: Drain flies observed in shower # 2 and 3 Showers cleaned - exterminator addressed the violation – 6/1/26
4. Unit 4-1	Lower Shower Area	105 CMR 451.123	Maintenance: No curtain at shower # 4 Curtain installed – 5/24/26
5. Unit 4-1	Lower Shower Area	105 CMR 451.123	Maintenance: Debris in drain in shower # 5 Debris removed - 4/29/26
6. Unit 4-1	Upper Shower Area	105 CMR 451.123*	Maintenance: Walls dirty in shower # 7, 8, 9, and 12 Walls cleaned – 4/29/26
7. Unit 4-1	Upper Shower Area	105 CMR 451.123*	Maintenance: Ceiling vent dusty in shower # 8 Vent cleaned – 5/24/26
8. Unit 4-1	Upper Shower Area	105 CMR 451.123	Maintenance: Walls dirty in shower # 10 Walls cleaned – 4/29/26
9. Unit 4-1	Upper Shower Area	105 CMR 451.123	Maintenance: Ceiling vent dusty in shower # 7 Vent cleaned – 5/24/26
10. Unit 4-1	Upper Shower Area	105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, shower # 9 leaking Shower repaired - 6/4/26

Area	Sub Area # 1	Regulation	Description of Deficiency
11. Unit 4-1	Cells	105 CMR 451.103	Mattresses: Mattress cover missing in cell # 20 Mattress replaced – 5/24/26
12. Unit 4-2	Kitchenette	105 CMR 451.200	Food Storage, Preparation and Service: Food preparation not in compliance with 105 CMR 590.000, interior of microwave oven dirty Microwave cleaned – 4/29/26
13. Unit 4-2	1st Tier Bathroom # 4257 and 4268	105 CMR 451.123	Maintenance: Ceiling vent dusty Vent cleaned – 5/24/26
14. Unit 4-2	1st Tier Bathroom # 4257 and 4268	105 CMR 451.123	Maintenance: Drain flies observed Area cleaned – exterminator addressed the violation – 6/1/26
15. Unit 4-2	1st Tier Bathroom # 4257 and 4268	105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, handwash sink # 1 out-of-order Sink repaired -placed back on-line – 6/4/26
16. Unit 4-2	1st Tier Bathroom # 4257 and 4268	105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, urinal # 1 out-of-order Urinal repaired - placed back on-line – 6/4/26
17. Unit 4-2	1st Tier Bathroom # 4257 and 4268	105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, toilet # 5 out-of-order Toilet repaired - placed back on-line – 6/4/26
18. Unit 4-2	1st Tier Bathroom # 4257 and 4268	105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, handwash sink # 7 leaking Sink repaired – 6/4/26
19. Unit 4-2	1st Tier Bathroom # 4257 and 4268	105 CMR 451.123	Maintenance: Standing water observed on floor Water removed – 4/29/26
20. Unit 4-2	1st Tier Bathroom # 4285 and 4275	105 CMR 451.130*	Plumbing: Plumbing not maintained in good repair, toilet # 1 out-of-order Toilet repaired - placed back on-line – 6/4/26
21. Unit 4-2	1st Tier Bathroom # 4285 and 4275	105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, toilet # 2 out-of-order Toilet repaired - placed back on-line – 6/4/26
22. Unit 4-2	2nd Tier Bathroom # 4366 and 4354	105 CMR 451.123	Maintenance: Floor dirty Floor cleaned – 4/29/26
23. Unit 4-2	2nd Tier Bathroom # 4366 and 4354	105 CMR 451.123	Maintenance: Dead insects observed on floor Floor cleaned – 5/20/26
24. Unit 4-2	2nd Tier Bathroom # 4374 and 4387	105 CMR 451.117	Toilet Fixtures: Toilet fixtures dirty in stall # 1, 2, and 4 Fixtures cleaned – 5/24/26
25. Unit 4-2	2nd Tier Bathroom # 4374 and 4387	105 CMR 451.117	Toilet Fixtures: Urinal # 3 dirty Urinal cleaned – 5/24/26
26. Unit 4-2	2nd Tier Bathroom # 4374 and 4387	105 CMR 451.123	Maintenance: Floor dirty Floor cleaned – 5/24/26
27. Unit 4-3	Common Area	105 CMR 451.200	Food Storage, Preparation and Service: Food preparation not in compliance with 105 CMR 590.000, interior of microwave oven dirty near cell # 5 and 8 Microwave cleaned – 4/29/26
28. Unit 4-3	Lower Shower Area	105 CMR 451.123*	Maintenance: Walls dirty in shower # 1, 2, and 3 Walls cleaned – 4/29/26
29. Unit 4-3	Lower Shower Area	105 CMR 451.123*	Maintenance: Ceiling vent dusty in shower # 1, 2, and 3

Area	Sub Area # 1	Regulation	Description of Deficiency
			Vents cleaned – 4/29/26
30. Unit 4-3	Lower Shower Area	105 CMR 451.123	Maintenance: Drain flies observed in shower # 1, 5, and 6 Shower cleaned – exterminator addressed violation – 6/1/26
31. Unit 4-3	Lower Shower Area	105 CMR 451.123	Maintenance: Door frame rusted in shower # 1, 2, 3, 4, and 5 Maintenance notified – frames will be repaired – anticipated date of repairs no later than 7/6/26
32. Unit 4-3	Lower Shower Area	105 CMR 451.123	Maintenance: Curtain dirty in shower # 2 and 4 Curtains replaced – 5/24/26
33. Unit 4-3	Lower Shower Area	105 CMR 451.123	Maintenance: Ceiling vent dusty in shower # 6 Vent cleaned – 5/24/26
34. Unit 4-3	Upper Shower Area	105 CMR 451.123*	Maintenance: Ceiling vent dusty in shower # 8 Vent cleaned – 5/24/26
35. Unit 4-3	Upper Shower Area	105 CMR 451.123	Maintenance: Ceiling vent dusty in shower # 7, 9, 10, and 11 Vents cleaned – 5/24/26
36. Unit 4-3	Upper Shower Area	105 CMR 451.123	Maintenance: Walls dirty in shower # 8 and 11 Walls cleaned – 4/29/26
37. Unit 4-3	Upper Shower Area	105 CMR 451.123	Maintenance: Drain flies observed in shower # 12 Shower cleaned – exterminator addressed violation – 6/1/26
38. Unit 4-3	Upper Shower Area	105 CMR 451.123	Maintenance: Dead drain flies observed on ceiling in shower # 12 Ceiling cleaned – exterminator addressed violation – 6/1/26

Deficiencies under the Recommended Standards (.300 series)

4 new deficiencies and 1 repeat deficiency (indicated by an *) were found during the inspection:

Area	Sub Area # 1	Regulation	Description of Deficiency
1. Dining Hall # 4137		105 CMR 451.353	Interior Maintenance: Wet mop stored in bucket Mop removed – 4/29/26
2. Unit 4-2	Common Area	105 CMR 451.353	Interior Maintenance: Ceiling vents dusty Vents cleaned – 5/24/26
3. Unit 4-2	Common Area	105 CMR 451.353	Interior Maintenance: Ceiling tiles dusty Tiles cleaned – 6/8/26
4. Unit 4-2	Laundry Area	105 CMR 451.353	Interior Maintenance: Dryer vent not properly connected Vent reconnected – 5/24/26
5. Unit 4-2	2nd Tier Utility Room # 4388	105 CMR 451.360*	Protective Measures: Rodent droppings observed Room cleaned – exterminator addressed the violation – 6/1/26

Building #5

Deficiencies under the Required Standards (.100 and .200 series)

70 new deficiencies and 40 repeat deficiencies (indicated by an *) were found during the inspection:

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
1. Food Service	Section 1	Inmate Locker	105 CMR 451.123*	Maintenance: Soap dispenser

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
Area		Room		damaged Dispenser replaced – 6/8/26
2. Food Service Area	Section 1	Inmate Locker Room	105 CMR 451.123*	Maintenance: Floor paint damaged Painting Supervisor notified – floor will be repaired – anticipated repair date no later than 7/6/26
3. Food Service Area	Section 1	Inmate Locker Room	105 CMR 451.123*	Maintenance: Ceiling dirty Ceiling cleaned – 5/20/26
4. Food Service Area	Section 1	Inmate Locker Room	105 CMR 451.123*	Maintenance: Insects observed Room cleaned – exterminator addressed the violation – 6/1/26
5. Food Service Area	Section 1	Inmate Locker Room	105 CMR 451.123*	Maintenance: Encrusted food debris on trash can Trash can cleaned – 4/27/26
6. Food Service Area	Section 1	Slop Sink Room	105 CMR 451.200*	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Facility not cleaned as often as necessary, standing water observed. Standard found in 105 CMR 590; FC 6-501.12(A). Water removed – 4/27/26
7. Food Service Area	Section 1	Slop Sink Room	105 CMR 451.200	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Wet mop stored in bucket. Standard found in 105 CMR 590; FC 6-501.16. Mop removed – 4/27/26
8. Food Service Area	Section 1	Slop Sink Room	105 CMR 451.200	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Standing water stored in mop bucket. Standard found in 105 CMR 590; FC 6-501.16. Water removed – 4/27/26
9. Food Service Area	Section 1	Slop Sink Room	105 CMR 451.200	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Facility not cleaned as often as necessary, slop sink dirty. Standard found in 105 CMR 590; FC 6-501.12(A). Sink cleaned – 4/27/26
10. Food Service Area	Section 1	Chemical Storage	105 CMR 451.200*	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Premises not maintained free of rodents, rodent droppings observed.

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
				Standard found in 105 CMR 590; FC 6-501.111. ** Corrected On-Site **
11. Food Service Area	Section 1	Chemical Storage	105 CMR 451.200	Design, Construction, and Installation; Functionality: Outer openings not protected against the entry of insects and rodents, exterior door damaged. Standard found in 105 CMR 590; FC 6-202.15(A)(3). Door sweep installed - 6/5/26
12. Food Service Area	Section 1	Staff Bathroom	105 CMR 451.123	Maintenance: Ceiling vent dusty Vent cleaned – 5/22/26
13. Food Service Area	Section 1	Mechanical Warewashing Area	105 CMR 451.200*	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Facility not cleaned as often as necessary, mold on wall above single compartment sink. Standard found in 105 CMR 590; FC 6-501.12(A). Wall cleaned – mold removed - 5/21/26
14. Food Service Area	Section 1	Mechanical Warewashing Area	105 CMR 451.200*	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Facility not cleaned as often as necessary, ceiling dirty. Standard found in 105 CMR 590; FC 6-501.12(A). Ceiling cleaned - mold removed– 5/22/26
15. Food Service Area	Section 1	Mechanical Warewashing Area	105 CMR 451.200*	Maintenance and Operation, Equipment: Inadequate water temperature in the mechanical warewashing machine (Pf), temperature recorded at 153°F. Standard found in 105 CMR 590; FC 4-501.112(A)(2). Warewashing machine's temperature adjusted to the appropriate regulatory temperature – 5/4/26
16. Food Service Area	Section 1	Mechanical Warewashing Area	105 CMR 451.200*	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Facility not cleaned as often as necessary, mold on ceiling. Standard found in 105 CMR 590; FC 6-501.12(A). Ceiling cleaned - mold removed – 5/22/26

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
17. Food Service Area	Section 1	Mechanical Warewashing Area	105 CMR 451.200*	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Facility not cleaned as often as necessary, walls dirty. Standard found in 105 CMR 590; FC 6-501.12(A). Walls cleaned – 4/27/26
18. Food Service Area	Section 1	Mechanical Warewashing Area	105 CMR 451.200	Cleaning of Equipment and Utensils, Objective: Nonfood contact surfaces of equipment dirty, splash curtain dirty on warewash machine. Standard found in 105 CMR 590; FC 4-601.11(C). Curtain cleaned – 5/22/26
19. Food Service Area	Section 1	Mechanical Warewashing Area	105 CMR 451.200	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Facility not in good repair, junction box cover missing. Standard found in 105 CMR 590; FC 6-501.11. Cover replaced – 5/4/26
20. Food Service Area	Section 1	Mechanical Warewashing Area	105 CMR 451.200	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Facility not in good repair, outlet cover missing below wall fan. Standard found in 105 CMR 590; FC 6-501.11. Cover replaced – 5/4/26
21. Food Service Area	Section 1	Mechanical Warewashing Area	105 CMR 451.200	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Facility not cleaned as often as necessary, wall mounted fan dusty. Standard found in 105 CMR 590; FC 6-501.12(A). ** Corrected On-Site **
22. Food Service Area	Section 1	Mechanical Warewashing Area	105 CMR 451.200	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Premises not maintained free of rodents, rodent droppings observed. Standard found in 105 CMR 590; FC 6-501.111. Area cleaned – exterminator addressed violation – 6/1/26
23. Food Service Area	Section 1	Mechanical Warewashing Area	105 CMR 451.200	Maintenance and Operation; Premises, Structure,

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
				Attachments, and Fixtures - Methods: Facility not cleaned as often as necessary, drying racks dirty. Standard found in 105 CMR 590; FC 6-501.12(A). Drying racks cleaned – 4/27/26
24. Food Service Area	Section 1	Mechanical Warewashing Area	105 CMR 451.200	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Premises not maintained free of insects, drain flies observed. Standard found in 105 CMR 590; FC 6-501.111. Area cleaned – exterminator addressed violation – 4/29/26
25. Food Service Area	Section 1	Mechanical Warewashing Area	105 CMR 451.200	Maintenance and Operation; Equipment: Warewashing machine not operating in accordance with manufacturer's instructions, warewash machine leaking. Standard found in 105 CMR 590; FC 4-501.15(A). Leak repaired – 4/29/26
26. Food Service Area	Section 1	Mechanical Warewashing Area	105 CMR 451.200	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Facility not cleaned as often as necessary, standing water observed. Standard found in 105 CMR 590; FC 6-501.12(A). Water removed – 4/27/26
27. Food Service Area	Section 1	Mechanical Warewashing Area	105 CMR 451.200	Plumbing System; Operation and Maintenance: Plumbing system not maintained in good repair. pipe in ceiling leaking into single compartment sink. Standard found in 105 CMR 590; FC 5-205.15(B). Maintenance notified – leak will be repaired – anticipated date of repair no later than 7/6/26
28. Food Service Area	Section 1	Pot Wash Area	105 CMR 451.200*	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Premises not maintained free of insects, drain flies observed. Standard found in 105 CMR 590; FC 6-501.111. Area cleaned – exterminator addressed the violation – 6/5/26

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
29. Food Service Area	Section 1	Pot Wash Area	105 CMR 451.200	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Facility not cleaned as often as necessary, signage hung on wall moldy. Standard found in 105 CMR 590; FC 6-501.12(A). Signage replaced– 5/22/26
30. Food Service Area	Section 1	Pot Wash Area	105 CMR 451.200*	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Facility not in good repair, wall damaged. Standard found in 105 CMR 590; FC 6-501.11. Maintenance notified – wall will be repaired - anticipated repair date not later than 7/6/26
31. Food Service Area	Section 1	Pot Wash Area	105 CMR 451.200*	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Facility not cleaned as often as necessary, sprayer head dirty. Standard found in 105 CMR 590; FC 6-501.12(A). Sprayer head cleaned – 4/29/26
32. Food Service Area	Section 1	Pot Wash Area	105 CMR 451.200*	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Non-functional equipment not repaired or removed from premises, garbage disposal out-of-order. Standard found in 105 CMR 590; FC 6-501.114(A). Food service contractor notified – disposal will be replaced - anticipated repair date no later than 7/10/26
33. Food Service Area	Section 1	Pot Wash Area	105 CMR 451.200*	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Facility not cleaned as often as necessary, standing water observed on floor. Standard found in 105 CMR 590; FC 6-501.12(A). Water removed – 4/27/26
34. Food Service Area	Section 1	Pot Wash Area	105 CMR 451.200*	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures -

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
				Methods: Facility not cleaned as often as necessary, walls dirty. Standard found in 105 CMR 590; FC 6-501.12(A). Walls cleaned – 4/27/26
35. Food Service Area	Section 1	Pot Wash Area	105 CMR 451.200*	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Facility not cleaned as often as necessary, mold on walls. Standard found in 105 CMR 590; FC 6-501.12(A). Walls cleaned- 4/27/26
36. Food Service Area	Section 1	Pot Wash Area	105 CMR 451.200*	Design, Construction, and Installation; Cleanability: Floors not smooth and easily cleanable. floor damaged. Standard found in 105 CMR 590; FC 6-201.11. Operations and Planning notified – contractor contacted to make necessary repairs – anticipated date of repairs no later than 7/10/26
37. Food Service Area	Section 1	Pot Wash Area	105 CMR 451.200	Plumbing System; Operation and Maintenance: Plumbing system not maintained in good repair, middle sink compartment leaking. Standard found in 105 CMR 590; FC 5-205.15(B). Sink repaired – 6/4/26
38. Food Service Area	Section 1	Pot Wash Handwash Sink	105 CMR 451.200	Plumbing System; Operation and Maintenance: Plumbing system not maintained in good repair, handwash sink out-of-order. Standard found in 105 CMR 590; FC 5-205.15(B). ** Corrected On-Site **
39. Food Service Area	Section 1	Pot Wash Handwash Sink	105 CMR 451.200	Numbers and Capacity; Handwashing Sinks: No soap at handwash sink(Pf). Standard found in 105 CMR 590.000, FC 6-301.11. ** Corrected On-Site **
40. Food Service Area	Section 1	Tray Area Handwash Sink	105 CMR 451.200*	Plumbing System; Design, Construction and Installation: Insufficient hot water temperature at handwashing sinks (Pf), temperature recorded at 87°F. Standard found in 105 CMR 590; FC 5-202.12(A). Water temperature adjusted to meet the appropriate regulatory

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency requirements – 6/15/26
41. Food Service Area	Section 1	Tray Area Handwash Sink	105 CMR 451.200*	Plumbing System; Operations and Maintenance: Handwashing sink not accessible (Pf), cart stored in front of handwash sink. Standard found in 105 CMR 590; FC 5-205.11(A). Cart removed – 4/27/29
42. Food Service Area	Section 1	Tray Area Handwash Sink	105 CMR 451.200	Numbers and Capacity; Handwashing Sinks: No hand drying method available at handwashing sink (Pf). Standard found in 105 CMR 590; FC 6-301.12. ** Corrected On-Site **
43. Food Service Area	Section 1	Tray Area Handwash Sink	105 CMR 451.200	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Facility not in good repair, paper towel dispenser not working properly. Standard found in 105 CMR 590; FC 6-501.11. Towel dispenser repaired – 5/22/26
44. Food Service Area	Section 2	Prep Table/Sink	105 CMR 451.200*	Maintenance and Operation; Equipment: Quaternary ammonium compound (QAC) solution lower than the manufacturers recommended concentration. Standard found in 105 CMR 590; FC 4-501.114(C)(2). ** Corrected On-Site **
45. Food Service Area	Section 2	Pot/Pan Storage Room	105 CMR 451.200*	Protection of Clean Items, Storing: Pots and pans not stored in a self-draining position, items stacked wet. Standard found in 105 CMR 590; FC 4-903.11(B)(1). ** Corrected On-Site **
46. Food Service Area	Section 2	Pot/Pan Storage Room	105 CMR 451.200*	Cleaning of Equipment and Utensils, Objective: Food contact surface dirty (Pf), pots and pans stored dirty. Standard found in 105 CMR 590; FC 4-601.11(A). ** Corrected On-Site **
47. Food Service Area	Section 2	Pot/Pan Storage Room	105 CMR 451.200*	Cleaning of Equipment and Utensils, Objective: Food contact surface dirty (Pf), trays stored greasy. Standard found in 105 CMR 590; FC 4-601.11(A).

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency ** Corrected On-Site **
48. Food Service Area	Section 2	Pot/Pan Storage Room	105 CMR 451.200*	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Facility not cleaned as often as necessary, ceiling dirty. Standard found in 105 CMR 590; FC 6-501.12(A). ** Corrected On-Site **
49. Food Service Area	Section 2	Pot/Pan Storage Room	105 CMR 451.200*	Design, Construction, and Installation; Cleanability: Wall not easily cleanable, wall paint damaged. Standard found in 105 CMR 590; FC 6-201.16(A). Paint Supervisor notified – wall will be repaired – anticipated date of repair no later than 7/3/26
50. Food Service Area	Section 2	Pot/Pan Storage Room	105 CMR 451.200*	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Premises not maintained free of rodents, rodent droppings observed on floor. Standard found in 105 CMR 590; FC 6-501.111. ** Corrected On-Site **
51. Food Service Area	Section 2	Pot/Pan Storage Room	105 CMR 451.200	Cleaning of Equipment and Utensils, Objective: Food contact surface dirty (Pf), rodent droppings observed on pans. Standard found in 105 CMR 590; FC 4-601.11(A). ** Corrected On-Site **
52. Food Service Area	Section 2	Pot/Pan Storage Room	105 CMR 451.200	Cleaning of Equipment and Utensils, Objective: Food contact surface dirty (Pf), dry baskets stored greasy. Standard found in 105 CMR 590; FC 4-601.11(A). Baskets cleaned – 4/27/26
53. Food Service Area	Section 2	Pot/Pan Storage Room	105 CMR 451.200	Protection from Contamination After Receiving; Preventing Contamination from Equipment, Utensils, and Linens: Grease from dry baskets dripping onto clean items. Standard found in 105 CMR 590; FC 3-304.12(B). ** Corrected On-Site **
54. Food Service	Section 3		105 CMR 451.200*	Maintenance and Operation;

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
Area				Premises, Structure, Attachments, and Fixtures - Methods: Premises not maintained free of rodents, rodent droppings observed on rear of stove. Standard found in 105 CMR 590; FC 6-501.111. ** Corrected On-Site **
55. Food Service Area	Section 3		105 CMR 451.200	Maintenance and Operation; Equipment: Quaternary ammonium compound (QAC) solution lower than the manufacturers recommended concentration. Standard found in 105 CMR 590; FC 4-501.114(C)(2). ** Corrected On-Site **
56. Food Service Area	Section 4	Refrigerator # 1	105 CMR 451.200	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Facility not cleaned as often as necessary, ceiling dirty. Standard found in 105 CMR 590; FC 6-501.12(A). Ceiling cleaned – 5/22/26
57. Food Service Area	Section 4	Refrigerator # 2	105 CMR 451.200*	Protection from Contamination After Receiving; Preventing Contamination from Equipment, Utensils, and Linens: Utensil handle not stored above the food in the container, scoop observed in sugar and flour containers. Standard found in 105 CMR 590; FC 3-304.12(B). ** Corrected On-Site **
58. Food Service Area	Section 4	Refrigerator # 2	105 CMR 451.200	Preventing Contamination after Receiving; Preventing Food and Ingredient Contamination: Food not appropriately covered, breadcrumbs stored uncovered. Standard found in 105 CMR 590; FC 3-302.11(A)(4). ** Corrected On-Site **
59. Food Service Area	Section 4	Refrigerator # 2	105 CMR 451.200	Protection from Contamination After Receiving, Preventing Food and Ingredient Contamination: Food or food ingredients that

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
				have been removed from original packages not labeled with common name of food, bulk containers not labeled. Standard found in 105 CMR 590; FC 3-302.12. ** Corrected On-Site **
60. Food Service Area	Section 4	Refrigerator # 2	105 CMR 451.200	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Facility not cleaned as often as necessary, sugar and flour container dirty. Standard found in 105 CMR 590; FC 6-501.12(A). ** Corrected On-Site **
61. Food Service Area	Section 4	Refrigerator # 2	105 CMR 451.200	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Facility not cleaned as often as necessary, walls dirty. Standard found in 105 CMR 590; FC 6-501.12(A). Walls cleaned – 5/22/26
62. Food Service Area	Section 4	Refrigerator # 2	105 CMR 451.200	Preventing Contamination from the Premises; Food Storage: Food exposed to splash, dust, or other contamination, fans in cooler dusty. Standard found in 105 CMR 590; FC 3-305.11(A)(2). ** Corrected On-Site **
63. Food Service Area	Section 4	Refrigerator # 2	105 CMR 451.200	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Facility not cleaned as often as necessary, spilled food debris on storage pallets. Standard found in 105 CMR 590; FC 6-501.12(A). ** Corrected On-Site **
64. Food Service Area	Section 4	Refrigerator # 2	105 CMR 451.200	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Facility not cleaned as often as necessary, produce storage rack dirty. Standard found in 105 CMR 590; FC 6-501.12(A). ** Corrected On-Site **
65. Food Service Area	Section 4	Refrigerator # 2	105 CMR 451.200	Characteristics; Condition: Food not safe, unadulterated, and honestly presented (Pf), rotten

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
				produce observed. Standard found in 105 CMR 590; FC 3-101.11. ** Corrected On-Site **
66. Food Service Area	Section 4	Freezer # 4	105 CMR 451.200*	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Facility not in good repair, threshold damaged. Standard found in 105 CMR 590; FC 6-501.11. Maintenance notified – threshold will be repaired – anticipated date of repair no later than 7/3/26
67. Food Service Area	Section 5	Diet Area	105 CMR 451.200*	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Facility not in good repair, pipe insulation damaged. Standard found in 105 CMR 590; FC 6-501.11. Insulation repaired – 6/15/26
68. Food Service Area	Section 5	Diet Area	105 CMR 451.200	Limitation of Growth of Organisms of Public Health Concern, Temperature and Time Control: Time/temperature control for safety food not held at 135°F or above (Pf), temperature of chicken recorded at 88°F. Standard found in 105 CMR 590; FC 3-501.16(A)(1). ** Corrected On-Site **
69. Food Service Area	Section 5		105 CMR 451.200	Limitation of Growth of Organisms of Public Health Concern, Temperature and Time Control: Time/temperature control for safety food not held at 135°F or above (Pf), temperature of rice recorded at 111°F. Standard found in 105 CMR 590; FC 3-501.16(A)(1). ** Corrected On-Site **
70. Food Service Area	Section 5	Diet Area	105 CMR 451.200	Maintenance and Operation, Equipment: Equipment not maintained in a state of good repair, available outlet not compatible with hot holding equipment. Standard found in 105 CMR 590; FC 4-501.11(A). Compatible outlet installed –

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency 4/29/26
71. Food Service Area	Section 5	Diet Area	105 CMR 451.200	Maintenance and Operation, Equipment: Equipment components not maintained in a state of good repair, warmer gaskets dirty and damaged. Standard found in 105 CMR 590; FC 4-501.11(B). Food Service contractor notified – contractor will replace gaskets – anticipated date of repairs no later 7/15/26. Current gaskets cleaned – 4/27/26
72. Food Service Area	Section 5	Diet Area	105 CMR 451.200	Hygienic Practices Food Contamination Prevention: Food service personnel eating in an inappropriate area, employee food observed in diet area. Standard found in 105 CMR 590; FC 2-401.11(A). ** Corrected On-Site **
73. Food Service Area	Section 5	Diet Area	105 CMR 451.200	Preventing Contamination after Receiving; Preventing Food and Ingredient Contamination: Food not appropriately covered, peas stored uncovered. Standard found in 105 CMR 590; FC 3-302.11(A)(4). ** Corrected On-Site **
74. Food Service Area	Section 5	Diet Area	105 CMR 451.200	Protection of Clean Items, Storing: Food product stored in an inappropriate location, peas stored below damaged pipe. Standard found in 105 CMR 590; FC 4-903-12(A)(8). ** Corrected On-Site **
75. Food Service Area	Section 5	Dry Storage Area	105 CMR 451.200*	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures -

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
				Methods: Premises not maintained free of rodents, rodent droppings observed. Standard found in 105 CMR 590; FC 6-501.111. ** Corrected On-Site **
76. Food Service Area	Section 5	Dry Storage Area	105 CMR 451.200	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Facility not cleaned as often as necessary, spilled food observed on floor. Standard found in 105 CMR 590; FC 6-501.12(A). ** Corrected On-Site **
77. Food Service Area	Section 5	Loading Dock	105 CMR 451.200*	Design, Construction, and Installation; Functionality: Outer openings not protected against the entry of insects and rodents, garage door not rodent and weathertight. Standard found in 105 CMR 590; FC 6-202.15(A)(3). Door sweep installed- 6/15/26
78. Food Service Area	Section 6	Refrigerator # 6	105 CMR 451.200*	Maintenance and Operation, Equipment: Equipment components not maintained in a state of good repair, gaskets dirty. Standard found in 105 CMR 590; FC 4-501.11(B). Gaskets cleaned – 5/22/26
79. Food Service Area	Section 6	Refrigerator # 6	105 CMR 451.200*	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Premises not maintained free of rodents, rodent droppings observed. Standard found in 105 CMR 590; FC 6-501.111. ** Corrected On-Site **
80. Food Service Area	Section 6	Refrigerator # 6	105 CMR 451.200	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Facility not cleaned as often as necessary, ceiling dirty. Standard found in 105 CMR 590; FC 6-501.12(A). Ceiling cleaned – 5/22/26
81. Food Service Area	Section 6	Refrigerator # 6	105 CMR 451.200	Maintenance and Operation, Equipment: Equipment

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
				components not maintained in a state of good repair, fan cover not secure. Standard found in 105 CMR 590; FC 4-501.11(B). ** Corrected On-Site **
82. Food Service Area	Section 6	Refrigerator # 6	105 CMR 451.200	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Facility not cleaned as often as necessary, spilled food debris observed on floor. Standard found in 105 CMR 590; FC 6-501.12(A). ** Corrected On-Site **
83. Food Service Area	Section 6	2-Compartment Sink Area	105 CMR 451.200	Plumbing System; Operation and Maintenance: Plumbing system not maintained in good repair, left side sink out-of-order. Standard found in 105 CMR 590; FC 5-205.15(B). Sink repaired and placed back on-line 6/3/26
84. Food Service Area	Section 6	2-Compartment Sink Area	105 CMR 451.200	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Premises not maintained free of insects, drain flies observed. Standard found in 105 CMR 590; FC 6-501.111. Area cleaned – exterminator addressed violation – 6/2/26
85. Food Service Area	Section 6	2-Compartment Sink Area	105 CMR 451.200	Design, Construction, and Installation; Cleanability: Wall not easily cleanable, wall damaged. Standard found in 105 CMR 590; FC 6-201.16(A). Maintenance notified – wall be repaired - anticipated date of repairs no later than 7/10/26
86. Food Service Area	Section 6	2-Compartment Sink Area	105 CMR 451.200	Plumbing System; Operations and Maintenance: Handwashing sink not accessible (Pf), carts stored in front of handwash sink. Standard found in 105 CMR 590; FC 5-205.11(A). ** Corrected On-Site **

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
87. Food Service Area	Section 6	Prep-Refrigerators and Tray Assembly Line	105 CMR 451.200*	Protection of Clean Items, Storing: Serving Trays not stored in a self-draining position. Standard found in 105 CMR 590; FC 4-903.11(B)(1). Trays stored in self-draining position – 4/28/26
88. Food Service Area	Section 6	Prep-Refrigerators and Tray Assembly Line	105 CMR 451.200*	Design, Construction, and Installation; Functionality: Outer openings not protected against the entry of insects and rodents, exterior door not rodent and weathertight. Standard found in 105 CMR 590; FC 6-202.15(A)(3). Door sweep installed – 5/22/26
89. Food Service Area	Section 6	Prep-Refrigerators and Tray Assembly Line	105 CMR 451.200*	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Facility not cleaned as often as necessary, vent dusty above warmers. Standard found in 105 CMR 590; FC 6-501.12(A). Vent cleaned – 5/22/26
90. Food Service Area	Section 6	Prep-Refrigerators and Tray Assembly Line	105 CMR 451.200	Cleaning of Equipment and Utensils, Objective: Food contact surface dirty (Pf). trays dirty. Standard found in 105 CMR 590; FC 4-601.11(A). Trays cleaned – 4/27/26
91. Food Service Area	Section 6	Prep-Refrigerators and Tray Assembly Line	105 CMR 451.200	Maintenance and Operation, Equipment: Equipment components not maintained in a state of good repair, warmer gaskets dirty. Standard found in 105 CMR 590; FC 4-501.11(B). Gasket cleaned – 5/22/26
92. Food Service Area	Section 6	Prep-Refrigerators and Tray Assembly Line	105 CMR 451.200	Maintenance and Operation, Equipment: Equipment components not maintained in a state of good repair, cooler gaskets damaged. Standard found in 105 CMR 590; FC 4-501.11(B). Food Service contractor notified – contractor will replace gaskets – anticipated date of repairs not later than 6/30/26
93. Food Service Area	Section 6	Prep-Refrigerators and Tray Assembly Line	105 CMR 451.200	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures -

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
				Methods: Premises not maintained free of rodents, rodent droppings observed. Standard found in 105 CMR 590; FC 6-501.111. Area cleaned – exterminator addressed violation – 6/2/26
94. Food Service Area	Section 6	Prep-Refrigerators and Tray Assembly Line	105 CMR 451.200	Cleaning of Equipment and Utensils, Objective: Nonfood contact surfaces of equipment dirty, encrusted food debris on tray carts. Standard found in 105 CMR 590; FC 4-601.11(C). Tray carts cleaned – 4/27/26
95. Food Service Area	Section 6	Staff Food Line	105 CMR 451.200	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Facility not cleaned as often as necessary, floor dirty below staff line. Standard found in 105 CMR 590; FC 6-501.12(A). ** Corrected On-Site **
96. Food Service Area	Section 6	Staff Food Line	105 CMR 451.200	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Premises not maintained free of rodents, rodent droppings observed throughout area. Standard found in 105 CMR 590; FC 6-501.111. ** Corrected On-Site **
97. Food Service Area	Section 6	Staff Dining Room	105 CMR 451.200	Cleaning of Equipment and Utensils, Objective: Food contact surface dirty (Pf), hairnet used in coffee brewer. Standard found in 105 CMR 590; FC 4-601.11(A). ** Corrected On-Site **
98. Food Service Area	Section 6	Staff Dining Room	105 CMR 451.200	Protection of Clean Items, Storing: Single-Use Items not stored at least 6 inches above the floor. Standard found in 105 CMR 590; FC 4-903.11(A)(3). ** Corrected On-Site **
99. Food Service Area	Section 6	Staff Dining Room	105 CMR 451.200	Protection from Contamination After Receiving, Preventing Food and Ingredient Contamination: Food or food ingredients that have been removed from original

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
				packages not labeled with common name of food, sugar not labeled. Standard found in 105 CMR 590; FC 3-302.12. Food container labeled – 4/27/26
100. Food Service Area	Section 6	Staff Dining Room	105 CMR 451.200	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Premises not maintained free of insects, fruit flies observed. Standard found in 105 CMR 590; FC 6-501.111. Dining room cleaned - exterminator addressed violation – 6/2/26
101. Food Service Area	Section 6	Staff Food Line	105 CMR 451.200	Cleaning of Equipment and Utensils, Objective: Nonfood contact surfaces of equipment dirty, exterior of warmer dirty. Standard found in 105 CMR 590; FC 4-601.11(C). ** Corrected On-Site **
102. Food Service Area	Section 6	Staff Dining Room	105 CMR 451.200	Limitation of Growth of Organisms of Public Health Concern, Temperature and Time Control: Time/temperature control for safety food not held at 41°F or less (Pf), temperature of chicken recorded at 60°F at salad bar. Standard found in 105 CMR 590; FC 3-501.16(A)(2). ** Corrected On-Site **
103. Food Service Area	Section 6	Staff Dining Room	105 CMR 451.200	Protection from Contamination After Receiving, Preventing Food and Ingredient Contamination: Food or food ingredients that have been removed from original packages not labeled with common name of food, dressing not labeled at salad bar. Standard found in 105 CMR 590; FC 3-302.12. ** Corrected On-Site **
104. Food Service Area	Section 6	Staff Dining Room	105 CMR 451.200	Maintenance and Operation, Equipment: Equipment components not maintained in a state of good repair, refrigerator gaskets dirty and damaged. Standard found in 105 CMR 590; FC 4-501.11(B). Gasket cleaned – 5/22/26

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
105. Food Service Area	Section 6	Staff Dining Room	105 CMR 451.200	Protection from Contamination After Receiving, Preventing Food and Ingredient Contamination: Food or food ingredients that have been removed from original packages not labeled with common name of food, several items not labeled in refrigerator. Standard found in 105 CMR 590; FC 3-302.12. Food container labeled – 4/27/26
106. Food Service Area	Section 6	Staff Dining Room	105 CMR 451.200	Protection of Clean Items, Storing: Use Items not stored at least 6 inches above the floor. Standard found in 105 CMR 590; FC 4-903.11(A)(3). ** Corrected On-Site **
107. Food Service Area	Section 6	Staff Dining Room	105 CMR 451.200	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Facility not cleaned as often as necessary, ceiling dirty around vent. Standard found in 105 CMR 590; FC 6-501.12(A). Ceiling cleaned – 5/22/26
108. Culinary Arts Kitchen	Slop Sink		105 CMR 451.200	Maintenance and Operation; Premises, Structure, Attachments, and Fixtures - Methods: Wet mop stored in slop sink. Standard found in 105 CMR 590; FC 6-501.16. Mop removed and stored appropriately – 5/22/26
109. Culinary Arts Kitchen	Bathroom		105 CMR 451.123	Maintenance: Floor dirty Floor cleaned -5/22/26
110. Culinary Arts Kitchen	Classroom Section		105 CMR 451.200	Design, Construction, and Installation; Functionality: Outer openings not protected against the entry of insects and rodents, exterior door not rodent and weathertight. Standard found in 105 CMR 590; FC 6-202.15(A)(3). Door sweep installed – 5/22/26

Building #6**Deficiencies under the Required Standards (.100 and .200 series)**

6 new deficiencies and 1 repeat deficiency (indicated by an *) were found during the inspection:

Area	Sub Area # 1	Regulation	Description of Deficiency
1. Health Services Medical Area	Inmate Bathroom # 6229	105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, handwash sink leaking Maintenance notified – sink will repaired– anticipated date of repairs no later than 7/3/26
2. Health Services Medical Area	Inmate Bathroom # 6229	105 CMR 451.123	Maintenance: Ceiling vent dusty Vent cleaned – 5/23/26
3. Medical Unit	Room # 6258	105 CMR 451.200	Food Storage, Preparation and Service: Food preparation not in compliance with 105 CMR 590.000, interior of microwave oven dirty Microwave cleaned – 4/28/26
4. Medical Unit	Shower Area	105 CMR 451.123	Maintenance: Ceiling vent dusty in shower # 1 Vent cleaned – 5/22/26
5. Medical Unit	Cells	105 CMR 451.103	Mattresses: Mattress damaged in cell # 8 and 12 Mattresses replaced – 5/22/26
6. Booking Area	Staff Bathroom # 6135	105 CMR 451.130*	Plumbing: Plumbing not maintained in good repair, water control not secure at handwash sink Control secured – 6/4/26

Deficiencies under the Recommended Standards (.300 series)

10 new deficiencies and 3 repeat deficiencies (indicated by an *) were found during the inspection:

Area	Sub Area # 1	Regulation	Description of Deficiency
1. Medical Unit	Hallway	105 CMR 451.353	Interior Maintenance: Ceiling vent dusty Vent cleaned – 5/23/26
2. Medical Unit	Room # 6258	105 CMR 451.353	Interior Maintenance: Ceiling vent blocked Vent cleared – 5/23/26
3. Medical Unit	Isolation Cells (# 3 and 5)	105 CMR 451.353	Interior Maintenance: Ceiling vent blocked in cell # 5 Vent cleared – 5/23/26
4. Medical Unit	Isolation Cells (# 3 and 5)	105 CMR 451.353	Interior Maintenance: Ceiling vent dusty outside of cell # 5 and 7 Vent cleaned – 5/23/26
5. Medical Unit	Medical Waste/Biohazard Storage # 6250	105 CMR 451.353*	Interior Maintenance: Ceiling vent dusty Vent cleaned – 5/23/26
6. Medical Unit	Chemical Storage Room # 6248	105 CMR 451.353	Interior Maintenance: Ceiling vent dusty Vent cleaned – 5/23/26
7. Medical Unit	Inmate Property # 6246	105 CMR 451.360*	Protective Measures: Rodent droppings observed Area cleaned – exterminator addressed the violation – 6/2/26
8. Medical Unit	Cells	105 CMR 451.353	Interior Maintenance: Ceiling vent blocked in cell # 2 and 9 Vents cleared – 5/23/26
9. Medical Unit	Cells	105 CMR 451.353	Interior Maintenance: Ceiling vent dusty in cell # 13 Vent cleaned – 5/23/26
10. Medical Unit	Cells	105 CMR 451.353	Interior Maintenance: Objectionable odor observed in cell # 18 Odor mitigated – 4/28/26

Area	Sub Area # 1	Regulation	Description of Deficiency
11. Booking Area	Male Property Room # 6106	105 CMR 451.353*	Interior Maintenance: Ceiling water damaged Ceiling repaired – 6/2/26

Deficiencies under 105 CMR 451.402(B) (other conditions that may constitute a threat to health or safety)

1 new deficiency was found during the inspection:

Area	Sub Area # 1	Regulation	Description of Deficiency
1. Medical Unit	Medical Waste/Biohazard Storage # 6250	105 CMR 451.402(B)	Storage Area: Storage area not used exclusively for waste storage, clean blankets and clothing stored on top of full biohazard boxes. Standard found in 105 CMR 480.100(B). Clean blankets and clothing removed – 4/28/16

Building # 7

Deficiencies under the Recommended Standards (.300 series)

1 new deficiency and 1 repeat deficiency (indicated by an *) were found during the inspection:

Area	Sub Area # 1	Regulation	Description of Deficiency
1. Vehicle Trap	1st Floor	105 CMR 451.353*	Interior Maintenance: Ceiling water damaged Ceiling repaired – 6/2/26
2. Vehicle Trap	2nd Floor	105 CMR 451.353	Interior Maintenance: Ceiling water damaged Ceiling repaired – 6/2/26

Building # 8

Deficiencies under the Required Standards (.100 and .200 series)

22 new deficiencies and 19 repeat deficiencies (indicated by an *) were found during the inspection:

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
1. 1st Floor - Unit 8-1	Staff Area	Staff Bathroom # 8-106	105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, handwash sink leaking Sink repaired – 6/4/26
2. 1st Floor - Unit 8-1	Common Area		105 CMR 451.200	Food Storage, Preparation and Service: Food preparation not in compliance with 105 CMR 590.000, interior of microwave oven dirty Microwave cleaned – 4/29/26
3. 1st Floor - Unit 8-1	Common Area		105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, bubbler # 2 clogged Bubbler unclogged- 6/3/26
4. 1st Floor - Unit 8-1	Housing Area	Inmate Bathroom # 8-122	105 CMR 451.123	Maintenance: Wall vent dusty above showers Vent cleaned – 5/23/26
5. 2nd Floor - Unit 8-2	Staff Area	Staff Bathroom # 8-206	105 CMR 451.123*	Maintenance: Ceiling vent dusty Ceiling repaired – 6/2/26
6. 2nd Floor -	Common Area	Recreation Room #	105 CMR 451.200	Food Storage, Preparation and

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
Unit 8-2		8-215		Service: Food preparation not in compliance with 105 CMR 590.000, interior of microwave oven dirty Microwave cleaned – 4/29/26
7. 2nd Floor - Unit 8-2	Housing Area	Inmate Bathroom # 8-221	105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, water control leaking at handwash sink # 2 Sink Repaired – 6/4/26
8. 2nd Floor - Unit 8-2	Housing Area	Inmate Bathroom # 8-221	105 CMR 451.123	Maintenance: Wall vent dusty above showers Vent cleaned – 5/22/26
9. 2nd Floor - Unit 8-2	Housing Area	Inmate Bathroom # 8-222	105 CMR 451.123	Maintenance: Wall vent dusty above showers Vent cleaned – 5/22/26
10. 2nd Floor - Unit 8-2	Housing Area	Cells	105 CMR 451.103	Mattresses: Mattress damaged in cell # 1 Mattress replaced – 5/23/26
11. 3rd Floor - Unit 8-3	Common Area	Recreation Room # 8-316	105 CMR 451.200*	Food Storage, Preparation and Service: Food preparation not in compliance with 105 CMR 590.000, interior of microwave oven dirty Microwave cleaned – 4/29/26
12. 3rd Floor - Unit 8-3	Housing Area	Inmate Bathroom # 8-322	105 CMR 451.123*	Maintenance: Floor dirty outside showers Floor cleaned – 4/29/26
13. 3rd Floor - Unit 8-3	Housing Area	Inmate Bathroom # 8-322	105 CMR 451.123*	Maintenance: Wall vent dusty above showers Vent cleaned – 5/23/26
14. 3rd Floor - Unit 8-3	Housing Area	Inmate Bathroom # 8-322	105 CMR 451.123	Maintenance: Walls dirty in shower # 2 and 4 Walls cleaned – 4/29/26
15. 3rd Floor - Unit 8-3	Housing Area	Inmate Bathroom # 8-322	105 CMR 451.123	Maintenance: Curtain dirty in shower # 4 Curtin replaced – 5/23/26
16. 3rd Floor - Unit 8-3	Housing Area	Inmate Bathroom # 8-322	105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, water control leaking at handwash sink # 2 Sink Repaired – 6/4/26
17. 3rd Floor - Unit 8-3	Housing Area	Inmate Bathroom # 8-322	105 CMR 451.130	Plumbing: Plumbing not maintained in good repair, shower # 5 continuously running Shower repaired – 6/1/26
18. 3rd Floor - Unit 8-3	Housing Area	Inmate Bathroom # 8-322	105 CMR 451.130	Hot Water: Shower water temperature 121°F at shower # 5 Water temperature adjusted to meet the appropriate regulatory requirements – 6/15/26
19. 3rd Floor - Unit 8-3	Housing Area	Inmate Bathroom # 8-321	105 CMR 451.123*	Maintenance: Walls dirty in shower # 1, 3, and 5 Walls cleaned – 4/29/26
20. 4th Floor - Unit 8-4	Housing Area	Bathroom # 8-421	105 CMR 451.123	Maintenance: Floor dirty throughout bathroom

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
				Floor cleaned – 4/29/26
21. 4th Floor - Unit 8-4	Housing Area	Bathroom # 8-421	105 CMR 451.123*	Maintenance: Wall vent dusty above shower Vent cleaned – 5/23/26
22. 4th Floor - Unit 8-4	Housing Area	Bathroom # 8-421	105 CMR 451.123*	Maintenance: Walls dirty in shower # 1, 2, 3, 4, and 5 Walls cleaned – 4/29/26
23. 4th Floor - Unit 8-4	Housing Area	Bathroom # 8-421	105 CMR 451.123*	Maintenance: Floor dirty in shower # 1 Floor cleaned – 4/29/26
24. 4th Floor - Unit 8-4	Housing Area	Bathroom # 8-422	105 CMR 451.123*	Maintenance: Wall vent dusty above shower Vent cleaned – 5/23/26
25. 4th Floor - Unit 8-4	Housing Area	Bathroom # 8-422	105 CMR 451.123*	Maintenance: Area around handwash sinks dirty Area cleaned – 4/29/26
26. 4th Floor - Unit 8-4	Housing Area	Bathroom # 8-422	105 CMR 451.123*	Maintenance: Floor stained Floor cleaned – 5/23/26
27. 4th Floor - Unit 8-4	Housing Area	Bathroom # 8-422	105 CMR 451.123*	Maintenance: Light near showers damaged and dirty Light repaired and cleaned – 5/23/26
28. 4th Floor - Unit 8-4	Housing Area	Bathroom # 8-422	105 CMR 451.123*	Maintenance: Ceiling damaged Maintenance notified – ceiling will be repaired – anticipated date of repairs no later than 7/6/26
29. 4th Floor - Unit 8-4	Housing Area	Bathroom # 8-422	105 CMR 451.123	Maintenance: Walls dirty near handwash sinks Walls cleaned – 4/29/26
30. 4th Floor - Unit 8-4	Housing Area	Bathroom # 8-422	105 CMR 451.123	Maintenance: Walls dirty in shower # 1, 2, 3, 4, and 5 Walls cleaned – 4/29/26

Deficiencies under the Recommended Standards (.300 series)

17 new deficiencies and 3 repeat deficiencies (indicated by an *) were found during the inspection:

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
1. Building Entrance			105 CMR 451.350*	Structural Maintenance: Left side exterior door at entrance damaged Maintenance notified – door will be repaired – anticipated date of repairs no later than 7/6/26
2. 1st Floor - Unit 8-1	Common Area	Office # 8-115	105 CMR 451.353	Interior Maintenance: Ceiling vent blocked Vent cleared – 4/29/26
3. 1st Floor - Unit 8-1	Common Area	Staff Break Room # 8-116	105 CMR 451.353	Interior Maintenance: Ceiling vent dusty Vent cleaned – 5/23/26
4. 1st Floor - Unit 8-1	Common Area	Slop Sink Room # 8-123	105 CMR 451.353	Interior Maintenance: Wet mop stored in bucket Mop removed and stored appropriately – 4/29/26
5. 2nd Floor - Unit	Staff Area	Property # 8-211	105 CMR 451.344*	Illumination in Habitable Areas:

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
8-2				Light(s) not functioning properly, light out Light repaired – 6/4/26
6. 2nd Floor - Unit 8-2	Staff Area	Electrical # 8-226	105 CMR 451.353	Interior Maintenance: Ceiling vent dusty Vent cleaned – 5/23/26
7. 2nd Floor - Unit 8-2	Common Area		105 CMR 451.353*	Interior Maintenance: Floor tiles damaged throughout Tiles repaired – 5/28/26
8. 2nd Floor - Unit 8-2	Common Area	Recreation Room # 8-215	105 CMR 451.353	Interior Maintenance: Ceiling vent dusty Vent cleaned – 5/23/26
9. 2nd Floor - Unit 8-2	Common Area	Laundry Area	105 CMR 451.353	Interior Maintenance: Area around handwash sink dirty Area cleaned – 4/29/26
10. 2nd Floor - Unit 8-2	Housing Area	Slop Sink # 8-223	105 CMR 451.353	Interior Maintenance: Ceiling vent dusty Vent cleaned – 5/23/26
11. 3rd Floor - Unit 8-3	Common Area	Recreation Room # 8-315	105 CMR 451.353	Interior Maintenance: Ceiling vent dusty Vent cleaned – 5/23/26
12. 3rd Floor - Unit 8-3	Common Area	Recreation Room # 8-316	105 CMR 451.353	Interior Maintenance: Padding damaged on exercise machine Maintenance notified – padding will be repaired – anticipated date of repairs no later than 7/6/26
13. 3rd Floor - Unit 8-3	Common Area	Laundry Area	105 CMR 451.353	Interior Maintenance: Area around handwash sink dirty Area cleaned – 4/29/26
14. 3rd Floor - Unit 8-3	Common Area	Laundry Area	105 CMR 451.360	Protective Measures: Rodent droppings observed Area cleaned – exterminator addressed the violation – 6/2/26
15. 3rd Floor - Unit 8-3	Housing Area	Slop Sink Room # 8-323	105 CMR 451.353	Interior Maintenance: Wet mop stored upside down Mop removed from upside down position and stored properly – 4/27/26
16. 3rd Floor - Unit 8-3	Housing Area	Slop Sink Room # 8-323	105 CMR 451.353	Interior Maintenance: Wet mop stored in bucket Mop removed and stored appropriately – 4/29/26
17. 3rd Floor - Unit 8-3	Housing Area	Slop Sink Room # 8-323	105 CMR 451.353	Interior Maintenance: Standing water stored in mop bucket Water removed – 4/29/26
18. 4th Floor - Unit 8-4	Common Area	TV Room # 8-415	105 CMR 451.353	Interior Maintenance: Floor dirty Floor cleaned – 4/29/26
19. 4th Floor - Unit 8-4	Common Area	TV Room # 8-416	105 CMR 451.353	Interior Maintenance: Ceiling vent dusty Vent cleaned – 5/23/26

Area	Sub Area # 1	Sub Area # 2	Regulation	Description of Deficiency
20. 4th Floor - Unit 8-4	Housing Area		105 CMR 451.353	Interior Maintenance: Floor dirty throughout Floor cleaned – 4/29/26

SECTION 2: Areas Found to be in Compliance

EHRHS inspected 272 additional areas of the facility which were found to be in compliance

SECTION 3: Areas EHRHS did not Inspect

EHRHS did not inspect 3 areas of the facility because they were either in use, locked, or under construction.

Area	Sub Area # 1	Sub Area # 2	Sub Area # 3	Description of Deficiency
1. Building # 1	11th Floor	Unit 1-11-2	Kitchenette	Unable to Inspect – In Use
2. Building # 1	2nd Floor	Unit 1-2-1	Bathroom # 235	Unable to Inspect – In Use
3. Building # 8	1st Floor - Unit 8-1	Housing Area	Inmate Bathroom # 8-121	Unable to Inspect – In Use

SECTION 4: Plan of Correction

This facility does not comply with the Department’s regulations cited above. In accordance with 105 CMR 451.404, please submit a plan of correction within 10 working days of receipt of this notice which includes:

1. Specific corrective steps to be taken
2. A timetable for the corrective actions for larger projects
3. The date by which correction will be achieved
4. Any interim measures being implemented to ensure the health and safety of incarcerated individuals and facility staff
5. A signature by the Superintendent or Administrator responsible for the plan. The signed plan should be submitted to my attention, at the address listed above.

SECTION 5: Observations and Recommendations

1. The inmate population was 1093 at the time of inspection.
2. During the facility inspection, the EHRHS noted numerous deficiencies related to cleanliness. The conditions noted throughout the facility can lead to bacterial growth and pest infestation, increasing the risk of illness for staff and inmates. The EHRHS suggests a routine cleaning schedule be developed and implemented to ensure all areas of the facility are cleaned at a higher frequency.
3. During the inspection of the food service area, the EHRHS noted numerous deficiencies related to improper food serving procedures and failure to properly clean and sanitize surfaces and equipment. The conditions noted throughout the food service area can lead to cross contamination and pathogen growth, increasing the risk of foodborne illness or injury. The EHRHS recommends:
 - A routine cleaning schedule be developed and implemented to ensure all areas of the kitchen are cleaned at a higher frequency; and
 - Kitchen management develop a program and train staff on proper food serving temperatures and record keeping protocols.

To review the specific regulatory requirements, please visit the [Massachusetts Department of Public Health Regulatory and Compliance Unit](#) and [read the minimum health and sanitation standards for correctional facilities](#) available in both PDF and RTF formats. For more specific information about the food standards, you can [download the merged food code](#).

An inspection may also include observations of other conditions which could constitute a threat to the health or safety of inmates or employees, including but not limited to the standards set forth by the Department as follows, and report on such pursuant to 451.402(B). You can use these links below to review these standards:


- [105 CMR 205.000](#): Minimum Standards Governing Medical Records and Conduct of Physical Examinations in Correctional Facilities
- [105 CMR 480.000](#): Minimum requirements for the Management of Medical or Biological Waste
- [105 CMR 500.000](#): Good Manufacturing Practices for Food

This inspection report is true and accurate to the best of my knowledge.

Sincerely,



Hannah LeBeau
Environmental Health Officer, EHRS, BCEH

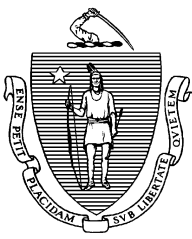

The Commonwealth of Massachusetts
Executive Office of Health and Human Services
Department of Public Health
Bureau of Climate and Environmental Health
Division of Environmental Health Regulations and Standards
67 Forest Street, Suite # 100
Marlborough, MA 01752
617-624-6000 | mass.gov/dph

Maura T. Healey
Governor

Kiame Mahaniah, MD, MBA
Secretary

Kimberley Driscoll
Lieutenant Governor

Robert Goldstein, MD, PhD
Commissioner

July 10, 2026

Steven W. Tompkins, Sheriff
Suffolk County Sheriff's Department
20 Bradston Street
Boston, MA 02118 (electronic copy)

Re: Plan of Correction – Suffolk County House of Correction, Boston

Dear Sheriff Tompkins:

The Massachusetts Department of Public Health, Division of Environmental Regulations and Standards (EHRS) has received your Plan of Correction dated June 25, 2026. After review, the EHRS finds the plan addresses all the deficiencies noted.

Thank you for your prompt attention to this matter, should you have any questions please contact me at the address listed above.

Sincerely,

A handwritten signature in blue ink that reads "Hannah LeBeau".

Hannah LeBeau
Environmental Health Officer, EHRS, BCEH

cc: Michael Lally, Superintendent
Sergeant Tyler Crocker, EHSO/FSO

(electronic copy)
(electronic copy)